


Phase I Environmental Site Assessment Report

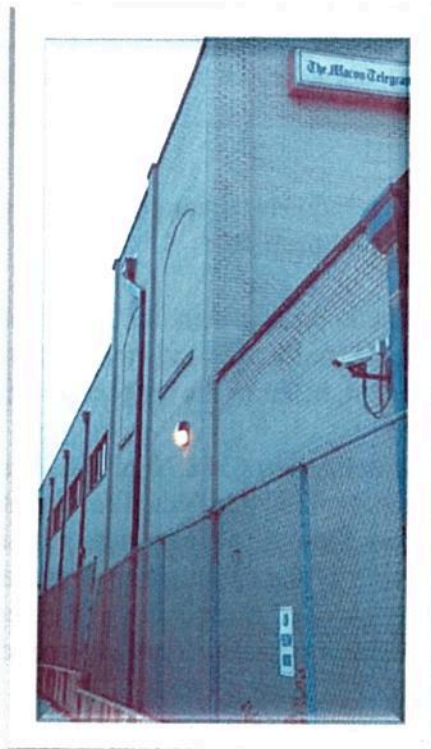

Former Macon Telegraph Publishing Company & Adjacent Parking Lots

120 Broadway • 139 Broadway
415 Walnut Street • 179 Fifth Street
Macon, Bibb County, Georgia 31201

GA EPD HSI Number: N/A

SUBMITTED TO:

Ms. Julie Moore
Macon-Bibb County
700 Poplar Street
Macon, Georgia 31201

SUBMITTED BY:

Resolute

Environmental & Water Resources Consulting

1001 Weatherstone Parkway, Suite 410
Woodstock, Georgia 30188
Telephone: 678.398.9942

Checklist for Phase I Site Assessments Conducted using EPA Brownfields Assessment Grant Funds

Contact Information

Grantee Name: Macon-Bibb County

Grant Number: BF-00D32515

ACRES Property ID: 228298

Program Manager Name: Juile Moore
(Point of Contact)

Contact Phone Number: 478-751-7170

Name / Address of Property Assessed: Macon Telegraph/ 120 Broadway, Macon, Ga 31201

Checklist

Please indicate that each of the following All Appropriate Inquiries documentation requirements were met for the Phase I assessment conducted at the above listed property:

- ☒ An *opinion* as to whether the inquiry has identified conditions indicative of releases or threatened releases of hazardous substances, and as applicable, pollutants and contaminants, petroleum or petroleum products, or controlled substances, on, at, in, or to the subject property.
- ☒ An identification of "*significant*" *data gaps* (as defined in §312.10 of AAI final rule and §12.7 of ASTM E1527-05 and E1527-13), if any, in the information collected for the inquiry, as well as comments regarding the significance of these data gaps. Significant data gaps including missing and unattainable information that affects the ability of the environmental professional to identify conditions indicative of releases or threatened releases of hazardous substances, and as applicable, pollutants and contaminants, petroleum or petroleum products, or controlled substances, on, at, in, or to the subject property.
- ☒ **Qualifications and signature** of the environmental professional(s). The environmental professional must place the following statements in the document and sign the document:
 - ☒ "[I, We] declare that, to the best of [my, our] professional knowledge and belief, [I, we] meet the definition of Environmental Professional as defined in §312.10 of this part."
 - ☒ "[I, We] have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. [I, We] have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312."

Note: Please use either "I" or "We."
- ☒ In compliance with §312.31(b) of the AAI final rule and §12.6.1 of ASTM E1527-05 and E1527-13, the environmental professional must include in the final report an *opinion regarding additional appropriate investigation*, if the environmental professional has such an opinion.

Juile Moore
Signature of Grantee Program Manager

1-26-17
Date

TABLE OF CONTENTS

Executive Summary	iii
1.0 Introduction	1
1.1 Purpose	1
1.2 Detailed Scope of Services	1
1.3 Significant Assumptions	2
1.4 Limitations & Exceptions	2
1.4.1 Limitations	2
1.4.2 Exceptions, Deviations, and/or Data Gaps	2
1.5 Special Terms & Conditions	2
1.6 User Reliance	2
2.0 Site Description	4
2.1 Location & Legal Description	4
2.2 Site & Vicinity General Characteristics	4
2.3 Current Use of the Property	4
2.4 Descriptions of Roads & Other Improvements on the Site	5
2.5 Current Uses of Adjoining Properties	5
3.0 User Provided Information	7
3.1 Title Records	7
3.2 Environmental Liens or Activity and Use Limitations	7
3.3 Specialized Knowledge	7
3.4 Commonly Known/Reasonably Ascertainable Information	7
3.5 Valuation Reduction for Environmental Issues	8
3.6 Owner, Property Manager, and Occupant Information	8
3.7 Reason for Performing Phase I Assessment	8
4.0 Records Review	9
4.1 Standard Environmental Record Sources	9
4.2 Additional Environmental Record Sources	16
4.2.1 January 2011 CAP-B Progress Report	17
4.3 Physical Setting Source(s)	17
4.4 Historical Use Information on the Property	18
4.4.1 Sanborn® Fire Insurance Maps	18

4.4.2	Historical topographic map review	20
4.4.3	Aerial Photography Review	20
4.5	Potential Vapor Impact	21
5.0	Site Reconnaissance	22
5.1	Methodology & Limiting Conditions	22
5.2	General Site Settings	22
5.3	Additional & Non-ASTM Issues	24
6.0	Interviews	25
6.1	Interviews with Owner	25
6.2	Interviews with Others	25
7.0	Findings & Opinion	27
7.1	Findings	27
7.2	Opinion	27
7.3	Next Steps	28
8.0	References	29
9.0	Qualifications & Signature of Environmental Professional	30

FIGURES

- Figure 1** Site Location
Figure 2 Site Plan

APPENDICES

- Appendix A** Access Agreement
Appendix B Photo Log
Appendix C All Appropriate Inquiry Questionnaire
Appendix D EDR Report
Appendix E Corrective Action Plan Part B Progress Report #9 (January 2011)
Appendix F Coldwell Banker Commercial Property Listing

EXECUTIVE SUMMARY

Resolute Environmental and Water Resources Consulting, LLC (Resolute) has completed a Phase I Environmental Site Assessment (ESA) of the subject group of parcels known as the Former Macon Telegraph Publishing Company & Adjacent Parking Lots at 120 Broadway (Main building), 139 Broadway (Riverside Drive parking lot), 415 Walnut Street (Former fueling station), and 179 Fifth Street (MLK Jr Blvd parking lot) in Macon, GA 31201. The study area is herein referred to as “the subject property”, “the property”, or “the site.” The site consists of approximately four acres of commercially developed land in a Central Business District 1 (CBD-1) zoned area. This assessment was performed under and was funded by the FY2015 Macon-Bibb County Environmental Protection Agency (EPA) Brownfield Assessment Grant. The subject site was selected for assessment as it was identified as pivotal property in downtown Macon.

This assessment was performed to identify potential impairment and liabilities associated with the property due to contamination by hazardous substances, controlled substances or petroleum products on or near the site. This report meets the general requirements for conducting all appropriate inquiry (AAI) into the previous ownership, uses, and environmental conditions of a property, as specified in 40 CFR Part 312, Standards and Practices for All Appropriate Inquiries. This work was conducted by or under the responsible charge of an environmental professional as defined in 40 CFR §312.10.

As a part of the assessment, Resolute commissioned a report from Environmental Data Resources (EDR) that included a regulatory database report of all listed sites in the area; a list of the historical city directories for the surrounding area; and historical topographic, aerial, and Sanborn® Fire Insurance maps of the subject and neighboring properties. In reviewing these reports, and through a comprehensive site investigation by Resolute personnel, the assessment has revealed potential RECs at the subject property as defined by the ASTM Standard Practice E1527-13. These RECs are as follows:

- The removed tanks and abandoned SVE & air sparge soil and groundwater remediation system associated with the fueling station located at 415 Walnut Street with state LUST & UST programs constitute a controlled historical REC.
- A single railroad track observed leading from the eastern edge of the main building to the eastern edge of the parcel boundary, coupled with historical use of parts of 120 Broadway as a freight station. This historical use together with the former presence of above ground storage tanks and a barrel storage building on the property constitutes a REC.
- The main building’s historical use as a publishing company including sumps, the presence of chemicals associated with newspaper production, and black staining & concrete rubble in vicinity of floor drains in the pressroom constitute an additional REC.
- The former use of 139 Broadway as an auto body/repair shop and car lot in the 1960s constitutes a REC.
- Numerous potential off-site sources of soil and ground water contamination ranging from active and historic dry cleaning facilities to active and closed underground storage tanks.

Based on the findings of this assessment, additional investigation/action is warranted in order to prevent further impact to the property and/or to determine if the referenced factors associated with the RECs have affected and/or continue to effect the environmental integrity of the site. More specifically, Resolute is of the opinion that the following actions are warranted prior to property transfer or redevelopment:

- Historic site uses ranging from the fueling station, the 1960s era auto body shop, the historic rail terminal, and the Macon Telegraph printing operations, together with the likely off site sources of contamination suggest the potential for the presence of soil, ground water, and/or vapor encroachment. As a result, it is recommended that a subsurface soil and ground water monitoring investigation be performed in order to begin to determine the extent and degree of environmental impact.
- The potential for vapor encroachment from both on and off site sources exists. As such, vapor intrusion pathways should be investigated and considered with respect to future use and development of the site.
- The contents of the standing water in the two sumps in the main building (subfloor warehouse & ink storage room) should be characterized and properly managed.
- Labeled containers/drums should be removed and properly disposed.
- Unlabeled containers/drums should be characterized and properly disposed.
- The black staining & concrete rubble in the pressroom indicative of heavy machinery should be characterized. If floor cracking or a different route of soil exposure is identified after the rubble is removed impacts to site soil and/or groundwater should be evaluated.
- The dielectric fluid in the transformers located in the basement of the main building along the interior of its western wall should be tested for the presence of PCBs & characterized for disposal.

As the goal of the County's EPA grant program is to gather environmental data which can ultimately serve to move sites toward cleanup and redevelopment, transitioning the subject site into the Georgia Brownfield Program should also be considered. Doing so may expedite cleanup and position the site for future re-development.

1.0 INTRODUCTION

1.1 PURPOSE

The purpose of this Phase I Environmental Site Assessment (ESA) is to gather sufficient information in order to develop a professional opinion about the subject property, and to identify any readily apparent or potential recognized environmental conditions (RECs) that may affect the future usability of the property. RECs are defined by the ASTM as such:

"The term recognized environmental conditions means the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, ground water, or surface water of the property. The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include de minimis conditions that generally do not present a threat to human health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies."

This assessment was performed under and was funded by the FY2015 Macon-Bibb County Environmental Protection Agency (EPA) Brownfield Assessment Grant. The subject group of parcels known as the Former Macon Telegraph Publishing Company & Adjacent Parking Lots at 120 Broadway (Main building), 139 Broadway (Riverside Drive parking lot), 415 Walnut Street (Former fueling station), and 179 Fifth Street (MLK Jr Blvd parking lot) was selected for assessment as it was identified as pivotal property in downtown Macon.

1.2 DETAILED SCOPE OF SERVICES

The Phase I ESA was conducted by Resolute in general accordance with the ASTM Standard Practice E 1527-13. The purpose of the ESA was to identify recognized environmental conditions in connection with the Site at the time of the site reconnaissance. The scope of the ESA includes an evaluation of the following:

- Physical setting characteristics of the Site through a review of referenced sources such as topographic maps and geologic, soils and hydrologic reports.
- Usage of the Site, adjoining properties and surrounding area through a review of reasonably ascertainable historical sources such as land title records, fire insurance maps, city directories, aerial photographs, prior reports and interviews.
- Observations and interviews regarding current Site usage and conditions including: the use, treatment, storage, disposal or generation of hazardous substances, petroleum products, hazardous wastes, nonhazardous solid wastes and wastewater.
- Observations and interviews regarding usage of adjoining and surrounding area properties and the likely impact of known or suspected releases of hazardous substances or petroleum products from those properties on the Site.

- Information in ASTM-specified environmental agency databases and local environmental records, within the ASTM-specified approximate minimum search distance from the Site.

Preparation of this written report that includes findings, opinions, conclusions and supporting documentation.

1.3 SIGNIFICANT ASSUMPTIONS

While this report provides an overview of present and potential environmental concerns, the report is limited by the information that was available at the time of the assessment and associated site reconnaissance. Unreported or illegal contamination or disposal of contaminated goods could alter the environmental status of the subject property, and may have not been identified by this assessment. No scope of work, no matter how broad, could uncover all potential RECs at a property if they occurred illegally. The contents of this report are based on a scope of work provided to the Macon-Bibb County (Client) in Resolute's proposal to and associated contract for the project, as well as the access agreement between 120 Macon MRP c/o WhiteStar Advisors LLC and Macon-Bibb County (Appendix A). It is further assumed that the Client and any designated parties will read the report in its entirety.

1.4 LIMITATIONS & EXCEPTIONS

1.4.1 Limitations

The information presented in this assessment was gathered from and relies upon information that was readily available at the time assessment. Unless explicitly included in the scope of services, no investigation into the validity, completeness, or willful withholding of information was made. Thus, the findings and opinions presented in this report are limited to the available information, and Resolute reserves the right to amend its findings and opinions should new information be presented at a later date.

1.4.2 Exceptions, Deviations, and/or Data Gaps

No exceptions are necessary, as sufficient information was available to form an opinion concerning the environmental state of the subject property.

1.5 SPECIAL TERMS & CONDITIONS

No special terms or contractual conditions outside of the detailed scope of services were agreed upon by Resolute and the Client at the time of assessment.

1.6 USER RELIANCE

This report may be relied upon and distributed by the Client and any personnel authorized by them. Use of or reliance on the information or conclusions presented in this assessment is not authorized without the explicit written consent of Resolute. This reliance is valid only as a description of the subject property and any described potential or actual environmental conditions present. This report has no other purpose and should not be used for any other than those listed above.

This assessment was performed in accordance with generally accepted practices for similar studies performed in a similar time frame and geographic region, and Resolute observed that a similar degree of skill and care was taken on this project as would be under similar conditions or circumstances. No other warranty is expressed or implied.

2.0 SITE DESCRIPTION

2.1 LOCATION & LEGAL DESCRIPTION

The site spans four street addresses in Macon, Georgia, 31201: 120 Broadway, 139 Broadway, 415 Walnut Street, and 179 Fifth Street. The site location is illustrated in Figure 1, and a site plan illustrating observed conditions is included as Figure 2. The property identification numbers, provided by the Macon-Bibb Tax assessor's office, are specified as follows:

Tax Parcel ID	120 Broadway (Main Building)	R073-0118
	139 Broadway (Riverside Drive Parking Lot)	R073-0117
	415 Walnut Street (Former Fueling Station)	R073-0112
	179 Fifth Street (MLK Jr Blvd Parking Lot)	R073-0129

2.2 SITE & VICINITY GENERAL CHARACTERISTICS

The site, approximately four acres in size, is commercially developed in Central Business District 1 (CBD-1) zoning classification and is bounded by Riverside Drive to the North, Martin Luther King Jr Boulevard to the East, Walnut Street to the South, and 3rd Street Lane to the West. The 140,000± ft² three-story former Macon Telegraph newspaper office/distribution building with basement is the main site feature. The building was used to produce newspapers until April 2009, and was retained as office space for the Telegraph until 2011 when its remaining employees vacated and the property was incorporated as an asset of the company pension plan. The main building HVAC is a central, electric unit powered by Constellation Natural Gas. Macon Water Authority provides water to the main building. A former fueling station used by Macon Telegraph in the Broadway parking lot at Walnut Street (location shown in Figure 2) is another significant site feature.

Adjacent properties include Macon Machine Shop to the South of the main building, Marathon Gas to the East of the MLK Jr Blvd parking lot, former Saf-T-Oil filling station to the south of the MLK Jr Blvd parking lot, One Hour Valet dry cleaners to the south of the former fueling station, the Bibb County Tag Office to the west of the former fueling station, and Macon Occupational Medicine to West of the Riverside Drive parking lot. The site vicinity can be seen in Figure 1, and a full list of known adjacent properties uses is detailed in Section 2.5. A photo log illustrating site conditions at the time of reconnaissance is included as Appendix B.

2.3 CURRENT USE OF THE PROPERTY

The eastern portion of the basement level of the main building (facing MLK Jr Blvd) is used by a contractor independent of the Telegraph as a distribution center for the newspaper. Macon Telegraph plans to retain the space as a distribution center until the building is sold. The fueling station in the Broadway parking lot at Walnut Street is formerly occupied and is surrounded by an abandoned vapor extraction, air sparge, and groundwater treatment system.

2.4 DESCRIPTIONS OF ROADS & OTHER IMPROVEMENTS ON THE SITE

Broadway Street separates the eastern portion of the site containing the main building & MLK Jr Blvd parking lot from the western portion of the site containing the former fueling station in the Broadway parking lot at Walnut Street & the Riverside Drive parking lot to the West. Riverside Dr Lane separates the northeastern portion of the site containing the main building from the southeastern portion of the site containing the MLK Jr Blvd parking lot.

2.5 CURRENT USES OF ADJOINING PROPERTIES

A summary of the properties adjacent to the site are listed below. A review of the historical uses of the adjacent properties is discussed in Section 4.4.2 of this report.

Adjacent properties to the North include:

- Riverside Drive
- Norfolk Southern railroad tracks (overhead)
- Charles H Jones Gateway Park at Riverside Drive

Adjacent properties to the East include:

- Martin Luther King Jr Boulevard
- Norfolk Southern railroad tracks
- Marathon Gas, 277 Walnut St

Adjacent properties to the South include:

- Walnut Street
- Saf-T-Oil filling station (former) at corner of Walnut St & MLK Jr Blvd
- Macon Machine Shop, 313 Walnut St
- Off Broadway, between Riverside Dr Lane & Walnut St:
 - Tidwell-Chandler Insurance
 - Smith & Watson Printing
 - Gulf Fish Company
 - car wash
- Riverview Hotel & Event Center, 205 Broadway
- One Hour Valet dry cleaner, 444 Walnut St

Adjacent properties to the West include:

- Bibb County Tag Office, 188 3rd St

- Macon Occupational Medicine, 124 3rd St

3.0 USER PROVIDED INFORMATION

3.1 TITLE RECORDS

A search of the online Bibb County Board of Tax Assessors property record cards and deed references showed the following:

Property	Parcel Number	Sale Date Sale Price Reason	2016 Valuation
120 Broadway (Main Building)	R0730118OC4 6A	10/24/2011 \$10 Conversion of Past Sales	\$1,226,838
139 Broadway (Riverside Drive Parking Lot)	R0730117OC3 8A	10/24/2011 \$0 Gift	\$235,682
415 Walnut Street (Former Fueling Station)	R0730112OC3 1A	1/10/2011 \$2,200,000 Personal Property Included	\$137,443
179 Fifth Street (MLK Jr Blvd Parking Lot)	R0730129OC4 1E	10/24/2011 \$0 Gift	\$79,733

The Bibb County records showed only one sale listed for each parcel – each of them being completed in 2011 with Macon Telegraph as the grantor and Macon MRP LLC as the grantee. Despite the differing listed values and reasons for the sale of each property, it is believed all four sales are an expression of the subject site being conveyed as an asset of the Macon Telegraph pension plan.

3.2 ENVIRONMENTAL LIENS OR ACTIVITY AND USE LIMITATIONS

No documented evidence of recorded Environmental Liens or Activity and Use Limitations (AULs) was identified during the research performed as part of this assessment.

3.3 SPECIALIZED KNOWLEDGE

The Client has no specialized knowledge regarding the subject site outside of the scope of this Phase I assessment beyond that which is presented in the ASTM E 1527-13 User Questionnaire and Site Assessment Checklist. Information derived from the owner's representative is documented in the questionnaire included as Appendix C. The interviews with the owner's representative are discussed in Section 6 of this report.

3.4 COMMONLY KNOWN/REASONABLY ASCERTAINABLE INFORMATION

The subject site's current use is common knowledge to the Client, as well as the local community. The site is recognized as formerly being used by the Macon Telegraph for administrative offices and the printing of newspapers.

3.5 VALUATION REDUCTION FOR ENVIRONMENTAL ISSUES

The four properties constituting the subject site are collectively valued at nearly \$1,700,000 by the Bibb County Board of Tax Assessors. There is no indication that the value of the site has been reduced due to environmental issues despite historical use of the property as a newspaper printing operation and the groundwater remediation conducted outside the former fueling station in the Broadway parking lot at Walnut Street.

3.6 OWNER, PROPERTY MANAGER, AND OCCUPANT INFORMATION

The site is currently owned & managed by 120 Macon MRP c/o WhiteStar Advisors LLC. The independent newspaper distribution contractor is the sole occupant across the site assemblage.

3.7 REASON FOR PERFORMING PHASE I ASSESSMENT

The site is being assessed as part of Macon-Bibb County's EPA Brownfield Assessment Project, as the site was identified as a key property in downtown Macon.

4.0 RECORDS REVIEW

4.1 STANDARD ENVIRONMENTAL RECORD SOURCES

A search of readily available federal, state, and local records was commissioned from Environmental Data Resources (EDR) in report form. The full EDR report is included as Appendix D and is summarized in the following section. The full list of databases searched by EDR is as follows:

<u>Federal Records</u>	<u>Search Radius</u>
NPL/Superfund Sites	1 Mile
Proposed/Delisted NPL Sites	1 Mile
NPL Liens	Site Search
CERCLIS Sites (SEMS)	½ Mile
CERCLIS NFRAP Sites	½ Mile
RCRA CORRACTS TSD Facilities	1 Mile
RCRA non CORRACTS TSD Facilities	½ Mile
RCRA Generators	¼ Mile
ERNS Hazardous Spills	Site Search
Hazardous Material Information Reporting System	Site Search
US Engineering Controls	½ Mile
US Institutional Controls	½ Mile
Department of Defense (DOD)	1 Mile
Formerly Use Defense Sites (FUDS)	1 Mile
US Brownfields Sites	½ Mile
Superfund Consent Decrees (CONSENT)	1 Mile
NPL Records of Decision (RODS)	1 Mile
Uranium Mill Tailings Sites (UMTRA)	½ Mile
Open Dump Inventory (ODI)	½ Mile
Toxic Chemical Release Inventory System (TRIS)	Site Search
Toxic Substance Control Act (TSCA)	Site Search
FIFRA/TSCA Tracking System (FTTS)	Site Search
Section Seven Tracking System (SSTS)	Site Search
PCB Activity Database System (PADS)	Site Search
Material Licensing Tracking System (MLTS)	Site Search
Master Mines Index (MINES)	¼ Mile
Facility Index System (FINDS)	Site Search
RCRA Administrative Action Tracking (RAATS)	Site Search
<u>State and Local Records</u>	<u>Search Radius</u>
State Hazardous Waste Sites (SHWS)	1 Mile
State Non-Hazardous Site Inventory (GA NON-HSI)	1 Mile
State Landfill/Solid Waste Sites (SWF/LF)	½ Mile
Leaking USTs	½ Mile

Registered USTs	¼ Mile
Registered ASTs (AST)	¼ Mile
Oil and Hazardous Materials Incidents (SPILLS)	Site Search
Engineering Controls	½ Mile
Institutional Controls	½ Mile
Voluntary Cleanup Program (VCP)	½ Mile
PRIORITY Dry Cleaners	½ Mile
Ethylene Dibromide Database (DEDB)	½ Mile
BROWNFIELDS	½ Mile

Tribal Records

Indian Reservations (Indian Reserve)
Indian Leaking UST (INDIAN LUST)
INDIAN UST

Search Radius

1 Mile
½ Mile
¼ Mile

EDR Proprietary Records

Manufactured Gas Plants

Search Radius

1 Mile

The above databases were searched for sites within the stated set radii defined by the ASTM standard for each database. The search returned the following results for the databased that were accessed by EDR:

Superfund Enterprise Management System (SEMS): Formerly known as CERCLIS. This database tracks hazardous waste site, potential hazardous waste sites, and activities performed under the Superfund Program.

SEMS

Site Name	Relative Elevation	Distance & Direction (feet)
Macon Gas Light and Water Company	Equal/Higher	1,200 SSE
Ficklin and Walker	Equal/Higher	1,000 W

Resource Conservation and Recovery Act (RCRA): A database that tracks sites that generate, transport, store, treat, or dispose of hazardous waste as defined in the RCRA. The sites identified in this search were small quantity generators, which is defined by the RCRA as a facility that generates between 100 and 1000 kilograms of hazardous waste per month.

RCRA

Site Name	Relative Elevation	Distance & Direction (feet)
General Railway Services	Lower	1,200 SE

State Hazardous Waste Sites (SHWS): The state-level of SEMS and CERCLIS. This database tracks state-listed hazardous waste sites, and tracks the remedial activities done through the state-equivalent version of the Superfund Program.

SHWS

Site Name	Relative Elevation	Distance & Direction (feet)
Transco Railcar Facility	Equal/Higher	4,500 SSW
Macon MGP Site	Lower	1,200 SSE

Georgia Non-Hazardous Site Inventory (GA Non-HSI) – GA Non-HSI sites are sites that were identified to the Georgia Environmental Protection Division (EPD), and were evaluated by EPD to not pose sufficient threat to the environment to justify listing on the state Hazardous Site Inventory (HSI).

GA Non-HSI

Site Name	Relative Elevation	Distance & Direction (feet)
Morgan Tire & Auto Inc.	Equal/Higher	2,400 NW
Yomans Chevrolet	Equal/Higher	2,600 SW
SE Terminal: Macon	Equal/Higher	2,700 WNW
Middle Georgia Hospital	Equal/Higher	3,200 WSW
Former Middle Georgia Hospital	Equal/Higher	3,700 WSW
Former Dennard Sinclair Service Station	Equal/Higher	4,000 WSW
Former Caduceus Property	Lower	980 ESE
Riverside Drive Property	Lower	1,400 NW
Atlanta Gas Light Company: Macon MGP	Lower	1,600 SSE

Solid Waste Facilities/Landfill Sites (SWF/LF): A database that contains a state-wide inventory of landfills or other solid waste disposal sites.

SWF/LF

Site Name	Relative Elevation	Distance & Direction (feet)
David W. Thornton	Equal/Higher	2,400 WSW
City of Macon Landfill	Equal/Higher	2,500 WSW
Macon – Walker Rd Ph 2 (SL)	Equal/Higher	2,500 WSW

State Leaking Underground Storage Tanks (LUST): Contains the state-wide inventory of reported leaking underground storage tanks. The list below provides details of the remediation currently being taken on the leaking tank.

LUST

Site Name	Relative Elevation	Cleanup Status	Distance & Direction (feet)
Macon Telegraph Publishing Company	Subject Site	No Further Action	0
Public Saf-T-Oil Service	Equal/Higher	No Further Action	90 SSE
Cassidy's Garage	Equal/Higher	No Further Action	410 SW
Mauldin & Jenkins Property	Equal/Higher	No Further Action	420 SW
Old Western Union	Equal/Higher	No Further Action	1,500 SSW
Georgia Department of Transportation	Equal/Higher	No Further Action	1,500 NW
Palmer Ind. Inc.	Equal/Higher	No Further Action	1,500 SSW
Straight Eight Corp	Equal/Higher	No Further Action	1,600 S
Lot #44 Goodyear	Equal/Higher	No Further Action	1,700 SSW

LUST

Site Name	Relative Elevation	Cleanup Status	Distance & Direction (feet)
Downtown Chevron Service Center	Equal/Higher	No Further Action	1,800 W
Norfolk Southern Brosnan Yard	Equal/Higher	No Further Action	2,000 SW
Macon-Bibb County Transit Authority	Equal/Higher	No Further Action	2,100 NW
BST\Macon Main\R2110	Equal/Higher	No Further Action	2,300 W
Locksmith Associates	Equal/Higher	No Further Action	2,400 SW
Morgan Tire & Auto Inc.	Equal/Higher	No Further Action	2,400 NW
Former Curtis Mathis Facility	Equal/Higher	No Further Action	2,400 SSW
Former Service Station	Equal/Higher	No Further Action	2,400 SSW
Old Ice Cream Building	Equal/Higher	No Further Action	2,500 SSW
World Tire Inc. (Site 2)	Equal/Higher	No Further Action	2,500 SSW
Spring & Riverside Exxon	Equal/Higher	No Further Action	2,500 NW
Firestone Store #054	Equal/Higher	No Further Action	2,500 WSW
Youmans Chevrolet Co	Equal/Higher	No Further Action	2,600 SW
Bibb Yarns Inc. Coliseum Plant	Lower	No Further Action	660 ENE

LUST

Site Name	Relative Elevation	Cleanup Status	Distance & Direction (feet)
Macon Gas Light and Water Company	Lower	Transferred	1,200 SSE
Anderson McGriff	Lower	No Further Action	2,000 SSE

Registered Underground Storage Tanks (UST): A state list of the registered underground storage tanks in the area.

UST

Site Name	Relative Elevation	Tank Status	Distance & Direction (feet)
Macon Telegraph Publishing Company	Subject Site	Removed	0
Public Saf-T-Oil Service	Equal/Higher	Closed in Ground	90 SSE
Osan Marathon	Equal/Higher	Removed	350 SSE
Cassidy's Garage	Equal/Higher	Removed	410 SW
Mauldin & Jenkins Property	Equal/Higher	Removed	420 SW
Site 301	Equal/Higher	Removed	540 S
Bibb Co. Courthouse & Federal Bldg.	Equal/Higher	Closed in Ground	550 SW
BB&T	Equal/Higher	Active	920 W
Bibb County Courthouse	Equal/Higher	Removed	1,200 W

UST

Site Name	Relative Elevation	Tank Status	Distance & Direction (feet)
General Steel Co	Lower	Removed	600 SE
Bibb Yarns Inc. Coliseum Plant	Lower	Removed	660 ENE
Macon Gas Light and Water Company	Lower	Removed	1,200 SSE

Registered Aboveground Storage Tanks (AST): A state list of registered liquid petroleum gas tanks.

AST

Site Name	Relative Elevation	Distance & Direction (feet)
Marathon #1	Equal/Higher	350 SSE
The Bibb Company (Closed)	Lower	660 ENE
Atlanta Gas Light Company	Lower	1,200 SSE

Brownfields Public Record: A state list of properties where response actions under the Georgia Hazardous Site Reuse and Redevelopment Act are planned, ongoing, or completed.

Brownfields

Site Name	Relative Elevation	Distance & Direction (feet)
Palmer Ind. Inc.	Equal/Higher	1,500 SSW

Summary: A list created by Resolute highlighting the sites determined to have the greatest impact potential on the subject site. The following table was ordered by prioritizing sites within ¼ mile of the subject site, those believed to be hydraulically upgradient (southwest) of the subject site, those at a relatively higher elevation than the subject site, and those believed to present an ongoing environmental impact.

Site Name	Relative Elevation	Distance & Direction (feet)	List
Macon Telegraph Publishing Company	Subject Site	0	LUST, UST
One Hour Valet (dry cleaners)	Equal/Higher	90 SW	
Cassidy's Garage	Equal/Higher	410 SW	LUST
Bibb Co. Courthouse & Federal Bldg.	Equal/Higher	550 SW	UST
Public Saf-T-Oil	Equal/Higher	90 SSE	LUST
Osan Marathon	Equal/Higher	350 SSE	UST
Macon MGP Site	Equal/Higher	1,200 SSE	SEMS, SHWS, AST

EDR sources indicated the following about the properties listed above:

- Macon Telegraph Publishing Company: subject site, four USTs removed circa 1987
- One Hour Valet: dry cleaners operational since 1998, no known releases
- Cassidy's Garage: nine USTs removed since 1999, environmental monitoring is ongoing
- Bibb Co. Courthouse & Federal Bldg.: two USTs closed in-ground in 1982, historically handled degreasing solvents
- Public Saf-T-Oil: former filling station, one UST closed in ground in 1991, four more known USTs listed as "temporarily out of use"
- Osan Marathon: operational fueling station, several USTs historically removed, maintains several more active tanks.
- Macon MGP Site: former coal gasification plant; known release of benzo(a)pyrene in soil; cleanup activities being conducted for source materials, soil, and groundwater

4.2 ADDITIONAL ENVIRONMENTAL RECORD SOURCES

The "Additional Environmental Records" Radius Map™ section of the EDR Report provides more sources including local Brownfields, local landfill/solid waste disposal sites, local hazardous waste/contaminated sites, local registered storage tanks, local land records for AULs, emergency release reports, and contaminated public wells. A key finding was One Hour Valet being listed as an active dry cleaner, located just 90 feet hydraulically upgradient. The proximity of the dry cleaners

and likely ongoing use of tetrachloroethylene (PCE) suggests the potential for vapor encroachment into site structures exists.

As noted above, the former fueling station portion of the subject site was listed on the LUST and UST inventories. Macon Telegraph contracted Geotechnical & Environmental Consultants, Inc. (GEC) to aid in implementing corrective action associated with the listings. GEC made available several documents related to historical environmental work conducted at the site, including:

- 2004 Site Investigation Report
- 2009 Phase I ESA (Main Building, Riverside Drive Parking Lot, and Former Fueling Station)
- Undated Vapor Extraction, Air Sparge, and Groundwater Treatment System Specifications
- 2011-January Corrective Action Plan Part B (CAP-B) Progress Report
- 2011-April CAP-B Reimbursement Claim
- 2012-March Reimbursement Letter

4.2.1 JANUARY 2011 CAP-B PROGRESS REPORT

The January 2011 CAP-B Progress Report (Appendix E) details the subject site's history with the LUST and UST state programs and the soil vapor extraction (SVE) & air sparge system implemented to remediate the benzene groundwater contamination associated with the former on-site UST system.

- 2002: the first date in the environmental chronology provided by the report. GEC supervised the closure of the UST system. A release was discovered during the sampling associated the closure activities, which prompted a CAP-A to be submitted for the site in July 2002.
- March 2005: through programmatic groundwater monitoring, the contamination was delineated and a CAP-B was submitted.
- April 2006: EPD approved the CAP-B.
- 2006-2007: GEC established a benzene groundwater concentration corrective action limit (CAL) of 3,500 micrograms per liter (µg/L).
- February 2007: GEC installed the SVE & air sparge system in February 2007 and full-scale operation began. Quarterly groundwater sampling was subsequently undertaken as the remediation system was periodically adjusted to focus on wells with concentrations remaining in excess of the CAL.
- June 2010: a recommendation to shut down the remediation system to observe the contamination rebound effect was approved by EPD. Sampling events continued for an unknown period of time thereafter.
- 2012: the final year in which the subject site is listed as "active" on the EPD LUST list. This may have coincided with the formal abandonment of the remediation system, or the abandonment may have occurred sometime thereafter.

4.3 PHYSICAL SETTING SOURCE(S)

A United States Geological Survey (USGS) topographic map centered around the site from 2014 (contained within the EDR Report in Appendix D) was reviewed to discern the probable direction of surface and groundwater flow beneath the site and make note of any development in the vicinity of the subject site. The USGS maps showed that the elevation for the property ranges between 310 and 320 feet above sea level. Based upon the elevation gradation around the subject property, both surface and groundwater can be expected to flow northeastward toward the Ocmulgee River. The northeastern border of the site along Riverside Drive is parallel with the Ocmulgee River and lies approximately 400 feet away from the river.

4.4 HISTORICAL USE INFORMATION ON THE PROPERTY

4.4.1 SANBORN® FIRE INSURANCE MAPS

Sanborn® Fire Insurance maps have been produced since the late 1800's to provide information to insurers as it related to insurable property and potential fire hazards. The Sanborn® maps often indicate the locations of aboveground and underground fuel storage tanks, as well as paint shops, maintenance facilities, and other buildings where hazardous materials were used. For this assessment, the Sanborn® maps of the subject property dated 1884, 1889, 1895, 1908, 1924, 1951, 1960, and 1969 were reviewed to evaluate the overall structure and use of the subject and adjacent properties, as well as to determine any locations of potential RECs. The source Sanborn® maps can be found as part of the EDR Report in Appendix D.

Subject Site Observations	
Years	Observations
1884	<ul style="list-style-type: none"> Properties consist of residential dwellings and sheds, apart from the eastern section of the main building parcel. Here, small businesses like restaurants and barbers can be seen.
1889	<ul style="list-style-type: none"> No significant changes
1895	<ul style="list-style-type: none"> No significant changes
1908	<ul style="list-style-type: none"> Properties still largely consist of residential dwellings, but several more can be seen in this map.
1924	<ul style="list-style-type: none"> 120 Broadway: the M.D. & S.R.R. Freight Station can be seen on the northern border of the main building parcel. To the south of the freight station, four rail road tracks can be seen. To the south of those tracks, a gasoline tank, a kerosene tank, and a building designated as "barrel storage" can be seen. These developments replaced many of the residential dwellings previously in this parcel. 179 Fifth Street: buildings previously in the MLK Jr Blvd parking lot parcel appear to have been leveled. Remainder of the subject site exhibits no significant changes.
1951	<ul style="list-style-type: none"> 120 Broadway: a "paper warehouse" can be seen to the south of the freight station and to the west of the gasoline & kerosene tanks. The "barrel storage" building is gone. The remaining residential dwellings in the main building parcel have been leveled and a "junk storage" building can be seen at southwestern corner of the parcel. Remainder of the subject site exhibits no significant changes.

Subject Site Observations	
Years	Observations
1960	<ul style="list-style-type: none"> No residential dwellings exist on the subject site. 120 Broadway: the freight station has been converted to a "newsprint storage" building. Train tracks, "paper warehouse," gasoline & kerosene tanks, and "junk storage" no longer pictured. 415 Walnut Street: the former fueling station in the Broadway parking lot parcel can be seen. 139 Broadway: an auto body/repair shop can be seen in the Riverside Drive parking lot parcel. The parcel can also be seen as designated for "used auto sales."
1969	<ul style="list-style-type: none"> 120 Broadway: the "newsprint storage" building has expanded significantly to include a composing room and a press room. Macon Telegraph Publishing Company is listed next to these buildings. A single rail road track has appeared entering from the eastern boundary of the parcel. 139 Broadway: the structures associated with the auto body/repair shop remain, but Macon Telegraph Publishing Company is listed next to them.

Adjacent Properties Observations	
Years	Observations
1884	<ul style="list-style-type: none"> Adjacent properties consist of residential dwellings and sheds.
1889	<ul style="list-style-type: none"> Railroad tracks appear to the north of the subject property, just south of the Ocmulgee River. To the south of those tracks is the "E.T.V. & G.R.R. Freight House."
1895	<ul style="list-style-type: none"> The freight house appears expanded and re-titled as "The Southern Railway Freight House." Development around the subject site continues but appears to remain largely residential.
1908	<ul style="list-style-type: none"> Continued residential development
1924	<ul style="list-style-type: none"> The freight house is now listed as the "Barfields Feed Mills" and several hay storage buildings and grain silos have appeared next to it. The railroad tracks remain to the north and expand to the southeast. A church near the corner of Broadway & Walnut now appears as "Armour & Co. Meat Packers."
1951	<ul style="list-style-type: none"> The Barfields Feed Mills have been converted to "Macon Peanut & Storage Co." The feed mill infrastructure remains. Residential developments surrounding the subject site have been converted to larger industrial buildings (e.g. auto sales & service, garment manufacturing, gas filling stations). Some residential dwellings remain.
1960	<ul style="list-style-type: none"> Continued industrial development. All residential dwellings gone apart from the "Town Pavilion Motel" located at the corner of Broadway & Walnut.
1969	<ul style="list-style-type: none"> Continued industrial development: buildout of the Town Pavilion Motel, conversion of a post office building at the corner of Broadway & Walnut St Lane to an auto body repair shop, expansion of the Macon Machine Shop to the south of the main building parcel.

4.4.2 HISTORICAL TOPOGRAPHIC MAP REVIEW

USGS historical topographic maps dated 1956, 1972, 1985, and 2014 (contained within the EDR Report in Appendix D) were reviewed to make note of any development in the vicinity of the subject site. The most drastic change in site vicinity development is visible between the 1956 and 1972 maps. Interstate roads 16 and 75, an expanded railroad network to the east of the site, and the Macon Coliseum & Coliseum Medical buildings to the north of the site across the Ocmulgee River all first appear in the 1972 map. There are no discernable changes in on-site development amongst the historical topographic maps.

4.4.3 AERIAL PHOTOGRAPHY REVIEW

Historic aerial photography of the subject and adjacent property was reviewed to ascertain past uses of the property, and identify relevant environmental conditions. The photographs reviewed (contained within the EDR Report in Appendix D) were dated 1955, 1958, 1966, 1972, 1981, 1988, 1993, 2005, 2006, 2007, 2009, and 2010.

Subject Site Observations	
Years	Observations
1955	<ul style="list-style-type: none">120 Broadway: the freight station can be seen on the main building parcel. The relatively low resolution of this photo limits other observations.
1958	<ul style="list-style-type: none">120 Broadway: a building can be seen to the south of the freight station. There are no visible tanks.139 Broadway: cars can be seen in the Riverside Drive parking lot.
1966	<ul style="list-style-type: none">120 Broadway: the freight station building has expanded significantly and appears to have been converted into Macon Telegraph property. The building south of the former freight station is no longer visible. Cars fill the remainder of this parcel.139 Broadway: more cars and some building infrastructure can be seen in the Riverside Drive parking lot.415 Walnut Street: the former fueling station in the Broadway parking lot parcel can be seen.
1972	<ul style="list-style-type: none">No significant changes from the last photograph.
1981	<ul style="list-style-type: none">139 Broadway: blurry photograph limits observations, but the Riverside Drive parking lot appears empty of cars & some building infrastructure has been removed.
1988	<ul style="list-style-type: none">Very blurry and low resolution of this photo severely limit observations.
1993	<ul style="list-style-type: none">120 Broadway: Macon Telegraph building significantly expanded. Parking lot area greatly reduced.139 Broadway: Riverside Drive parking lot has no building infrastructure and is filled with cars.
2005	<ul style="list-style-type: none">Low resolution photograph limits observations.
2006	<ul style="list-style-type: none">Low resolution photograph limits observations.
2007	<ul style="list-style-type: none">No significant changes from previous photograph.

Subject Site Observations	
Years	Observations
2009	<ul style="list-style-type: none"> 415 Walnut Street: remediation system trailer visible next to former fueling station.
2010	<ul style="list-style-type: none"> No significant changes from previous photograph.

Adjacent Properties Observations	
Years	Observations
1955	<ul style="list-style-type: none"> Extensive railroad network can be seen to the SSE of the subject site. It wraps around the site to the northwest. Development around the subject site appears as a mix of residential & industrial.
1958	<ul style="list-style-type: none"> A plot of land to the north of the subject site just across the Ocmulgee River has been cleared.
1966	<ul style="list-style-type: none"> Interstate roads 16 and 75, an expanded railroad network to the east of the site, and cleared plot of land which will ultimately contain the Macon Coliseum & Coliseum Medical buildings to the north of the site across the Ocmulgee River all appear.
1972	<ul style="list-style-type: none"> More roadway & railroad track expansion. Buildings in the vicinity still generally changing from residential to industrial.
1981	<ul style="list-style-type: none"> Continued roadway infrastructure development. Some vicinity buildings replaced with larger high-rises & associated parking lots.
1988	<ul style="list-style-type: none"> Very blurry and low resolution of this photo severely limit observations.
1993	<ul style="list-style-type: none"> No significant changes from previous photograph.
2005	<ul style="list-style-type: none"> No significant changes from previous photograph.
2006	<ul style="list-style-type: none"> No significant changes from previous photograph.
2007	<ul style="list-style-type: none"> No significant changes from previous photograph.
2009	<ul style="list-style-type: none"> No significant changes from previous photograph.
2010	<ul style="list-style-type: none"> No significant changes from previous photograph.

4.5 POTENTIAL VAPOR IMPACT

Historical on-site benzene groundwater impacts, historical railroad uses of the main building parcel & adjacent properties, and the presence of One Hour Valet dry cleaners just 90 feet hydraulically upgradient suggest the potential for vapor encroachment into site structures exists. As such, vapor intrusion pathways should be investigated and considered with respect to future use and development of the site.

5.0 SITE RECONNAISSANCE

5.1 METHODOLOGY & LIMITING CONDITIONS

The purpose of the on-site reconnaissance was to gather information about potential RECs that would not be apparent from the historical data gathering. The property was visited on 5 December 2016, and a follow-up visit to the site was completed on 8 December 2016. Adjacent properties were inspected from the subject property and from public roads.

5.2 GENERAL SITE SETTINGS

▪ *Structures/On-Site Improvements*

Structures associated with the site's historical operations and subsequent corrective action efforts were identified. Their descriptions are as follows:

- The 140,000± ft² three-story former Macon Telegraph newspaper office/distribution building with basement is the main site feature. Building specifications and floor plans can be seen in the Coldwell Banker Commercial property listing included as Appendix F. About 30% of the building is office space; the rest of building was historically used for newspaper production. The former pressroom in the main building showed widespread black staining and concrete rubble, suggesting the former presence of large publishing machinery.
- The former fueling station was found to have multiple large (up to a few feet in diameter) holes in its ceiling, shallow pools of standing water, vegetative overgrowth, various industrial debris including small (less than 5-liter) chemical containers and plywood, and a floor drain in the bay portion of the station.
- Outside the former fueling station, asphalt & concrete patches, monitoring well caps, and abandoned PVC pipes indicated the former presence of the vapor extraction, air sparge, and groundwater treatment system.
- A single railroad track leading from the eastern edge of the main building to the eastern edge of the parcel boundary corroborated the site's former status as a freight station.

▪ *Containers/Drums*

- Several labeled 55-gallon drums and other smaller containers were observed within the main building, generally around the former pressroom. Instances include multiple 55-gallon drums of photographic fixing concentrate, a relatively small (less than 5-liter) metal container of 1,1,1-trichloroethane, and miscellaneous containers of various proprietary solutions associated with printing operations.
- Several small (less than 5-liter) chemical containers were observed within the former fueling station. Instances include motor oil, weed killer, and paint.

▪ *USTs/ASTs*

- No USTs or ASTs were observed. Possible footprints for the removed storage tanks outside the former fueling station associated with the subject's site LUST and UST

listings were identified.

- ***Odors***
 - No unusual odors were noted.
- ***Drains***
 - Several floor drains were visible, most of which are believed to discharge into Macon Water Authority system. Two of the floor drains discovered were identified as sumps: one in the main building subfloor warehouse and one in the main building ink storage room. One floor drain was observed in the bay portion of the former fueling station.
- ***Unknown Use Pits***
 - No pits, ponds, lagoons, or surface waters of unknown use were observed. Some shallow pools of liquid were observed throughout the former fueling station.
- ***Septic Systems***
 - No visibly apparent septic system was found on the property. On-site buildings are known to be provided with a municipal sewer connection from the Macon Water Authority.
- ***Water Wells***
 - No potable or production wells were observed on the property.
- ***Groundwater Monitoring, Treatment, and Extraction Wells***
 - Flush-mount monitoring well caps and abandoned metal vaults & PVC pipes in the vicinity of the former fueling station provided evidence for the presence of a monitoring well network associated with the former SVE & air sparge groundwater remediation system installed and operated by GEC in February 2007. More details about the system can be found in Appendix E.
- ***Electrical Transformers or Polychlorinated Biphenyl (PCB) Sources***
 - A series of electrical transformers were discovered in the basement level of the main building along the western edge of its interior. The manufacturer's plate on the transformer series suggests the dielectric fluid used in the machines is silicone, not PCB. It is conceivable, however, that PCBs were historically used in the transformers, thereby allowing the possibility for at least residual PCB presence.
- ***Mechanical, Hydraulic, or Electrical Lifts***
 - Three elevators and one freight elevator were discovered in the main building, generally along its interior edges. Their locations are specified in the floor plans found in the Coldwell Banker Commercial property listing (Appendix F).

- ***Surface Discoloration***
 - The floor of the former pressroom in the main building showed widespread black staining and concrete rubble in the vicinity of floor drains.

5.3 ADDITIONAL & NON-ASTM ISSUES

- ***Asbestos Containing Materials (ACM) and Lead Based Paint***
 - No explicit lines of evidence for ACMs or lead based paint were identified, but the age of the main building and former fueling station merits further investigation for such in future development.
- ***Lead Contamination***
 - No explicit lines of evidence for lead contamination were identified, but the black staining on the floor of the former pressroom in the main building could potentially contain metal residues associated with printing inks.
- ***Mold and Water Damage***
 - No major mold or water damage was observed in the main building apart from some brown staining on fiber ceiling tiles throughout the main building third floor. During renovation, designers and contractors should be cognizant of the potential for isolated mold accumulation near stained areas.
 - The former fueling station was found to have multiple large (up to a few feet in diameter) holes in its ceiling and water damage associated with that structural deficiency. The potential for mold accumulation is likely.

6.0 INTERVIEWS

6.1 INTERVIEWS WITH OWNER

Per the All Appropriate Inquiry rule (40 CFR Part 312) inquiries shall be made to past and present owners, operators and occupants (§312.23) to help evaluate the environmental conditions of the property. Thus, a comprehensive interview was completed digitally through a questionnaire signed by Macon Telegraph president and former main building occupant Don Bailey on 2 December 2016 (Appendix C). Mr. Bailey was also present during the site reconnaissance, and was available to answer questions about associated findings in real time. Critical information provided by Mr. Bailey includes:

- General site narrative: Mr. Bailey worked in the main building for several years beginning in the 1980's and was very familiar with its former operations
- Use of the main building as a distribution center for the Telegraph by an independent contractor
- Believed uses/occupants of adjacent properties:
 - Scrap metal shop adjacent to the main building
 - Macon Occupational Health & Macon/Bibb Tax Commissioners Office adjacent to the Riverside Drive parking lot
- Past use of the property as a newspaper publishing company
- Total acreage of the property and square footage & build year of the main building
- Heating, water, and sanitary services associated with the main building
- Macon Water Authority as the handler of floor drain discharge
- Location of two sumps: one in the subfloor warehouse and one in the ink storage room
- Location of the basement transformers along the western interior of the main building
- Contacts for GEC which were used to gain access to subject site environmental reports
- Verification of the former presence of USTs outside the former fueling station
- Confirmation of past use of newspaper production, printing, and photography chemicals
- During the site reconnaissance, Mr. Bailey stated that the portion of the main building footprint spanning the basement warehouse may have been built where a gas station once was.

6.2 INTERVIEWS WITH OTHERS

The All Appropriate Inquiry rule (40 CFR Part 312) requires that certain inquiries be made to the user (prospective purchaser) to help evaluate the environmental conditions of the property. To qualify for one of the Landowner Liability Protections (LLPs) offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the "Brownfields Amendments"), the user/prospective purchaser must provide information (if available) to the environmental professional completing the assessment.

Failure to provide this information could result in a determination that "all appropriate inquiry" is not complete. The degree of information provided by Mr. Bailey in his interview and during the site

reconnaissance, however, and the willingness of GEC to provide several historical environmental site documents deemed no other interviews necessary.

7.0 FINDINGS & OPINION

7.1 FINDINGS

The purpose of this Phase I environmental site assessment was to identify apparent or suspect RECs, either historical or present, and identify de minimis conditions. De minimis conditions are defined as conditions that are judged to not present a material risk of harm to health or the environment. This assessment revealed the following RECs and de minimis conditions at the subject property as defined by the ASTM Standard Practice E1527-13:

- The removed tanks and abandoned SVE & air sparge groundwater remediation system associated with the involvement of the former fueling station with state LUST & UST programs constitute a controlled, historical REC.
- A single railroad track observed leading from the eastern edge of the main building to the eastern edge of the parcel boundary, coupled with findings from the historical Sanborn® maps including two storage tanks and a building designated as “barrel storage” confirms the site’s former status as a freight station and therefore constitutes a REC.
- Artifacts from the main building’s historical use as a publishing company including sumps, the presence of chemicals associated with newspaper production, and black staining & concrete rubble in the pressroom constitute an additional REC.
- The series of electrical transformers discovered in the basement level of the main building along the western edge of its interior represent a de minimis condition. Though the manufacturer’s plate on the transformer series suggests the dielectric fluid used in the machines is silicone, PCBs may have been historically used in its place.
- The nearby presence of One Hour Valet dry cleaners just 90 feet hydraulically upgradient represents another de minimis condition. The proximity of the dry cleaners allows for the potential of vapor encroachment into site structures.

7.2 OPINION

Based on the findings of this assessment, it is recommended that the following actions and/or investigations are warranted to eliminate or limit future impacts, and verify that the site has been adequately characterized:

- Historic site uses ranging from the fueling station, the 1960s era auto body shop, the historic rail terminal, and the Macon Telegraph printing operations, together with the likely off site sources of contamination suggest the potential for the presence of soil, ground water, and/or vapor encroachment. As a result, it is recommended that a subsurface soil and ground water monitoring investigation be performed in order to begin to determine the extent and degree of environmental impact.
- The potential for vapor encroachment from both on and off site sources exists. As such, vapor intrusion pathways should be investigated and considered with respect to future use and development of the site.

- The contents of the standing water in the two sumps in the main building (subfloor warehouse & ink storage room) should be characterized and properly managed.
- Labeled containers/drums should be removed and properly disposed.
- Unlabeled containers/drums should be characterized and properly disposed.
- The black staining & concrete rubble in the pressroom indicative of heavy machinery should be characterized. If floor cracking or a different route of soil exposure is identified after the rubble is removed impacts to site soil and/or groundwater should be evaluated.
- The dielectric fluid in the transformers located in the basement of the main building along the interior of its western wall should be tested for the presence of PCBs & characterized for disposal.
-

7.3 NEXT STEPS

Transitioning into the Georgia Brownfield Program should be considered, since doing so may expedite cleanup and position the site for future re-development. As such, it is recommended that the site owner and/or Macon-Bibb County meet with EPD, and EPA meet to establish a path forward, so that the property can be better marketed for sale and re-development.

8.0 REFERENCES

Bailey, Don. *All Appropriate Inquiry Questionnaire*, 2 December 2016.

Coldwell Banker Commercial Eberhard & Barry Inc., Former Macon Telegraph Publishing Company & Adjacent Parking Lots Property Listing, 7 October 2016.

Environmental Data Resources, Inc. *EDR Radius Map™ With Geotcheck®*, Inquiry Number 47939250.2s, 1 December 2016.

Environmental Data Resources, Inc. *Certified Sanborn ®Map Report*, Inquiry Number 47939250.3, 1 December 2016.

Environmental Data Resources, Inc. *EDR Historical Topo Map Report*, Inquiry Number 47939250.4, 1 December 2016.

Environmental Data Resources, Inc. *EDR Aerial Photo Decade Package*, Inquiry Number 47939250.9, 1 December 2016.

Geotechnical & Environmental Consultants, Inc. *Corrective Action Plan Part B Progress Report #9*, 12 January 2011.

Macon-Bibb County Tax Assessor's Office Online Database of Records, accessed 18 November 2016.

9.0 QUALIFICATIONS & SIGNATURE OF ENVIRONMENTAL PROFESSIONAL

This report has been prepared in general accordance with 40 CFR Part 312 and ASTM Standard Practices E1527-13 for Environmental Site Assessments. Furthermore, I have the specific qualifications based on training, experience and registration to assist in the assessment of a property of the nature, history and setting of the subject property.


I declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in 40 CFR Part 312.10. I have the specific qualifications based on education, training and experience to assess a property of the nature, history and setting of the subject property. I further certify that, in my professional judgment, this report meets the requirements of 40 CFR Part 312, Standards and Practices for All Appropriate Inquiries, and was prepared by me or under my direct responsible charge.

For Resolute Environmental & Water Resources Consulting:



Keith J. Ziobron
Principal Engineer
Date: 20 January 2017

FIGURES

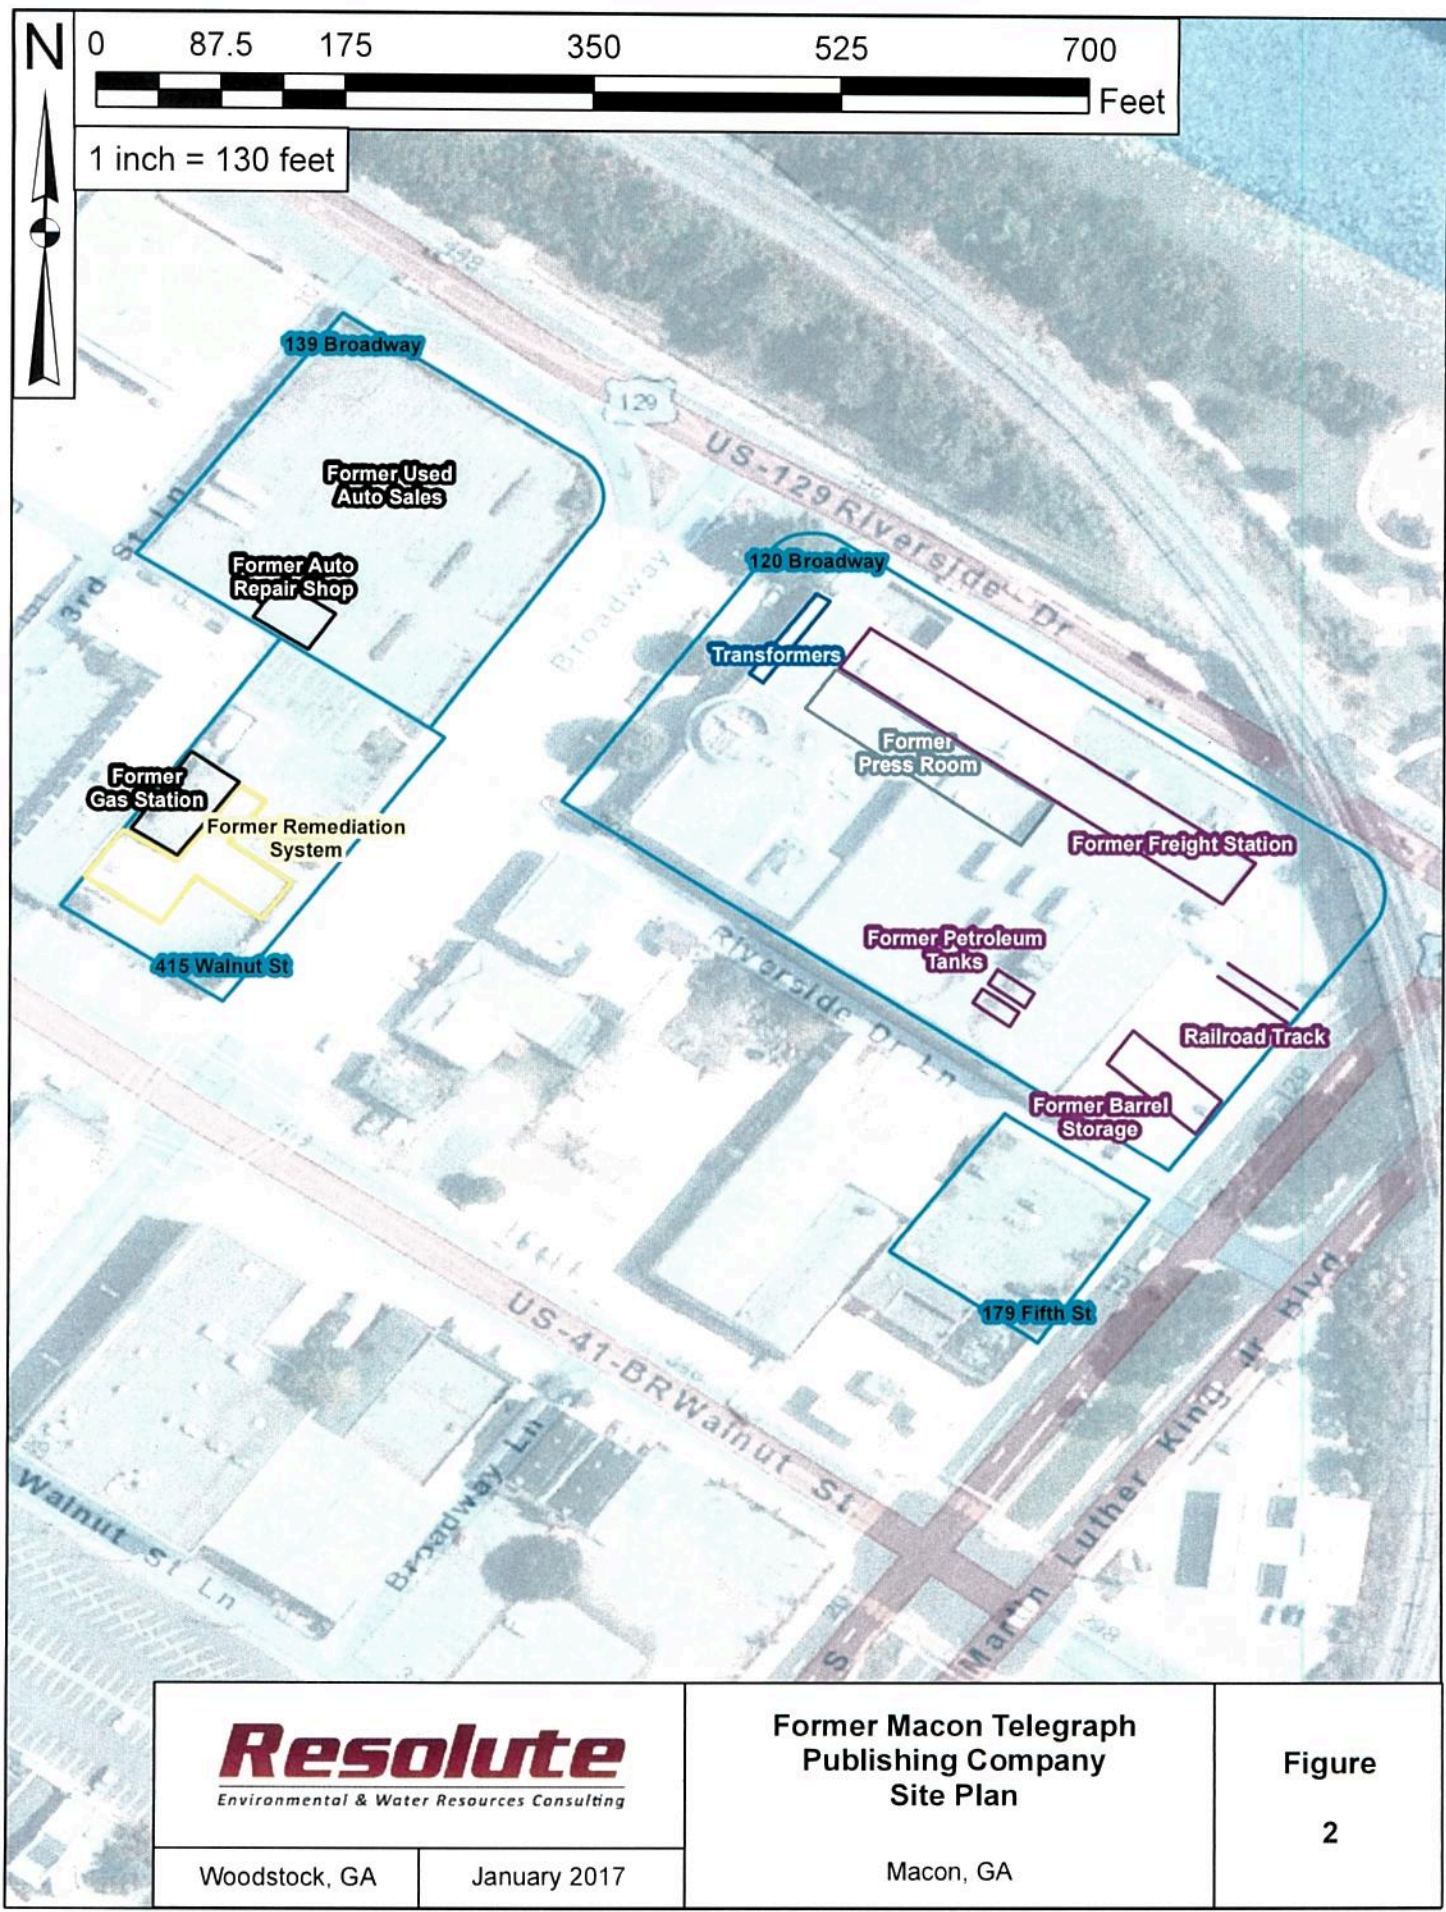

APPENDICES

Appendix A
ACCESS AGREEMENT

SITE ACCESS AGREEMENT

FOR

PHASE I ENVIRONMENTAL SITE ASSESSMENT

MACON-BIBB COUNTY

EPA COMMUNITY-WIDE BROWNFIELD ASSESSMENT PROGRAM

This **SITE ACCESS AGREEMENT** ("Agreement") is entered into by: 120 Macon MRP c/o Whitstar Advisors LLC ("Owner") and Macon-Bibb County ("County"), a Georgia municipal corporation.

WHEREAS, Owner owns the property described as follows, (the "Property").

Addresses & Associated Parcel Numbers: 1.) 120 Broadway (Main Bldg.): Parcel R073-0118; 2.) 139 Broadway (Corner Parking Lot @ Riverside: Parcel R073-0117; 3.) 415 Walnut Street (Walnut @ Broadway Parking Lot): Parcel R073-0112; 4.) 179 Fifth Street (MLK Parking Lot): Parcel R073-0129

WHEREAS, County, in cooperation with the United State Environmental Protection Agency (USEPA) and in association with USEPA's Brownfield grant program, is conducting certain environmental assessment activities relating to potential environmental impacts that might be present at the Property;

WHEREAS, County has hired Resolute Environmental & Water Resources Consulting, LLC (Contractor) to conduct such assessment activities; and

WHEREAS, County needs the permission of the Owner to enter onto the Property in order to conduct the assessment activities specified herein. The work covered by this agreement is limited in scope to the non-intrusive activities associated with the performance of a Phase I Environmental site Assessment which will be completed per the conditions of ASTM E1527 - 13: Standard Practice for Environmental Site Assessments - Phase I Environmental Site Assessment Process.

NOW, THEREFORE, County and Owner agree as follows:

1. **The Work:** Owner hereby grants County, its employees, agents, servants, contractor, and subcontractors (collectively hereinafter referred to as the "County") permission to enter upon Owner's Property, as necessary, to perform a Phase I Environmental Site Assessment of the subject property per the referenced standard. Work on the property will be limited to an in depth site inspection and occupant (if any) interview.
2. **Additional Work:** Additional intrusive assessment work, if warranted and approved by the owner, that might include collecting soil samples using hand auger or soil boring methods; collecting groundwater samples that may include installing monitoring well(s) and periodic sampling of such well(s); collecting water supply well samples; collecting sub-slab and indoor vapor samples; collecting surface water and/or sediment samples, collecting potential asbestos-containing material samples, and collecting potential lead-based paint materials as may be required to meet USEPA requirements (the "Project") would be conducted under an access agreement **separate and apart** from this initial agreement following discussion of initial findings.
3. **Coordination:** Access for initial assessment activities shall be through the route of access specified by the Owner. County and/or County's agents will provide reasonable notice to Owner prior to entering the Property for Project activities. In completing the

SITE ACCESS AGREEMENT

FOR

PHASE I ENVIRONMENTAL SITE ASSESSMENT

MACON-BIBB COUNTY
EPA COMMUNITY-WIDE BROWNFIELD ASSESSMENT PROGRAM

Project, the County will strive to limit obstruction, if any, to the use of the Property. No waste materials are anticipated to be generated by the Project activities.

4. **Effective Date of Agreement:** This Agreement shall become effective on the date of execution by the last executing party.
5. **Indemnification:** To the extent allowed by Georgia State Law, Macon-Bibb County agrees to defend, indemnify and save harmless Owner from all losses, claims, liabilities, expenses and costs (except any consequential or indirect damages) arising from the actions of County, its employees, agents or contractors in connection with exercising rights herein granted, including any claims by persons involved in such actions.
6. **Work Product:** County will provide one electronic copy of final reports and data generated in association with the Project following USEPA approval of project deliverables.
8. **Authorization:** Owner warrants that its signatory hereto has full right and authority to execute this Agreement on behalf of Owner and that this Agreement is a valid and binding obligation of Owner, subject to its terms.
9. **Insurance:** Per the agreement between the County and the Contractor, the Contractor carries adequate insurance to provide sufficient coverage to be protective of the owner for the stated scope of work as specified by the contract between the County and the Contractor.
9. **Supplemental Condition:** No provision of this Agreement or any actions under it shall, in any action, proceeding or litigation, operate as an admission by County or Owner of any violation of law, regulation, or breach of duty at any time.

IN WITNESS WHEREOF, the parties have affixed their signatures as of the dates written below.

OWNER

Nov. 28, 2016
DATE

By: James E. Bishop
Print Name James E. Bishop

MACON-BIBB COUNTY

Nov. 29, 2016
DATE

By: Robert A. B. Reichert
Print Name: Robert A. B. Reichert

Appendix B
PHOTO LOG



Photograph 1: Looking north toward the former gas station & remediation system artifacts in the Broadway parking lot at Walnut Street.



Photograph 2: Looking northwest toward the railroad track leading to the main building.

**RECONNAISSANCE
PHOTOGRAPHS**
Taken By: Keith Ziobron &
Michael Patinkin
Date: 12.05.16

Resolute
Environmental & Water Resources Consulting

Former Macon Telegraph
Publishing Company &
Adjacent Lots
Macon, Georgia



Photograph 3: Looking southeast towards One Hour Valet dry cleaners from the former gas station parking lot



Photograph 4: Looking southwest towards the former Saf-T-Oil filling station from MLK Jr Blvd


**RECONNAISSANCE
PHOTOGRAPHS**
Taken By: Keith Ziobron &
Michael Patinkin
Date: 12.05.16

Resolute
Environmental & Water Resources Consulting

Former Macon Telegraph
Publishing Company &
Adjacent Lots
Macon, Georgia



Photograph 5: Looking down at the main building subfloor warehouse sump

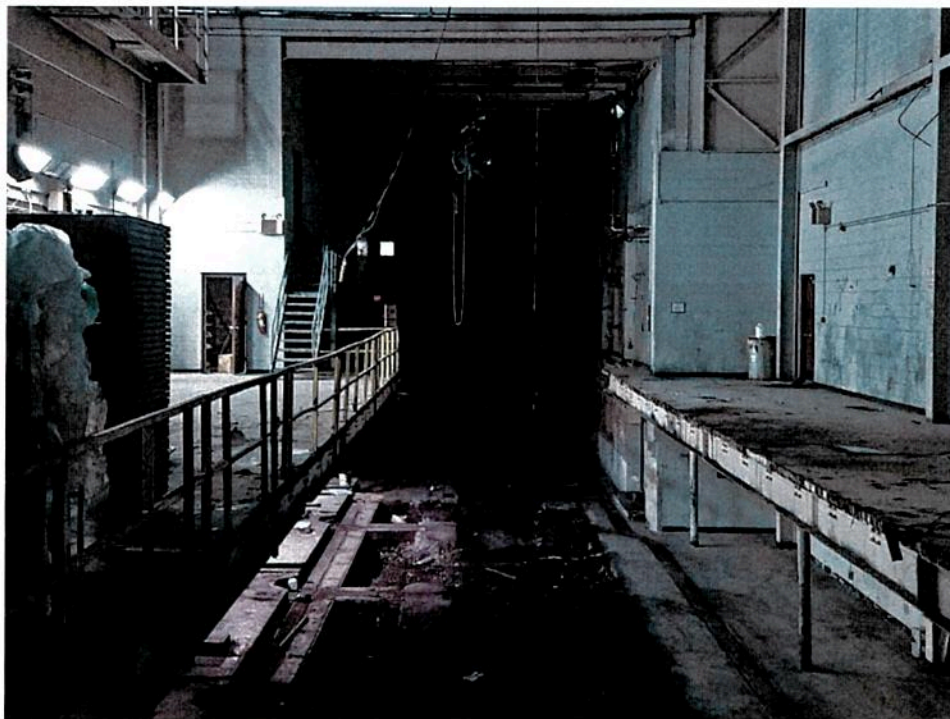

Photograph 6: Looking northwest into the former pressroom. Note black staining on concrete rubble on floor.


**RECONNAISSANCE
PHOTOGRAPHS**
Taken By: Keith Ziobron &
Michael Patinkin
Date: 12.05.16

Resolute
Environmental & Water Resources Consulting

Former Macon Telegraph
Publishing Company &
Adjacent Lots
Macon, Georgia



Photograph 7: A relatively small (< 5-liter) metal container of 1,1,1-TCA found in the former business card printing room in the main building basement

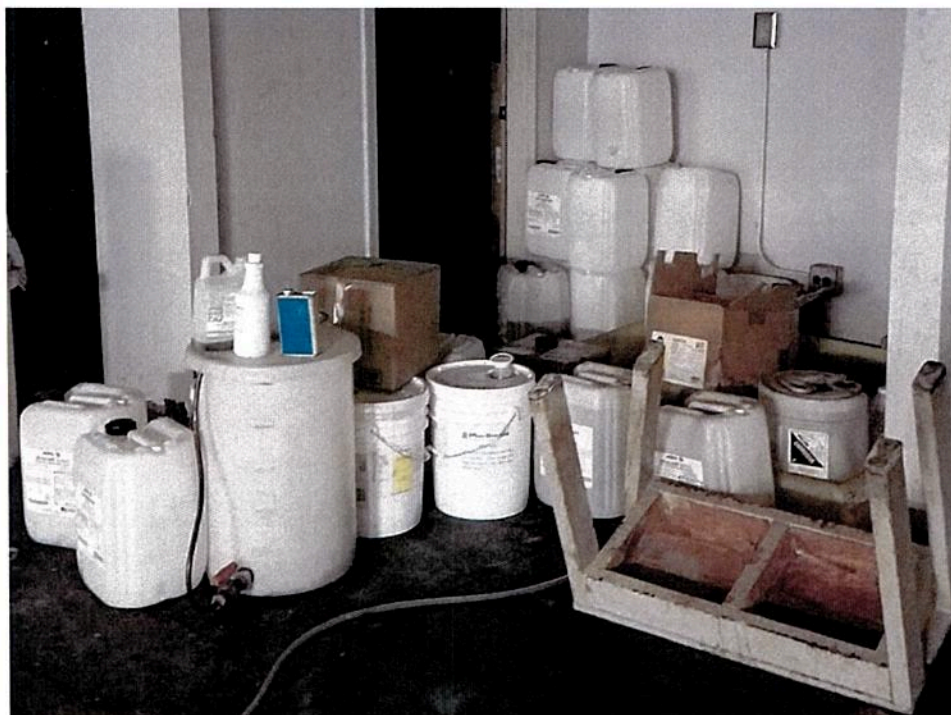


Photograph 8: A representation of the various chemical containers found in the basement of the main building

**RECONNAISSANCE
PHOTOGRAPHS**
Taken By: Keith Ziobron &
Michael Patinkin
Date: 12.05.16

Resolute
Environmental & Water Resources Consulting

Former Macon Telegraph
Publishing Company &
Adjacent Lots
Macon, Georgia

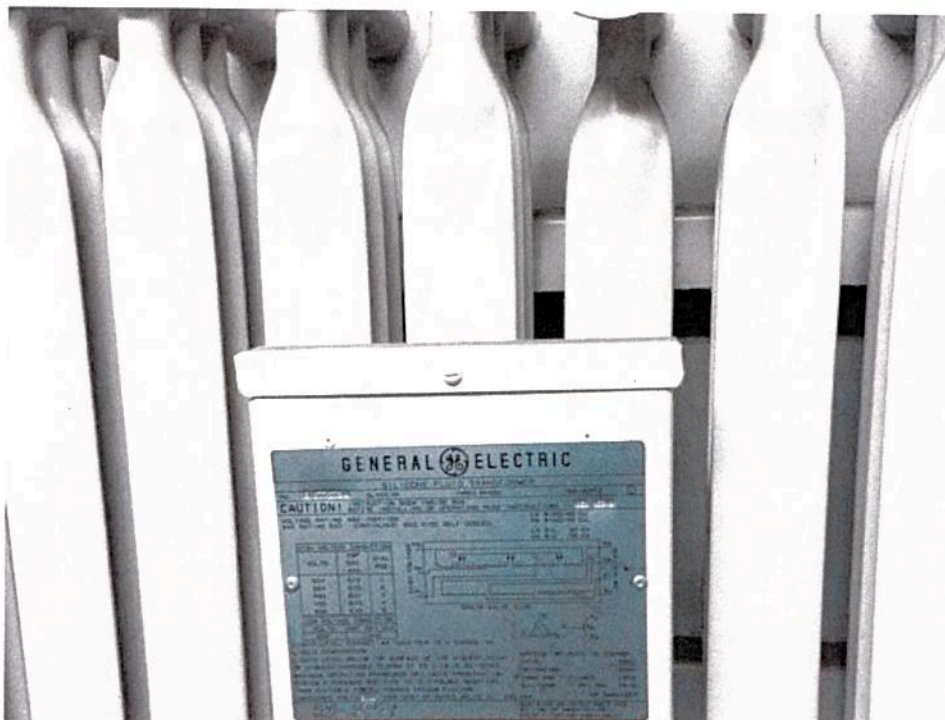

Photograph 9: The manufacturer's plate on the transformers lining the interior western wall in the basement of the main building



Photograph 10: Inside the bay of the former gas station

**RECONNAISSANCE
PHOTOGRAPHS**
Taken By: Keith Ziobron &
Michael Patinkin
Date: 12.05.16

Resolute
Environmental & Water Resources Consulting

Former Macon Telegraph
Publishing Company &
Adjacent Lots
Macon, Georgia

Appendix C
ALL APPROPRIATE INQUIRY QUESTIONNAIRE

All Appropriate Inquiry – Interview Questionnaire

The new All Appropriate Inquiry rule (40 CFR Part 312) requires that certain inquiries be made to past and present owners, operators and occupants (§312.23) to help evaluate the environmental conditions of the property. This questionnaire has been developed to facilitate the interview process and is intended to be completed prior to the environmental professional's site visit. Please answer all questions to the best of your ability.

Site/Project Name: **Former Macon Telegraph Assemblage**

Address:

Person Completing Interview: **Don Bailey**

1. What is the current use(s) of the property? List all on-site businesses and contact information for each owner or operator?

Rear of building facing MLK, Jr Blvd is used by an independent contractor as the distribution center for The Telegraph. They will remain on site until the building is sold.

2. List the known uses/occupants of all adjacent properties.

**Cassidy Scrap Metal is adjacent to the main Telegraph building.
Macon Occupational Health (drug screens, etc) and the Macon/Bibb Tax Commissioners Office is located adjacent to the large parking lot across Broadway from the main Telegraph building.**

3. Do you know the Past uses of the property?

To my knowledge The Telegraph is the only building on the main lot. On the opposite side of Broadway a gas station (building still located on site) once occupied the corner of Broadway and Walnut Streets.

4. List the total acreage of the property and square footage of each building present on site.

See Art Barry's real estate listing for this information.

5. When was each structure built? What was there before construction?

See Art Barry's real estate listing for this information.

6. What is the heating source of the building (if any)?

Constellation Natural Gas

7. Was the fuel source for the building(s) ever heating oil?

Unknown

8. What is the water source for the property?

Macon Water Authority

9. What is the sanitary service for the property?

Trash removal by Schneider

10. Has there ever been a septic system on the property?

Unknown

11. Are any wells present on-site?

Unknown

12. Are floor drains present on-site?

Yes

13. Where do the drains discharge?

City system

14. Are any sumps, sand traps, grease traps or oil-water separators present now or historically on-site?

Two are known. One is subfloor warehouse and one in the old ink storage room.

15. Are there transformers, hydraulic lifts or other potentially PCB-containing equipment at the site?

GEC provided an environmental cleanup report. This report is on file with Art Barry.

16. If so, has the PCB content been tested?

See GEC report

17. Have areas of the property been used a borrow pits?

Not to my knowledge

18. Have areas of the property been filled with debris or fill of unknown origin?

Not to my knowledge

19. Is there now or has there been automobile/equipment repair, a parts washer or degreaser present at the property?

Not to my knowledge

20. Are hazardous substances or petroleum products stored, generated, treated or disposed at the property?

Not to my knowledge

21. Are there now or have there been underground storage tanks (USTs) present on the property?

Gasoline storage tanks were near the old gas station in the large parking lot. These tanks have been removed. See the GEC report for detail.

22. How many USTs are/were present? (Please provide the contents, age, location, size for each)

See GEC report

23. Are USTs in service, closed-in-place or removed? Please provide applicable closure/removal reports or current tightness testing results.

See GEC report

24. Are there now or have there been aboveground storage tanks (ASTs) present on the property

Not to my knowledge

25. How many ASTs are/were present? (Please provide the content, age, location, size for each)

N/A

26. Are the ASTs in service or removed? (Please provide applicable closure/removal reports or current tightness testing results)

N/A

27. Were chemicals such as solvents, petroleum products, inks, paints, oils, pesticides or oils used in the past?

Yes, for newspaper production, printing and photography.

28. Do you know of specific chemicals that are present or once were present at the property or adjacent properties?

Newspaper ink (water based) and photography developing fluids

29. Were hazardous substances or petroleum products stored, generated, treated, or disposed at the property?

GEC report. Gasoline tanks were removed from property next to old gas station on corner of Broadway and Walnut Street

30. Do you know of spills or other chemical releases that have taken place at the property or adjacent properties?

Not to my knowledge

31. Do you know of any environmental cleanups that have taken place at the property or adjacent properties?

Gas tanks leaked and were removed. Soil was remediated. See GEC report.

32. Has the property been the recipient of any notices or other correspondence from any government agency relating to past or present violations of environmental laws, rules or codes?

Not to my knowledge

33. Do you know of any obvious indicators that point to the presence or likely presence of contamination at the property or adjacent properties?

See GEC report

34. Are you aware of any environmental cleanup liens or pending enforcement actions against the property that are filed or recorded under federal, tribal, state or local law?

Not to my knowledge

35. Are you aware of any Activity and Use Limitations (AULs), such as engineering controls, land use restrictions or institutional controls that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law?

Not to my knowledge

36. Do you have any other information that might indicate potential environmental concerns associated with the subject or adjacent properties?

See GEC report

I have completed this questionnaire in good faith and to the best of my knowledge.

Signature:  Date: 12/2/16

Name: Donald W Bailey

Phone: 478-744-4290

Title: **President and Publisher, The Telegraph**

Relationship to Property: **Tenant. Property owned by company pension plan**

Number of years associated with the property: **3.5 years**

Appendix D
EDR REPORT

Former Macon Telegraph Assemblage
Riverside Dr and Martin Luther King Blvd
Macon, GA 31201

Inquiry Number: 4793950.2s
November 30, 2016

The EDR Radius Map™ Report with GeoCheck®



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	160
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-9
Physical Setting Source Map Findings	A-11
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

RIVERSIDE DR AND MARTIN LUTHER KING BLVD
MACON, GA 31201

COORDINATES

Latitude (North):	32.8384000 - 32° 50' 18.24"
Longitude (West):	83.6233000 - 83° 37' 23.88"
Universal Transverse Mercator:	Zone 17
UTM X (Meters):	254455.5
UTM Y (Meters):	3636231.0
Elevation:	314 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	6046660 MACON EAST, GA
Version Date:	2014
Southwest Map:	6046666 MACON WEST, GA
Version Date:	2014

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20150728, 20150727
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
RIVERSIDE DR AND MARTIN LUTHER KING BLVD
MACON, GA 31201

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	MACON TELEGRAPH PUBL	139 BROADWAY	LUST, UST, Financial Assurance	Higher	1 ft.
A2	SOLOMON STEVE M JR I	139 BROADWAY ST	EDR Hist Auto	Higher	1 ft.
A3	MACON TELEGRAPH PUBL	139 BROADWAY	RGA LUST	Higher	1 ft.
A4	MACON TELEGRAPH PUBL	139 BROADWAY	RGA LUST	Higher	1 ft.
A5	MACON TELEGRAPH & NE	139 BROADWAY	RGA LUST	Higher	1 ft.
A6	MACON TELEGRAPH & NE	139 BROADWAY	RGA LUST	Higher	1 ft.
B7	STEWART HOOK TEXACO	185 BROADWAY ST	EDR Hist Auto	Higher	20, 0.004, SSW
A8	MACON TELEGRAPH PUBL	120 BROADWAY	UST, Financial Assurance	Lower	23, 0.004, ESE
C9	PEOPLES OIL CO STA N	301 WALNUT ST	EDR Hist Auto	Higher	90, 0.017, SSE
C10	PUBLIC SAF-T-OIL SER	301 WALNUT ST	UST, Financial Assurance	Higher	90, 0.017, SSE
C11	PUBLIC SAF-T-OIL SER	301 WALNUT ST	LUST, FINDS	Higher	90, 0.017, SSE
B12	ONE HOUR VALET	444 WALNUT ST	DRYCLEANERS	Higher	91, 0.017, SW
B13	ONE HOUR VALET CLEAN	444 WALNUT ST	EDR Hist Cleaner	Higher	91, 0.017, SW
B14	RUTLANDS GARAGE	182 BROADWAY ST	EDR Hist Auto	Higher	91, 0.017, South
B15	CUSTOM BUILT TRANSMI	399 WALNUT ST	EDR Hist Auto	Higher	124, 0.023, South
B16	SOU OIL STORES INC G	200 BROADWAY ST	EDR Hist Auto	Higher	186, 0.035, SSW
B17	ADVANCE OIL CO FILLI	202 BROADWAY ST	EDR Hist Auto	Higher	186, 0.035, SSW
D18	MC GOLDRICK MTR CO I	470 WALNUT ST	EDR Hist Auto	Higher	204, 0.039, WSW
B19	HUGHES AUTOMOTIVE	355 WALNUT ST	EDR Hist Auto	Higher	206, 0.039, South
B20	GREENWAY BROTHERS BO	353 WALNUT ST	EDR Hist Auto	Higher	206, 0.039, South
B21	GREENWAY BROTHERS BO	353 WALNUT STREET	RCRA NonGen / NLR, FINDS, ECHO	Higher	206, 0.039, South
D22	M C SHEFFIELD AUTO	212 3RD ST	EDR Hist Auto	Higher	299, 0.057, WSW
E23	OSAN MARATHON	277 WALNUT ST	UST, FINDS, Financial Assurance	Higher	350, 0.066, SSE
E24	MARATHON #1	277 WALNUT STREET	AST	Higher	350, 0.066, SSE
E25	BALKCOM THOS L FILLI	277 WALNUT ST	EDR Hist Auto	Higher	350, 0.066, SSE
D26	NUTTING SARAH C MRS	210 3RD ST	EDR Hist Auto	Higher	363, 0.069, WSW
D27	MC GOLDRICK MOTOR CO	240 3RD ST	EDR Hist Auto	Higher	389, 0.074, WSW
F28	CASSIDYS GARAGE	423 MULBERRY ST	LUST, UST, FINDS, Financial Assurance	Higher	414, 0.078, SW
F29	CASSIDYS GARAGE	423 MULBERRY ST	EDR Hist Auto	Higher	414, 0.078, SW
F30	MAULDIN & JENKINS PR	439 MULBURY STREET	LUST, UST, Financial Assurance	Higher	415, 0.079, SW
F31	JONES THOS M FILLING	265 BROADWAY ST	EDR Hist Auto	Higher	433, 0.082, SSW
F32	BONNER THOS E JR DRY	284 BROADWAY ST	EDR Hist Cleaner	Higher	438, 0.083, SSW
G33	WISE BOB AUTO SERVIC	278 BROADWAY ST	EDR Hist Auto	Higher	443, 0.084, SSW
G34	COMMUNITY	267 BROADWAY LN	EDR Hist Auto	Higher	474, 0.090, South
F35	KENDALL PETE SERV ST	405 MULBERRY ST	EDR Hist Auto	Higher	494, 0.094, SSW
F36	439 43 CHAPMANS	439 MULBERRY ST	EDR Hist Auto	Higher	502, 0.095, SW
G37	ROBERTSON LAFAYETTE	315 BROADWAY ST	EDR Hist Cleaner	Higher	504, 0.095, South
G38	SMITH JOS B CLO CLNR	319 BROADWAY ST	EDR Hist Cleaner	Higher	507, 0.096, South
F39	CASSIDYS GARAGE	401 MULBERRY ST	EDR Hist Auto	Higher	510, 0.097, SSW

MAPPED SITES SUMMARY

Target Property Address:
RIVERSIDE DR AND MARTIN LUTHER KING BLVD
MACON, GA 31201

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
F40	SWANN L FRANK AUTO R	403 MULBERRY ST	EDR Hist Auto	Higher	510, 0.097, SSW
F41	CASSIDYS GARAGE AUTO	409 MULBERRY ST	EDR Hist Auto	Higher	511, 0.097, SW
F42	415 19 CHAPMANS GARA	415 MULBERRY ST	EDR Hist Auto	Higher	512, 0.097, SW
F43	415 19 CHAPMANS GARA	419 MULBERRY ST	EDR Hist Auto	Higher	512, 0.097, SW
F44	439 43 CHAPMANS GARA	443 MULBERRY ST	EDR Hist Auto	Higher	519, 0.098, SW
G45	FELIX BANKS	314 BROADWAY ST	EDR Hist Cleaner	Higher	526, 0.100, South
G46	SITE 301	301 MULBERRY SITE	UST, Financial Assurance	Higher	539, 0.102, South
G47	GULF REFINING CO FIL	301 MULBERRY ST	EDR Hist Auto	Higher	539, 0.102, South
F48	B & B ONE DAY CLEANER	397 MULBERRY ST	EDR Hist Cleaner	Higher	541, 0.102, SSW
H49	TYLER BROS GARAGE AU	215 3RD ST	EDR Hist Auto	Higher	543, 0.103, West
H50	215 219 HANNAS STORA	219 3RD ST	EDR Hist Auto	Higher	543, 0.103, West
F51	ONE DAY CLEANERS	393 MULBERRY ST	EDR Hist Cleaner	Higher	547, 0.104, SSW
F52	FEDERAL BLDG & US CO	475 MULBERRY ST	RCRA NonGen / NLR, FINDS, ECHO	Higher	549, 0.104, SW
F53	BIBB CO COURTHOUSE &	475 MULBERRY ST	UST, Financial Assurance	Higher	549, 0.104, SW
G54	BONNER ONE HOUR CLEA	375 MULBERRY ST	EDR Hist Cleaner	Higher	553, 0.105, SSW
H55	BEAU BRUMMEL LNDRY	255 3RD ST	EDR Hist Cleaner	Higher	580, 0.110, WSW
G56	PATTERSON GULF SERVI	351 MULBERRY ST	EDR Hist Auto	Higher	582, 0.110, SSW
E57	BUCKS GARAGE	225 WALNUT ST	EDR Hist Auto	Higher	595, 0.113, SE
E58	NORFOLK SOUTHERN RAI	225 WALNUT ST	SPILLS, RCRA NonGen / NLR, FINDS, ECHO	Higher	595, 0.113, SE
E59	GENERAL STEEL CO	224 WALNUT ST	UST, Financial Assurance	Lower	605, 0.115, SE
I60	BIBB CO COLISEUM PLT	155 COLISEUM DR	RCRA NonGen / NLR, FINDS, ECHO	Lower	661, 0.125, ENE
I61	THE BIBB COMPANY(CLO	155 COLISEUM	AST	Lower	661, 0.125, ENE
I62	BIBB YARNS INC COLIS	155 COLISEUM DR	LUST, UST, Financial Assurance	Lower	661, 0.125, ENE
63		306 TERMINAL AVE.	VCP	Higher	832, 0.158, SSE
64	BB&T	201 SECOND STREET	UST, Financial Assurance	Higher	923, 0.175, West
65	CADUCEUS PROPERTY (F	167 RIVERSIDE DRIVE	GA NON-HSI	Lower	977, 0.185, ESE
J66	FICKLIN AND WALKER	577 MULBERRY ST	SEMS-ARCHIVE	Higher	1008, 0.191, West
J67	BIBB COUNTY COURTHOU	601 MULBERRY STREET	UST, Financial Assurance	Higher	1159, 0.220, West
K68	MACON GAS LIGHT AND	137 MULBERRY STREET	SEMS, LUST, UST, RCRA NonGen / NLR, Financial...	Lower	1189, 0.225, SSE
K69	ATLANTA GAS PLANT	137 MULBERRY STREET	US BROWNFIELDS, FINDS	Lower	1189, 0.225, SSE
K70	MACON GAS LIGHT AND	137 MULBERRY STREET	EDR MGP	Lower	1189, 0.225, SSE
K71	MACON MGP SITE	137 MULBERRY STREET	SHWS	Lower	1189, 0.225, SSE
K72	ATLANTA GAS LIGHT CO	137 MULBERRY STREET	AST	Lower	1189, 0.225, SSE
73	GENERAL RAILWAY SVCS	200 7TH ST	RCRA-CESQG, FINDS, ECHO	Lower	1245, 0.236, SE
74	COCA COLA PROPERTY	658 WALNUT ST	US BROWNFIELDS, FINDS	Higher	1259, 0.238, WNW
L75	RIVERSIDE DRIVE PROP	695 RIVERSIDE DRIVE	GA NON-HSI	Lower	1386, 0.262, NW
76	OLD WESTERN UNION	310 CHERRY STREET	LUST, UST, Financial Assurance	Higher	1461, 0.277, SSW
L77	GEORGIA DEPARTMENT O	3.1 MILES NE OF I-16	LUST, UST, Financial Assurance	Higher	1484, 0.281, NW
M78	450 MLK JR., BLVD	450 MLK JR, BLVD.(A/	BROWNFIELDS	Higher	1540, 0.292, SSW

MAPPED SITES SUMMARY

Target Property Address:
RIVERSIDE DR AND MARTIN LUTHER KING BLVD
MACON, GA 31201

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
M79	PALMER IND INC	450 MLK JR BLVD	LUST, UST, Financial Assurance	Higher	1540, 0.292, SSW
80	ATLANTA GAS LIGHT CO	MULBERRY ST.	GA NON-HSI	Lower	1584, 0.300, SSE
81	STRAIGHT EIGHT CORP/	454 TERMINAL AVE	LUST, UST, FINDS, Financial Assurance	Higher	1648, 0.312, South
M82	LOT #44 GOODYEAR	486 BROADWAY	LUST, UST, Financial Assurance	Higher	1697, 0.321, SSW
83	DOWNTOWN CHEVRON SER	311 FIRST ST	LUST, UST, Financial Assurance	Higher	1795, 0.340, West
84	NORFOLK SOUTHERN BRO	190 POPLAR STREET	LUST, UST, Financial Assurance	Higher	1958, 0.371, SW
85	ANDERSON MCGRUFF	398 EIGHTH ST	LUST, UST, FINDS, Financial Assurance	Lower	2078, 0.394, SSE
N86	MACON-BIBB COUNTY TR	815 RIVERSIDE DR	LUST, UST, Financial Assurance	Higher	2128, 0.403, NW
N87	MACON GAS LIGHT AND	WILLOW STREET	EDR MGP	Lower	2251, 0.426, NW
88	BST\MACON MAIN\R2110	787 CHERRY ST	LUST, AIRS, TIER 2	Higher	2342, 0.444, West
O89	LOCKSMITH ASSOCIATES	551 PLUM STREET	LUST, UST, Financial Assurance	Higher	2369, 0.449, SW
P90	MORGAN TIRE & AUTO I	852 RIVERSIDE DRIVE	GA NON-HSI, LUST, UST, Financial Assurance	Higher	2370, 0.449, NW
Q91	FORMER CURTIS MATHIS	600 BROADWAY DRIVE	LUST, UST, Financial Assurance	Higher	2374, 0.450, SSW
R92	FORMER SERVICE STATI	489 COTTON AVENUE	LUST	Higher	2392, 0.453, WSW
93	DAVID W. THORNTON	686 POPLAR STREET	SWF/LF	Higher	2396, 0.454, WSW
94	OLD ICE CREAM BUILDI	5TH AND PLUM ST	LUST, UST, Financial Assurance	Higher	2453, 0.465, SSW
R95	CITY OF MACON LANDFI	327 LOWER POPLAR ST	SWF/LF, NPDES	Higher	2455, 0.465, WSW
R96	MACON - WALKER RD PH	ELEVENTH STREET	SWF/LF, Financial Assurance	Higher	2455, 0.465, WSW
Q97	WORLD TIRE INC (SITE	INTERSECTION OF MLK	LUST, UST, Financial Assurance	Higher	2479, 0.470, SSW
P98	SPRING & RIVERSIDE E	893 RIVERSIDE DR	LUST, FINDS	Higher	2486, 0.471, NW
O99	FIRESTONE STORE #054	595 SECOND ST	LUST, UST, Financial Assurance	Higher	2498, 0.473, WSW
S100	YOMANS CHEVROLET CO	630 THIRD ST	LUST, RCRA NonGen / NLR	Higher	2542, 0.481, SW
S101	YOMANS CHEVROLET	601-647 3RD ST.	GA NON-HSI	Higher	2574, 0.488, SW
102	MACON FORMER MANUFAC	SPRING STREET AND RI	DEL SHWS	Higher	2636, 0.499, NW
103	SE TERMINAL: MACON	US HWY. 41 N	GA NON-HSI	Higher	2746, 0.520, WNW
104	MIDDLE GEORGIA HOSPI	600 NEW STREET	GA NON-HSI	Higher	3212, 0.608, WSW
105	FORMER MIDDLE GEORGI	831 PINE STREET; 818	GA NON-HSI	Higher	3695, 0.700, WSW
106	(FORMER) DENNARD SIN	681 SPRING STREET	GA NON-HSI	Higher	3962, 0.750, WSW
107	TRANSCO RAILCAR FACI	989 SEVENTH STREET	SHWS	Higher	4478, 0.848, SSW

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY..... Federal Facility Site Information listing

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-LQG..... RCRA - Large Quantity Generators
RCRA-SQG..... RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

LUCIS..... Land Use Control Information System
US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROL..... Sites with Institutional Controls

Federal ERNS list

ERNS..... Emergency Response Notification System

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

EXECUTIVE SUMMARY

State and tribal registered storage tank lists

FEMA UST..... Underground Storage Tank Listing
INDIAN UST..... Underground Storage Tanks on Indian Land

State and tribal institutional control / engineering control registries

AUL..... Uniform Environmental Covenants
INST CONTROL..... Public Record List

State and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY..... Recycling Center Listing
HIST LF..... Historical Landfills
INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands
ODI..... Open Dump Inventory
DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations
IHS OPEN DUMPS..... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL..... Delisted National Clandestine Laboratory Register
CDL..... Clandestine Drug Labs
US CDL..... National Clandestine Laboratory Register

Local Land Records

LIENS 2..... CERCLA Lien Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System
SPILLS..... Spills Information
SPILLS 90..... SPILLS 90 data from FirstSearch

Other Ascertainable Records

FUDS..... Formerly Used Defense Sites
DOD..... Department of Defense Sites
SCRD DRYCLEANERS..... State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR..... Financial Assurance Information
EPA WATCH LIST..... EPA WATCH LIST
2020 COR ACTION..... 2020 Corrective Action Program List
TSCA..... Toxic Substances Control Act
TRIS..... Toxic Chemical Release Inventory System
SSTS..... Section 7 Tracking Systems
ROD..... Records Of Decision

EXECUTIVE SUMMARY

RMP.....	Risk Management Plans
RAATS.....	RCRA Administrative Action Tracking System
PRP.....	Potentially Responsible Parties
PADS.....	PCB Activity Database System
ICIS.....	Integrated Compliance Information System
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS.....	Material Licensing Tracking System
COAL ASH DOE.....	Steam-Electric Plant Operation Data
COAL ASH EPA.....	Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER.....	PCB Transformer Registration Database
RADINFO.....	Radiation Information Database
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS.....	Incident and Accident Data
CONSENT.....	Superfund (CERCLA) Consent Decrees
INDIAN RESERV.....	Indian Reservations
FUSRAP.....	Formerly Utilized Sites Remedial Action Program
UMTRA.....	Uranium Mill Tailings Sites
LEAD SMELTERS.....	Lead Smelter Sites
US AIRS.....	Aerometric Information Retrieval System Facility Subsystem
US MINES.....	Mines Master Index File
FINDS.....	Facility Index System/Facility Registry System
UXO.....	Unexploded Ordnance Sites
DOCKET HWC.....	Hazardous Waste Compliance Docket Listing
AIRS.....	Permitted Facility and Emissions Listing
COAL ASH.....	Coal Ash Disposal Site Listing
NPDES.....	NPDES Wastewater Permit List
TIER 2.....	Tier 2 Data Listing
ABANDONED MINES.....	Abandoned Mines
ECHO.....	Enforcement & Compliance History Information
FUELS PROGRAM.....	EPA Fuels Program Registered Listing

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS.....	Recovered Government Archive State Hazardous Waste Facilities List
RGA LF.....	Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

EXECUTIVE SUMMARY

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS list

SEMS: SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly known as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the SEMS list, as provided by EDR, and dated 03/07/2016 has revealed that there is 1 SEMS site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MACON GAS LIGHT AND	137 MULBERRY STREET	SSE 1/8 - 1/4 (0.225 mi.)	K68	64

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 03/07/2016 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
FICKLIN AND WALKER	577 MULBERRY ST	W 1/8 - 1/4 (0.191 mi.)	J66	62

Federal RCRA generators list

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 06/21/2016 has revealed that there is

EXECUTIVE SUMMARY

1 RCRA-CESQG site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
GENERAL RAILWAY SVCS	200 7TH ST	SE 1/8 - 1/4 (0.236 mi.)	73	75

State- and tribal - equivalent CERCLIS

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Natural Resources' Hazardous Site Inventory.

A review of the SHWS list, as provided by EDR, and dated 07/01/2016 has revealed that there are 2 SHWS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
TRANSCO RAILCAR FACI Facility Id: 10502	989 SEVENTH STREET	SSW 1/2 - 1 (0.848 mi.)	107	158
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MACON MGP SITE Facility Id: 10511	137 MULBERRY STREET	SSE 1/8 - 1/4 (0.225 mi.)	K71	73

GA NON-HSI: Georgia Non Hazardous Site Inventory Sites.

A review of the GA NON-HSI list, as provided by EDR, and dated 06/30/2016 has revealed that there are 9 GA NON-HSI sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN TIRE & AUTO I	852 RIVERSIDE DRIVE	NW 1/4 - 1/2 (0.449 mi.)	P90	139
YOMANS CHEVROLET	601-647 3RD ST.	SW 1/4 - 1/2 (0.488 mi.)	S101	156
SE TERMINAL: MACON	US HWY. 41 N	WNW 1/2 - 1 (0.520 mi.)	103	157
MIDDLE GEORGIA HOSPI	600 NEW STREET	WSW 1/2 - 1 (0.608 mi.)	104	158
FORMER MIDDLE GEORGI	831 PINE STREET; 818	WSW 1/2 - 1 (0.700 mi.)	105	158
(FORMER) DENNARD SIN	681 SPRING STREET	WSW 1/2 - 1 (0.750 mi.)	106	158
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CADUCEUS PROPERTY (F	167 RIVERSIDE DRIVE	ESE 1/8 - 1/4 (0.185 mi.)	65	62
RIVERSIDE DRIVE PROP	695 RIVERSIDE DRIVE	NW 1/4 - 1/2 (0.262 mi.)	L75	79
ATLANTA GAS LIGHT CO	MULBERRY ST.	SSE 1/4 - 1/2 (0.300 mi.)	80	83

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the Department of Natural Resources' Operating Solid Waste Facilities' list.

A review of the SWF/LF list, as provided by EDR, and dated 06/28/2016 has revealed that there are 3

EXECUTIVE SUMMARY

SWF/LF sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
DAVID W. THORNTON Permit Number: PBR-011-29IL	686 POPLAR STREET	WSW 1/4 - 1/2 (0.454 mi.)	93	143
CITY OF MACON LANDFI Permit Number: PBR-011-37IL	327 LOWER POPLAR ST	WSW 1/4 - 1/2 (0.465 mi.)	R95	144
MACON - WALKER RD PH Permit Number: 011-017D(SL) Operating Status: Operating	ELEVENTH STREET	WSW 1/4 - 1/2 (0.465 mi.)	R96	145

State and tribal leaking storage tank lists

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Natural Resources' Confirmed Release List.

A review of the LUST list, as provided by EDR, and dated 05/27/2016 has revealed that there are 25 LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MACON TELEGRAPH PUBL Cleanup Status: NFA - Combined Release Cleanup Status: NFA - Remediation Act Sys Facility Id: 04110030	139 BROADWAY	0 - 1/8 (0.000 mi.)	A1	8
PUBLIC SAF-T-OIL SER Cleanup Status: NFA - No Further Action Facility Id: 04110187	301 WALNUT ST	SSE 0 - 1/8 (0.017 mi.)	C11	17
CASSIDYS GARAGE Cleanup Status: NFA -Monitoring Only (MNA) Facility Id: 09011110	423 MULBERRY ST	SW 0 - 1/8 (0.078 mi.)	F28	32
MAULDIN & JENKINS PR Cleanup Status: NFA - No Further Action Facility Id: 09011213	439 MULBURY STREET	SW 0 - 1/8 (0.079 mi.)	F30	37
OLD WESTERN UNION Cleanup Status: NFA - Remediation Facility Id: 09011179	310 CHERRY STREET	SSW 1/4 - 1/2 (0.277 mi.)	76	79
GEORGIA DEPARTMENT O Cleanup Status: NFA - No Further Action Facility Id: 01420017	3.1 MILES NE OF I-16	NW 1/4 - 1/2 (0.281 mi.)	L77	81
PALMER IND INC Cleanup Status: NFA - No Further Action Facility Id: 09011194	450 MLK JR BLVD	SSW 1/4 - 1/2 (0.292 mi.)	M79	82
STRAIGHT EIGHT CORP/ Cleanup Status: NFA - No Further Action Facility Id: 09011224	454 TERMINAL AVE	S 1/4 - 1/2 (0.312 mi.)	81	84
LOT #44 GOODYEAR Cleanup Status: NFA - No Further Action	486 BROADWAY	SSW 1/4 - 1/2 (0.321 mi.)	M82	85

EXECUTIVE SUMMARY

Facility Id: 04110367				
DOWNTOWN CHEVRON SER	311 FIRST ST	W 1/4 - 1/2 (0.340 mi.)	83	86
Cleanup Status: NFA - No Further Action				
Facility Id: 04110107				
NORFOLK SOUTHERN BRO	190 POPLAR STREET	SW 1/4 - 1/2 (0.371 mi.)	84	90
Cleanup Status: NFA - No Further Action				
Facility Id: 09011174				
MACON-BIBB COUNTY TR	815 RIVERSIDE DR	NW 1/4 - 1/2 (0.403 mi.)	N86	92
Cleanup Status: NFA - No Further Action				
Facility Id: 09011141				
BSTMACON MAINR2110	787 CHERRY ST	W 1/4 - 1/2 (0.444 mi.)	88	94
Cleanup Status: NFA - No Further Action				
Facility Id: 04110369				
LOCKSMITH ASSOCIATES	551 PLUM STREET	SW 1/4 - 1/2 (0.449 mi.)	O89	138
Cleanup Status: NFA - No Further Action				
Facility Id: 09011209				
MORGAN TIRE & AUTO I	852 RIVERSIDE DRIVE	NW 1/4 - 1/2 (0.449 mi.)	P90	139
Cleanup Status: NFA - No Further Action				
Facility Id: 09011203				
FORMER CURTIS MATHIS	600 BROADWAY DRIVE	SSW 1/4 - 1/2 (0.450 mi.)	Q91	140
Cleanup Status: NFA -Monitoring Only (MNA)				
Facility Id: 09011202				
FORMER SERVICE STATI	489 COTTON AVENUE	WSW 1/4 - 1/2 (0.453 mi.)	R92	142
Cleanup Status: NFA - No Further Action				
Facility Id: 10002090				
OLD ICE CREAM BUILDI	5TH AND PLUM ST	SSW 1/4 - 1/2 (0.465 mi.)	94	143
Cleanup Status: NFA - No Further Action				
Facility Id: 09011156				
WORLD TIRE INC (SITE	INTERSECTION OF MLK	SSW 1/4 - 1/2 (0.470 mi.)	Q97	150
Cleanup Status: NFA - No Further Action				
Facility Id: 09011157				
SPRING & RIVERSIDE E	893 RIVERSIDE DR	NW 1/4 - 1/2 (0.471 mi.)	P98	152
Cleanup Status: NFA - No Further Action				
Facility Id: 09000192				
FIRESTONE STORE #054	595 SECOND ST	WSW 1/4 - 1/2 (0.473 mi.)	O99	153
Cleanup Status: NFA - No Further Action				
Facility Id: 04110067				
YOUNANS CHEVROLET CO	630 THIRD ST	SW 1/4 - 1/2 (0.481 mi.)	S100	154
Cleanup Status: NFA -Monitoring Only (MNA)				
Cleanup Status: NFA - No Further Action				
Facility Id: 04110299				
Lower Elevation	Address	Direction / Distance	Map ID	Page
BIBB YARNS INC COLIS	155 COLISEUM DR	ENE 1/8 - 1/4 (0.125 mi.)	I62	58
Cleanup Status: NFA - No Further Action				
Facility Id: 09000382				
MACON GAS LIGHT AND	137 MULBERRY STREET	SSE 1/8 - 1/4 (0.225 mi.)	K68	64
Cleanup Status: Transferred				
Facility Id: 09000535				
ANDERSON MCGRUFF	398 EIGHTH ST	SSE 1/4 - 1/2 (0.394 mi.)	85	91

EXECUTIVE SUMMARY

Cleanup Status: NFA - No Further Action
Facility Id: 09000289

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Natural Resources' Underground Storage Tank Database.

A review of the UST list, as provided by EDR, and dated 05/27/2016 has revealed that there are 13 UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MACON TELEGRAPH PUBL Status: Installed Status: Removed From Ground Facility Status: Closed Facility Id: 4110030	139 BROADWAY	0 - 1/8 (0.000 mi.)	A1	8
PUBLIC SAF-T-OIL SER Status: Currently In Use Status: Installed Status: Cathodically Prot Status: Temporarily Out Of Use Status: Closed In Ground <i>*Additional key fields are available in the Map Findings section</i> Facility Status: Active Facility Id: 4110187	301 WALNUT ST	SSE 0 - 1/8 (0.017 mi.)	C10	14
OSAN MARATHON Status: Currently In Use Status: Installed Status: Cathodically Prot Status: Removed From Ground Status: Upgrade Repair Not Marked Facility Status: Active Facility Id: 4110039	277 WALNUT ST	SSE 0 - 1/8 (0.066 mi.)	E23	26
CASSIDYS GARAGE Status: Currently In Use Status: Installed Status: Cathodically Prot Status: Temporarily Out Of Use Status: Removed From Ground <i>*Additional key fields are available in the Map Findings section</i> Facility Status: Closed Facility Id: 9011110	423 MULBERRY ST	SW 0 - 1/8 (0.078 mi.)	F28	32
MAULDIN & JENKINS PR Status: Removed From Ground Status: Installed Status: Upgrade Repair Not Marked Facility Status: Closed Facility Id: 9011213	439 MULBURY STREET	SW 0 - 1/8 (0.079 mi.)	F30	37
SITE 301	301 MULBERRY SITE	S 0 - 1/8 (0.102 mi.)	G46	45

EXECUTIVE SUMMARY

Status: Removed From Ground
 Status: Installed
 Status: Upgrade Repair Not Marked
 Facility Status: Closed
 Facility Id: 9011040

BIBB CO COURTHOUSE &	475 MULBERRY ST	SW 0 - 1/8 (0.104 mi.)	F53	50
Status: Installed				
Status: Closed In Ground				
Status: Upgrade Repair Not Marked				
Facility Status: Closed				
Facility Id: 4110003				

BB&T	201 SECOND STREET	W 1/8 - 1/4 (0.175 mi.)	64	61
Status: Currently In Use				
Status: Installed				
Facility Status: Active				
Facility Id: 9011214				

BIBB COUNTY COURTHOU	601 MULBERRY STREET	W 1/8 - 1/4 (0.220 mi.)	J67	63
Status: Installed				
Status: Removed From Ground Date Unknown				
Status: Upgrade Repair Not Marked				
Facility Status: Closed				
Facility Id: 9011211				

Lower Elevation	Address	Direction / Distance	Map ID	Page
MACON TELEGRAPH PUBL	120 BROADWAY	ESE 0 - 1/8 (0.004 mi.)	A8	11
Status: Installed				
Status: Removed From Ground				
Status: Upgrade Repair Not Marked				
Facility Status: Closed				
Facility Id: 9011009				
GENERAL STEEL CO	224 WALNUT ST	SE 0 - 1/8 (0.115 mi.)	E59	55
Status: Installed				
Status: Removed From Ground				
Status: Upgrade Repair Not Marked				
Facility Status: Closed				
Facility Id: 4110017				
BIBB YARNS INC COLIS	155 COLISEUM DR	ENE 1/8 - 1/4 (0.125 mi.)	I62	58
Status: Installed				
Status: Closed In Ground				
Status: Upgrade Repair Not Marked				
Status: Removed From Ground				
Facility Status: Closed				
Facility Id: 9000382				
MACON GAS LIGHT AND	137 MULBERRY STREET	SSE 1/8 - 1/4 (0.225 mi.)	K68	64
Status: Installed				
Status: Removed From Ground				
Status: Upgrade Repair Not Marked				
Facility Status: Closed				
Facility Id: 9000535				

EXECUTIVE SUMMARY

AST: A listing of LP gas tank site locations.

A review of the AST list, as provided by EDR, and dated 06/04/2012 has revealed that there are 3 AST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MARATHON #1 Tank Capacity: 480 Number of Tanks: 24	277 WALNUT STREET	SSE 0 - 1/8 (0.066 mi.)	E24	31
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
THE BIBB COMPANY(CLO Tank Capacity: 0 Number of Tanks: 1	155 COLISEUM	ENE 1/8 - 1/4 (0.125 mi.)	I61	58
ATLANTA GAS LIGHT CO Tank Capacity: 0 Number of Tanks: 1	137 MULBERRY STREET	SSE 1/8 - 1/4 (0.225 mi.)	K72	74

State and tribal voluntary cleanup sites

VCP: Georgia's Voluntary Remediation Program Act was created to encourage voluntary investigation and remediation of contaminated properties.

A review of the VCP list, as provided by EDR, and dated 07/14/2016 has revealed that there is 1 VCP site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported	306 TERMINAL AVE.	SSE 1/8 - 1/4 (0.158 mi.)	63	61

State and tribal Brownfields sites

BROWNFIELDS: The Brownfields Public Record lists properties where response actions under the Georgia Hazardous Site Reuse and Redevelopment Act are planned, ongoing or completed.

A review of the BROWNFIELDS list, as provided by EDR, and dated 09/20/2016 has revealed that there is 1 BROWNFIELDS site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
450 MLK JR., BLVD	450 MLK JR, BLVD.(A/	SSW 1/4 - 1/2 (0.292 mi.)	M78	82

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

EXECUTIVE SUMMARY

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 09/20/2016 has revealed that there are 2 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>COCA COLA PROPERTY</i>	<i>658 WALNUT ST</i>	<i>WNW 1/8 - 1/4 (0.238 mi.)</i>	<i>74</i>	<i>76</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>ATLANTA GAS PLANT</i>	<i>137 MULBERRY STREET</i>	<i>SSE 1/8 - 1/4 (0.225 mi.)</i>	<i>K69</i>	<i>70</i>

Local Lists of Hazardous waste / Contaminated Sites

DEL SHWS: A listing of sites delisted from the Hazardous Site Inventory.

A review of the DEL SHWS list, as provided by EDR, and dated 07/01/2016 has revealed that there is 1 DEL SHWS site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>MACON FORMER MANUFAC</i>	<i>SPRING STREET AND RI</i>	<i>NW 1/4 - 1/2 (0.499 mi.)</i>	<i>102</i>	<i>157</i>

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 06/21/2016 has revealed that there are 5 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>GREENWAY BROTHERS BO</i>	<i>353 WALNUT STREET</i>	<i>S 0 - 1/8 (0.039 mi.)</i>	<i>B21</i>	<i>22</i>
<i>FEDERAL BLDG & US CO</i>	<i>475 MULBERRY ST</i>	<i>SW 0 - 1/8 (0.104 mi.)</i>	<i>F52</i>	<i>48</i>
<i>NORFOLK SOUTHERN RAI</i>	<i>225 WALNUT ST</i>	<i>SE 0 - 1/8 (0.113 mi.)</i>	<i>E58</i>	<i>52</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>BIBB CO COLISEUM PLT</i>	<i>155 COLISEUM DR</i>	<i>ENE 1/8 - 1/4 (0.125 mi.)</i>	<i>I60</i>	<i>56</i>
<i>MACON GAS LIGHT AND</i>	<i>137 MULBERRY STREET</i>	<i>SSE 1/8 - 1/4 (0.225 mi.)</i>	<i>K68</i>	<i>64</i>

EXECUTIVE SUMMARY

DRYCLEANERS: A list of drycleaners in the state. The listing includes drycleaner facilities, that use perchloroethylene, that responded to the Notification of Compliance Status forms. It also includes those businesses that are pick-up stores only and do not conduct dry cleaning on site.

A review of the DRYCLEANERS list, as provided by EDR, and dated 12/22/2014 has revealed that there is 1 DRYCLEANERS site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ONE HOUR VALET	444 WALNUT ST	SW 0 - 1/8 (0.017 mi.)	B12	18

A listing of financial assurance information for underground storage tank facilities.

A review of the Financial Assurance list, as provided by EDR, has revealed that there is 1 Financial Assurance site within approximately 0.001 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MACON TELEGRAPH PUBL	139 BROADWAY	0 - 1/8 (0.000 mi.)	A1	8
Database: Financial Assurance 1, Date of Government Version: 05/27/2016 Facility Id: 4110030				

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there are 2 EDR MGP sites within approximately 1 mile of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MACON GAS LIGHT AND	137 MULBERRY STREET	SSE 1/8 - 1/4 (0.225 mi.)	K70	73
MACON GAS LIGHT AND	WILLOW STREET	NW 1/4 - 1/2 (0.426 mi.)	N87	94

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 31 EDR Hist Auto

EXECUTIVE SUMMARY

sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SOLOMON STEVE M JR I Database: EDR Hist Auto, Date of Government Version: 02/20/2007	139 BROADWAY ST	0 - 1/8 (0.000 mi.)	A2	9
STEWART HOOK TEXACO Database: EDR Hist Auto, Date of Government Version: 02/20/2007	185 BROADWAY ST	SSW 0 - 1/8 (0.004 mi.)	B7	11
PEOPLES OIL CO STA N Database: EDR Hist Auto, Date of Government Version: 02/20/2007	301 WALNUT ST	SSE 0 - 1/8 (0.017 mi.)	C9	13
RUTLANDS GARAGE Database: EDR Hist Auto, Date of Government Version: 02/20/2007	182 BROADWAY ST	S 0 - 1/8 (0.017 mi.)	B14	20
CUSTOM BUILT TRANSMI Database: EDR Hist Auto, Date of Government Version: 02/20/2007	399 WALNUT ST	S 0 - 1/8 (0.023 mi.)	B15	20
SOU OIL STORES INC G Database: EDR Hist Auto, Date of Government Version: 02/20/2007	200 BROADWAY ST	SSW 0 - 1/8 (0.035 mi.)	B16	20
ADVANCE OIL CO FILLI Database: EDR Hist Auto, Date of Government Version: 02/20/2007	202 BROADWAY ST	SSW 0 - 1/8 (0.035 mi.)	B17	21
MC GOLDRICK MTR CO I Database: EDR Hist Auto, Date of Government Version: 02/20/2007	470 WALNUT ST	WSW 0 - 1/8 (0.039 mi.)	D18	21
HUGHES AUTOMOTIVE Database: EDR Hist Auto, Date of Government Version: 02/20/2007	355 WALNUT ST	S 0 - 1/8 (0.039 mi.)	B19	21
GREENWAY BROTHERS BO Database: EDR Hist Auto, Date of Government Version: 02/20/2007	353 WALNUT ST	S 0 - 1/8 (0.039 mi.)	B20	21
M C SHEFFIELD AUTO Database: EDR Hist Auto, Date of Government Version: 02/20/2007	212 3RD ST	WSW 0 - 1/8 (0.057 mi.)	D22	26
BALKCOM THOS L FILLI Database: EDR Hist Auto, Date of Government Version: 02/20/2007	277 WALNUT ST	SSE 0 - 1/8 (0.066 mi.)	E25	31
NUTTING SARAH C MRS Database: EDR Hist Auto, Date of Government Version: 02/20/2007	210 3RD ST	WSW 0 - 1/8 (0.069 mi.)	D26	32
MC GOLDRICK MOTOR CO Database: EDR Hist Auto, Date of Government Version: 02/20/2007	240 3RD ST	WSW 0 - 1/8 (0.074 mi.)	D27	32
CASSIDYS GARAGE Database: EDR Hist Auto, Date of Government Version: 02/20/2007	423 MULBERRY ST	SW 0 - 1/8 (0.078 mi.)	F29	37
JONES THOS M FILLING Database: EDR Hist Auto, Date of Government Version: 02/20/2007	265 BROADWAY ST	SSW 0 - 1/8 (0.082 mi.)	F31	39
WISE BOB AUTO SERVIC Database: EDR Hist Auto, Date of Government Version: 02/20/2007	278 BROADWAY ST	SSW 0 - 1/8 (0.084 mi.)	G33	39
COMMUNITY Database: EDR Hist Auto, Date of Government Version: 02/20/2007	267 BROADWAY LN	S 0 - 1/8 (0.090 mi.)	G34	39
KENDALL PETE SERV ST Database: EDR Hist Auto, Date of Government Version: 02/20/2007	405 MULBERRY ST	SSW 0 - 1/8 (0.094 mi.)	F35	40
439 43 CHAPMANS Database: EDR Hist Auto, Date of Government Version: 02/20/2007	439 MULBERRY ST	SW 0 - 1/8 (0.095 mi.)	F36	41
CASSIDYS GARAGE Database: EDR Hist Auto, Date of Government Version: 02/20/2007	401 MULBERRY ST	SSW 0 - 1/8 (0.097 mi.)	F39	42
SWANN L FRANK AUTO R Database: EDR Hist Auto, Date of Government Version: 02/20/2007	403 MULBERRY ST	SSW 0 - 1/8 (0.097 mi.)	F40	42
CASSIDYS GARAGE AUTO Database: EDR Hist Auto, Date of Government Version: 02/20/2007	409 MULBERRY ST	SW 0 - 1/8 (0.097 mi.)	F41	42

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
415 19 CHAPMANS GARA Database: EDR Hist Auto, Date of Government Version: 02/20/2007	415 MULBERRY ST	SW 0 - 1/8 (0.097 mi.)	F42	43
415 19 CHAPMANS GARA Database: EDR Hist Auto, Date of Government Version: 02/20/2007	419 MULBERRY ST	SW 0 - 1/8 (0.097 mi.)	F43	43
439 43 CHAPMANS GARA Database: EDR Hist Auto, Date of Government Version: 02/20/2007	443 MULBERRY ST	SW 0 - 1/8 (0.098 mi.)	F44	44
GULF REFINING CO FIL Database: EDR Hist Auto, Date of Government Version: 02/20/2007	301 MULBERRY ST	S 0 - 1/8 (0.102 mi.)	G47	47
TYLER BROS GARAGE AU Database: EDR Hist Auto, Date of Government Version: 02/20/2007	215 3RD ST	W 0 - 1/8 (0.103 mi.)	H49	47
215 219 HANNAS STORA Database: EDR Hist Auto, Date of Government Version: 02/20/2007	219 3RD ST	W 0 - 1/8 (0.103 mi.)	H50	47
PATTERSON GULF SERVI Database: EDR Hist Auto, Date of Government Version: 02/20/2007	351 MULBERRY ST	SSW 0 - 1/8 (0.110 mi.)	G56	51
BUCKS GARAGE Database: EDR Hist Auto, Date of Government Version: 02/20/2007	225 WALNUT ST	SE 0 - 1/8 (0.113 mi.)	E57	52

EDR Hist Cleaner: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 9 EDR Hist Cleaner sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ONE HOUR VALET CLEAN Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	444 WALNUT ST	SW 0 - 1/8 (0.017 mi.)	B13	19
BONNER THOS E JR DRY Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	284 BROADWAY ST	SSW 0 - 1/8 (0.083 mi.)	F32	39
ROBERTSON LAFAYETTE Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	315 BROADWAY ST	S 0 - 1/8 (0.095 mi.)	G37	41
SMITH JOS B CLO CLNR Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	319 BROADWAY ST	S 0 - 1/8 (0.096 mi.)	G38	42
FELIX BANKS Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	314 BROADWAY ST	S 0 - 1/8 (0.100 mi.)	G45	45
B & B ONE DAY CLEAN Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	397 MULBERRY ST	SSW 0 - 1/8 (0.102 mi.)	F48	47
ONE DAY CLEANERS Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	393 MULBERRY ST	SSW 0 - 1/8 (0.104 mi.)	F51	48
BONNER ONE HOUR CLEA Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	375 MULBERRY ST	SSW 0 - 1/8 (0.105 mi.)	G54	51
BEAU BRUMMEL LNDRY Database: EDR Hist Cleaner, Date of Government Version: 02/20/2007	255 3RD ST	WSW 0 - 1/8 (0.110 mi.)	H55	51

EXECUTIVE SUMMARY

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LUST: The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Environmental Protection Division in Georgia.

A review of the RGA LUST list, as provided by EDR, has revealed that there are 4 RGA LUST sites within approximately 0.001 miles of the target property.


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MACON TELEGRAPH PUBL Facility ID: 4110030 Facility ID: 4-110030	139 BROADWAY	0 - 1/8 (0.000 mi.)	A3	10
MACON TELEGRAPH PUBL Facility ID: 4110030 Facility ID: 4110030.0 Facility ID: 4-110030	139 BROADWAY	0 - 1/8 (0.000 mi.)	A4	10
MACON TELEGRAPH & NE Facility ID: 4-110030	139 BROADWAY	0 - 1/8 (0.000 mi.)	A5	10
MACON TELEGRAPH & NE Facility ID: 4-110030	139 BROADWAY	0 - 1/8 (0.000 mi.)	A6	11

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 7 records.

<u>Site Name</u>	<u>Database(s)</u>
JM HUBER CORP	VCP
WALKER ROAD LANDFILL (FORMERLY 11T	LUST, UST, Financial Assurance
WEATHERBY MANAGEMENT CORPORATION	SHWS
CORNELL-YOUNG DIVISION, BLUE CIRCL	SWF/LF
CB&T BANK OF MIDDLE GEORGIA	SWF/LF
WILLIE BATTLE INERT LANDFILL	SWF/LF

OVERVIEW MAP - 4793950.2S

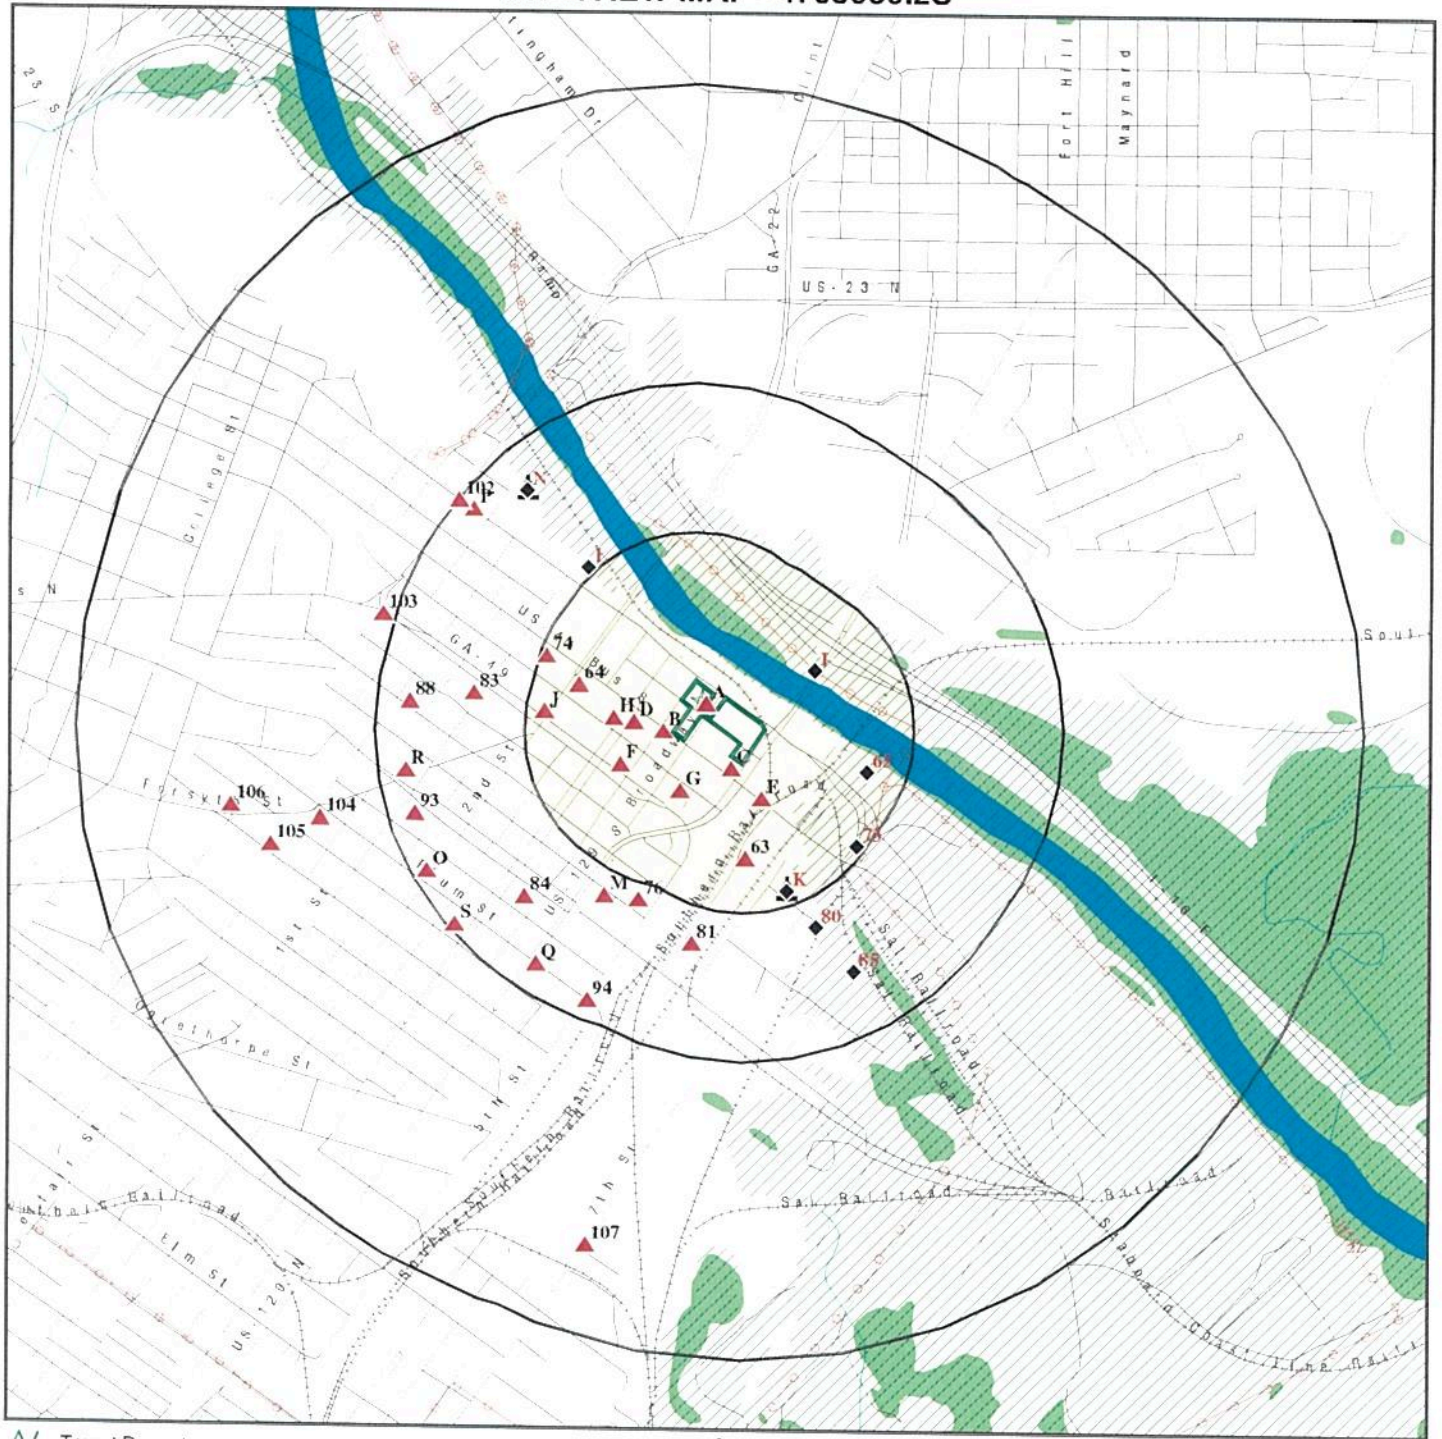

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- Power transmission lines
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory
- State Wetlands

0 1/4 1/2 1 Miles

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Former Macon Telegraph Assemblage
 ADDRESS: Riverside Dr and Martin Luther King Blvd
 Macon GA 31201
 LAT/LONG: 32.8384 / 83.6233

CLIENT: Resolute Environmental and Water Resources Consult
 CONTACT: Keith Ziobron
 INQUIRY #: 4793950.2s
 DATE: November 30, 2016 5:35 pm

DETAIL MAP - 4793950.2S



- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- Power transmission lines
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Former Macon Telegraph Assemblage
 ADDRESS: Riverside Dr and Martin Luther King Blvd
 Macon GA 31201
 LAT/LONG: 32.8384 / 83.6233

CLIENT: Resolute Environmental and Water Resources Consult
 CONTACT: Keith Ziobron
 INQUIRY #: 4793950.2s
 DATE: November 30, 2016 5:38 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Federal NPL site list								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	0.001		0	NR	NR	NR	NR	0
Federal Delisted NPL site list								
Delisted NPL	1.000		0	0	0	0	NR	0
Federal CERCLIS list								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	1	0	NR	NR	1
Federal CERCLIS NFRAP site list								
SEMS-ARCHIVE	0.500		0	1	0	NR	NR	1
Federal RCRA CORRACTS facilities list								
CORRACTS	1.000		0	0	0	0	NR	0
Federal RCRA non-CORRACTS TSD facilities list								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Federal RCRA generators list								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-CESQG	0.250		0	1	NR	NR	NR	1
Federal institutional controls / engineering controls registries								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROL	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	0.001		0	NR	NR	NR	NR	0
State- and tribal - equivalent CERCLIS								
SHWS	1.000		0	1	0	1	NR	2
GA NON-HSI	1.000		0	1	4	4	NR	9
State and tribal landfill and/or solid waste disposal site lists								
SWF/LF	0.500		0	0	3	NR	NR	3
State and tribal leaking storage tank lists								
LUST	0.500		4	2	19	NR	NR	25
INDIAN LUST	0.500		0	0	0	NR	NR	0
State and tribal registered storage tank lists								
FEMA UST	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
UST	0.250		9	4	NR	NR	NR	13
AST	0.250		1	2	NR	NR	NR	3
INDIAN UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
AUL	0.500		0	0	0	NR	NR	0
INST CONTROL	0.500		0	0	0	NR	NR	0
State and tribal voluntary cleanup sites								
VCP	0.500		0	1	0	NR	NR	1
INDIAN VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
BROWNFIELDS	0.500		0	0	1	NR	NR	1
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	2	0	NR	NR	2
Local Lists of Landfill / Solid Waste Disposal Sites								
SWRCY	0.500		0	0	0	NR	NR	0
HIST LF	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	0.001		0	NR	NR	NR	NR	0
CDL	0.001		0	NR	NR	NR	NR	0
DEL SHWS	1.000		0	0	1	0	NR	1
US CDL	0.001		0	NR	NR	NR	NR	0
Local Land Records								
LIENS 2	0.001		0	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.001		0	NR	NR	NR	NR	0
SPILLS	0.001		0	NR	NR	NR	NR	0
SPILLS 90	0.001		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		3	2	NR	NR	NR	5
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
US FIN ASSUR	0.001		0	NR	NR	NR	NR	0
EPA WATCH LIST	0.001		0	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	0.001		0	NR	NR	NR	NR	0
TRIS	0.001		0	NR	NR	NR	NR	0
SSTS	0.001		0	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	0.001		0	NR	NR	NR	NR	0
RAATS	0.001		0	NR	NR	NR	NR	0
PRP	0.001		0	NR	NR	NR	NR	0
PADS	0.001		0	NR	NR	NR	NR	0
ICIS	0.001		0	NR	NR	NR	NR	0
FTTS	0.001		0	NR	NR	NR	NR	0
MLTS	0.001		0	NR	NR	NR	NR	0
COAL ASH DOE	0.001		0	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	0.001		0	NR	NR	NR	NR	0
RADINFO	0.001		0	NR	NR	NR	NR	0
HIST FTTS	0.001		0	NR	NR	NR	NR	0
DOT OPS	0.001		0	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	0.001		0	NR	NR	NR	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	0.001		0	NR	NR	NR	NR	0
US AIRS	0.001		0	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
FINDS	0.001		0	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0
DOCKET HWC	0.001		0	NR	NR	NR	NR	0
AIRS	0.001		0	NR	NR	NR	NR	0
COAL ASH	0.500		0	0	0	NR	NR	0
DRYCLEANERS	0.250		1	0	NR	NR	NR	1
Financial Assurance	0.001		1	NR	NR	NR	NR	1
NPDES	0.001		0	NR	NR	NR	NR	0
TIER 2	0.001		0	NR	NR	NR	NR	0
ABANDONED MINES	TP		NR	NR	NR	NR	NR	0
ECHO	0.001		0	NR	NR	NR	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP	1.000		0	1	1	0	NR	2
EDR Hist Auto	0.125		31	NR	NR	NR	NR	31
EDR Hist Cleaner	0.125		9	NR	NR	NR	NR	9

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS	0.001		0	NR	NR	NR	NR	0
---------	-------	--	---	----	----	----	----	---

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
RGA LF	0.001		0	NR	NR	NR	NR	0
RGA LUST	0.001		4	NR	NR	NR	NR	4
- Totals --		0	63	19	29	5	0	116

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A1

< 1/8
1 ft.

MACON TELEGRAPH PUBLISHING COMPA
139 BROADWAY
MACON, GA 31206

LUST U001486704
UST N/A
Financial Assurance

Site 1 of 7 in cluster A

Relative:
Higher

LUST:

Actual:
315 ft.

Facility ID: 04110030
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - Combined Release
Date Received: 11/21/1991
Project Officer: Fonge,Cyprian

Facility ID: 04110030
Leak ID: 2
Description: Confirmed Release
Cleanup Status: NFA - Remediation Act Sys
Date Received: 04/30/2002
Project Officer: Jones,F. Calvin

Facility:

Facility Id: 4110030
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 5027
Owner Name: MACON TELEGRAPH PUBLISHING COMPANY
Owner Address: PO BOX 4167
Owner City: MACON
Owner State: GA
Owner Zip: 31208
Owner City,St,Zip: MACON, GA 31208
Owner Telephone: 478-744-4249

Tanks:

Tank ID: 1
Status: Removed From Ground
Status Date: 10/01/1987

Tank ID: 1
Status: Installed
Status Date: 02/01/1971

Tank ID: 1
Product1: Gas
Material: Bare Steel
Capacity: 4000
Pipe Material: Bare Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Installed
Status Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON TELEGRAPH PUBLISHING COMPA (Continued)

U001486704

Tank ID: 2
Status: Removed From Ground
Status Date: 11/12/2004

Tank ID: 2
Product1: Gas
Material: Marked Unknown
Capacity: 5000
Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 3
Status: Installed
Status Date: Not reported

Tank ID: 3
Status: Removed From Ground
Status Date: 11/12/2004

Tank ID: 3
Product1: Gas
Material: Marked Unknown
Capacity: 5000
Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 4110030
Financial Responsibility: G.U.S.T. Trust Fund

A2 SOLOMON STEVE M JR INC AUTO
139 BROADWAY ST
< 1/8 MACON, GA 31201
1 ft.

EDR Hist Auto 1014929951
N/A

Site 2 of 7 in cluster A

Relative:
Higher

EDR Historical Auto Stations:

Actual:
315 ft.

Name: SOLOMON STEVE M JR INC AUTO
Year: 1966
Type: AUTOMOBILE REPAIRING

Name: GRAYSON ROSE MR TRANSMISSION
Year: 1971
Type: AUTOMOBILE REPAIRING

Name: MR TRANSMISSION
Year: 1975

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLOMON STEVE M JR INC AUTO (Continued)

1014929951

Type: AUTOMOBILE REPAIRING
Name: BROWN ED GARAGE INC
Year: 1975
Type: AUTOMOBILE REPAIRING

A3 **MACON TELEGRAPH PUBLISHING COMPANY**
139 BROADWAY
MACON, GA

RGA LUST **S115543723**
N/A

< 1/8
1 ft.

Site 3 of 7 in cluster A

Relative: RGA LUST:
Higher
Actual: 2000 MACON TELEGRAPH PUBLISHING COMPANY 139 BROADWAY
315 ft. 1999 MACON TELEGRAPH PUBLISHING COMPANY 139 BROADWAY
1998 MACON TELEGRAPH PUBLISHING COMPANY 139 BROADWAY

A4 **MACON TELEGRAPH PUBLISHING COMPA**
139 BROADWAY
MACON, GA

RGA LUST **S115543722**
N/A

< 1/8
1 ft.

Site 4 of 7 in cluster A

Relative: RGA LUST:
Higher
Actual: 2012 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
315 ft. 2011 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2010 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2009 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2008 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2007 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2006 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2005 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2004 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2003 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2002 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY
2001 MACON TELEGRAPH PUBLISHING COMPA 139 BROADWAY

A5 **MACON TELEGRAPH & NEWS**
139 BROADWAY
MACON, GA

RGA LUST **S115543721**
N/A

< 1/8
1 ft.

Site 5 of 7 in cluster A

Relative: RGA LUST:
Higher
Actual: 1995 MACON TELEGRAPH & NEWS 139 BROADWAY
315 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

A6 MACON TELEGRAPH & NEWS GARAGE RGA LUST S115543720
139 BROADWAY
MACON, GA N/A

< 1/8
1 ft.

Site 6 of 7 in cluster A

Relative:
Higher

RGA LUST:

1997 MACON TELEGRAPH & NEWS GARAGE 139 BROADWAY
1996 MACON TELEGRAPH & NEWS GARAGE 139 BROADWAY

Actual:
315 ft.

B7 STEWART HOOK TEXACO
SSW 185 BROADWAY ST
< 1/8 MACON, GA 31201

EDR Hist Auto 1014930184
N/A

0.004 mi.
20 ft.

Site 1 of 10 in cluster B

Relative:
Higher

EDR Historical Auto Stations:

Name: CLANCEIS TEXACO SERVICE
Year: 1966
Type: GASOLINE STATIONS

Actual:
322 ft.

Name: CLANCES TEXACO SERVICE
Year: 1971
Type: GASOLINE STATIONS

Name: CLANCES TEXACO SERVICE
Year: 1975
Type: GASOLINE STATIONS

Name: STEWART HOOK TEXACO
Year: 1980
Type: GASOLINE STATIONS

A8 MACON TELEGRAPH PUBLISHING CO
ESE 120 BROADWAY
< 1/8 MACON, GA 31206

UST U001489795
Financial Assurance N/A

0.004 mi.
23 ft.

Site 7 of 7 in cluster A

Relative:
Lower

Facility:

Facility Id: 9011009
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 5027
Owner Name: MACON TELEGRAPH PUBLISHING COMPANY
Owner Address: PO BOX 4167
Owner City: MACON
Owner State: GA
Owner Zip: 31208
Owner City, St, Zip: MACON, GA 31208
Owner Telephone: 478-744-4249

Actual:
312 ft.

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON TELEGRAPH PUBLISHING CO (Continued)

U001489795

Status Date: 01/01/1987

Tank ID: 1
Status: Installed
Status Date: 01/01/1967

Tank ID: 1
Product1: Gas
Material: Bare Steel
Capacity: 4000
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Removed From Ground
Status Date: 01/01/1987

Tank ID: 2
Status: Installed
Status Date: 01/01/1967

Tank ID: 2
Product1: Gas
Material: Bare Steel
Capacity: 4000
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 3
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 3
Status: Removed From Ground
Status Date: 01/01/1987

Tank ID: 3
Status: Installed
Status Date: 01/01/1967

Tank ID: 3
Product1: Gas
Material: Bare Steel
Capacity: 4000
Pipe Material: Galvanized Steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON TELEGRAPH PUBLISHING CO (Continued)

U001489795

Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 4
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 4
Status: Removed From Ground
Status Date: 01/01/1987

Tank ID: 4
Status: Installed
Status Date: 01/01/1967

Tank ID: 4
Product1: Gas
Material: Bare Steel
Capacity: 4000
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:
Region: 1
Facility ID: 9011009
Financial Responsibility: G.U.S.T. Trust Fund

C9
SSE
< 1/8
0.017 mi.
90 ft.

PEOPLES OIL CO STA NO 2 FILL STA
301 WALNUT ST
MACON, GA

EDR Hist Auto 1014930251
N/A

Site 1 of 3 in cluster C

Relative:
Higher

EDR Historical Auto Stations:

Actual:
320 ft.

Name: PEOPLES OIL CO STA NO 2 FILL STA
Year: 1939
Type: GASOLINE AND OIL SERVICE STATIONS

Name: PUBLIC SAF T OIL SERVICE
Year: 1950
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SUP GAS STA
Year: 1954
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SERV NO
Year: 1959
Type: GASOLINE STATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PEOPLES OIL CO STA NO 2 FILL STA (Continued)

1014930251

Name: PUBLIC SAF T OIL SERVICE NO
Year: 1966
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SUPPLY
Year: 1971
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SUPPLY
Year: 1975
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SERVICE NO 1 GAS STA
Year: 1975
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SERVICE NO 1 GAS STA
Year: 1980
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SERVICE NO 1 GAS STA
Year: 1985
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SERVICE NO 1 GAS STA
Year: 1990
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL SERVICE NO 1 GAS
Year: 1997
Type: GASOLINE STATIONS

Name: PUBLIC SAF T OIL COMPANY GAS SERV STA
Year: 2001
Type: GASOLINE STATIONS

C10 PUBLIC SAF-T-OIL SERVICE
SSE 301 WALNUT ST
< 1/8 MACON, GA 31201
0.017 mi.
90 ft. Site 2 of 3 in cluster C

UST U001486821
Financial Assurance N/A

Relative: Facility:
Higher Facility Id: 4110187
Facility Status: Active
Facility Type: Gas Station
District: West Central
Actual: Contact Id: 57500
320 ft. Owner Name: DONG & KYJUNG INC
Owner Address: 277 WALNUT ST
Owner City: MACON
Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 478-741-8788

Tanks:
Tank ID: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SAF-T-OIL SERVICE (Continued)

U001486821

Status:	Temporarily Out Of Use
Status Date:	06/27/2011
Tank ID:	1
Status:	Cathodically Prot
Status Date:	09/30/1998
Tank ID:	1
Status:	Currently In Use
Status Date:	04/25/1968
Tank ID:	1
Status:	Installed
Status Date:	04/25/1968
Tank ID:	1
Product1:	Gas
Material:	Steel-Impressed Current
Capacity:	19625
Pipe Material:	Fiberglass Reinforced Plastic
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	04/27/1998
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	04/27/1998
Tank ID:	2
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	2
Status:	Closed In Ground
Status Date:	05/01/1991
Tank ID:	2
Status:	Installed
Status Date:	04/25/1968
Tank ID:	2
Product1:	Gas
Material:	Bare Steel
Capacity:	11983
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	3
Status:	Temporarily Out Of Use
Status Date:	06/27/2011
Tank ID:	3
Status:	Cathodically Prot
Status Date:	09/30/1998

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SAF-T-OIL SERVICE (Continued)

U001486821

Tank ID:	3
Status:	Currently In Use
Status Date:	04/25/1976
Tank ID:	3
Status:	Installed
Status Date:	04/25/1976
Tank ID:	3
Product1:	Diesel
Material:	Steel-Imprinted Current
Capacity:	4000
Pipe Material:	Cathodically Protected
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	04/27/1998
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	04/27/1998
Tank ID:	4
Status:	Temporarily Out Of Use
Status Date:	06/27/2011
Tank ID:	4
Status:	Cathodically Prot
Status Date:	09/30/1998
Tank ID:	4
Status:	Currently In Use
Status Date:	05/01/1991
Tank ID:	4
Status:	Installed
Status Date:	05/01/1991
Tank ID:	4
Product1:	Gas
Material:	Steel-Imprinted Current
Capacity:	8000
Pipe Material:	Fiberglass Reinforced Plastic
Pipe Type:	Suction: No Valve At The Tank
Overfill Protection:	Not reported
Overfill Installed:	04/27/1998
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	04/27/1998
Tank ID:	5
Status:	Installed
Status Date:	Not reported
Tank ID:	5
Status:	Temporarily Out Of Use
Status Date:	06/27/2011
Tank ID:	5
Status:	Cathodically Prot
Status Date:	09/30/1998

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SAF-T-OIL SERVICE (Continued)

U001486821

Tank ID: 5
Status: **Currently In Use**
Status Date: 09/30/1998

Tank ID: 5
Product1: Gas
Material: Steel-Imprinted Current
Capacity: 6000
Pipe Material: Fiberglass Reinforced Plastic
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: 04/27/1998
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 04/27/1998

GA Financial Assurance 1:

Region: 1
Facility ID: 4110187
Financial Responsibility: G.U.S.T. Trust Fund

C11 **PUBLIC SAF-T-OIL SERVICE**
SSE **301 WALNUT ST**
< 1/8 **MACON, GA 31201**
0.017 mi.
90 ft. **Site 3 of 3 in cluster C**

LUST **1006775730**
FINDS **N/A**

Relative:
Higher

LUST:

Actual:
320 ft.

Facility ID: 04110187
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 04/25/1991
Project Officer: Taiwo,Michael

FINDS:

Registry ID: 110013450292

Environmental Interest/Information System

GEIMS (Geographic Environmental Information Management System) provides the EPA and Public a single point of access to core data for all facilities and sites regulated or monitored by the EPA and a single system for the reporting of all environmental data.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

B12 ONE HOUR VALET
SW 444 WALNUT ST
< 1/8 MACON, GA 31201
0.017 mi.
91 ft. Site 2 of 10 in cluster B

DRYCLEANERS S109505989
N/A

Relative:
Higher

Actual:
324 ft.

DRYCLN:

Contact Name: Corrinne Johnston
Phone Number: 478-744-0035
Contact Name: Corrinne Johnston
MSA code: 4680
MSA desc: MACON, GA
CBSA code: 31420
CBSA descr: MACON, GA
Metro Micro Indicator: 2
CSA code: 356
Csa descr: MACON-WARNER ROBINS-FORT VALLEY, GA
Census tract: 10700
Census block group: 1
Latitude: 32.837775999999998
Longitude: -83.624435000000005
Match level code: 0
Secondary address: 444 Walnut St
Secondary city: Macon
Secondary state: GA
Secondary zip10: 31201-3408
Secondary carrier route code: C062
Fax number: Not reported
Toll free number: Not reported
Web site: Not reported
Selected SIC code: 721201
Selected SIC desc: Cleaners
Primary SIC code: 721201
Primary SIC desc: Cleaners
NAICS code: 81232002
NAICS desc: Drycleaning & Laundry Svcs
Location employment size code: B
Location employment size desc: 9-May
Actual location employment size: 6
Modeled employment size: A
Location sales volume code: A
Location sales volume desc: Less Than \$500,000
Actual location sales volume: 360
Corporate sales volume code: Not reported
Corporate sales volume desc: Not reported
Actual corporate sales volume: Not reported
Asset size: S
Name: Ms Corrinne Johnston
Title: Owner
Ethnicity code: Scottish
Infousa id: 984195925
Site Number: 984195925
HQ branch code: 9
HQ branch desc: Single Loc
Public company indicator code: 0
Public filing indicator: N
Individual firm code: 2
Individual firm desc: Firm/Business
Year SIC added: 199810

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE HOUR VALET (Continued)

S109505989

Year first appeared in yellow pages: 1998
Yellow page code: 18306
Transaction date: 199810
Call status code: N
Call status desc: Refusal
Credit score code: A
Credit score desc: 90 to 94
Actual credit score: 92
Ad size code: Regular
Population code: 6
Population desc: 50,000 - 99,000
Square footage code: B
Square footage desc: 2,500 - 9,999
Radial distance from target element: -
Actnumbus multitenant location: Not reported
Building num multi tenant: Not reported
Number of pcs code: 0 - 1 PCs
Affluent neighborhood location: N
Big business: N
Female owner exec: N
Highincomeexec: N
Hightechbusiness: N
Medium size business entrepreneur: N
Small business entrepreneur: Y
Tertiary address: Not reported
Tertiary city: Not reported
Tertiary state: Not reported
Tertiary zip10: Not reported
White collar percentage: 29
White collar indicator: 0
Production date: 12/02/2008
Obsolescence date: 06/02/2009
Source: infoUSA
Bookno: 14840

B13
SW
< 1/8
0.017 mi.
91 ft.

ONE HOUR VALET CLEANER DRYCLNG PLTS
444 WALNUT ST
MACON, GA 31201

EDR Hist Cleaner 1014928825
N/A

Site 3 of 10 in cluster B

Relative:
Higher

EDR Historical Cleaners:

Actual:
324 ft.

Name: ONE HOUR VALET CLEANER DRYCLNG PLTS
Year: 2001
Type: CLEANERS

Name: ONE HOUR VALET CLEANER
Year: 2003
Address: 444 WALNUT ST

Name: ONE HOUR VALET CLEANER
Year: 2004
Address: 444 WALNUT ST

Name: ONE HOUR VALET CLEANER
Year: 2006
Address: 444 WALNUT ST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

	Site	Database(s)	EDR ID Number EPA ID Number
B14 South < 1/8 0.017 mi. 91 ft.	RUTLANDS GARAGE 182 BROADWAY ST MACON, GA Site 4 of 10 in cluster B Relative: EDR Historical Auto Stations: Higher Name: RUTLANDS GARAGE Year: 1950 Actual: Type: AUTOMOBILE REPAIRING 320 ft. Name: RUTLANDS GARAGE Year: 1954 Type: AUTOMOBILE REPAIRING	EDR Hist Auto	1014931125 N/A
B15 South < 1/8 0.023 mi. 124 ft.	CUSTOM BUILT TRANSMISSIONS 399 WALNUT ST MACON, GA 31201 Site 5 of 10 in cluster B Relative: EDR Historical Auto Stations: Higher Name: SPIRES SERV STA Year: 1954 Actual: Type: GASOLINE STATIONS 320 ft. Name: RUTLAND SERV STA Year: 1959 Type: GASOLINE STATIONS Name: CUSTOM BUILT TRANSMISSIONS Year: 1975 Type: AUTOMOBILE REPAIRING	EDR Hist Auto	1014930638 N/A
B16 SSW < 1/8 0.035 mi. 186 ft.	SOU OIL STORES INC GAS STA 200 BROADWAY ST MACON, GA Site 6 of 10 in cluster B Relative: EDR Historical Auto Stations: Higher Name: SOU OIL STORES INC GAS STA Year: 1930 Actual: Type: GASOLINE AND OIL SERVICE STATIONS 323 ft. Name: SOU OIL STORES INC FILLING STA Year: 1935 Type: GASOLINE AND OIL SERVICE STATIONS	EDR Hist Auto	1014929803 N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B17 ADVANCE OIL CO FILLING STA
SSW 202 BROADWAY ST
< 1/8 MACON, GA
0.035 mi.
186 ft. Site 7 of 10 in cluster B

EDR Hist Auto 1014930629
N/A

Relative: EDR Historical Auto Stations:
Higher Name: ADVANCE OIL CO FILLING STA
Year: 1939
Actual: Type: GASOLINE AND OIL SERVICE STATIONS
323 ft.
Name: GRAY OIL CO BR
Year: 1950
Type: GASOLINE STATIONS

D18 MC GOLDRICK MTR CO INC USED
WSW 470 WALNUT ST
< 1/8 MACON, GA
0.039 mi.
204 ft. Site 1 of 4 in cluster D

EDR Hist Auto 1014930245
N/A

Relative: EDR Historical Auto Stations:
Higher Name: MC GOLDRICK MTR CO INC USED
Year: 1954
Actual: Type: AUTOMOBILE REPAIRING
326 ft.

B19 HUGHES AUTOMOTIVE
South 355 WALNUT ST
< 1/8 MACON, GA 31201
0.039 mi.
206 ft. Site 8 of 10 in cluster B

EDR Hist Auto 1014929771
N/A

Relative: EDR Historical Auto Stations:
Higher Name: HUGHES AUTOMOTIVE
Year: 1990
Actual: Type: AUTOMOBILE REPAIRING
320 ft.

B20 GREENWAY BROTHERS BODY SHOP
South 353 WALNUT ST
< 1/8 MACON, GA 31201
0.039 mi.
206 ft. Site 9 of 10 in cluster B

EDR Hist Auto 1014930381
N/A

Relative: EDR Historical Auto Stations:
Higher Name: ALEXANDERS GARAGE AUTO REPR
Year: 1966
Actual: Type: AUTOMOBILE REPAIRING
320 ft.
Name: AMNCO TRANSMISSIONS AUTO REPRS
Year: 1971
Type: AUTOMOBILE REPAIRING
Name: AAMCO TRANSMISSIONS AUTO REPRS
Year: 1975
Type: AUTOMOBILE REPAIRING
Name: A A M CO TRANSMISSIONS AUTO REPRS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREENWAY BROTHERS BODY SHOP (Continued)

1014930381

Year: 1980
Type: AUTOMOBILE REPAIRING

Name: A A M CO TRANSMISSIONS AUTO REPRS
Year: 1985
Type: AUTOMOBILE REPAIRING

Name: GREENWAY BROTHERS BODY SHOP AUTO
Year: 1990
Type: AUTOMOBILE REPAIRING

Name: GREENWAY BROTHERS BODY SHOP
Year: 1997
Type: AUTOMOBILE REPAIRING & SERVICE

Name: GREENWAY BROTHERS BODY SHOP INCORPORATED
Year: 1999
Address: 353 WALNUT ST

Name: GREENWAY BROTHERS BODY SHOP INCORPORATED
Year: 2000
Address: 353 WALNUT ST

Name: GREENWAY BROTHERS BODY SHOP
Year: 2002
Address: 353 WALNUT ST

Name: GREENWAY BROTHERS BODY SHOP INC
Year: 2003
Address: 353 WALNUT ST

Name: GREENWAY BROTHERS BODY SHOP INC
Year: 2004
Address: 353 WALNUT ST

Name: GREENWAY BROTHERS BODY SHOP INC
Year: 2005
Address: 353 WALNUT ST

B21
South
< 1/8
0.039 mi.
206 ft.

GREENWAY BROTHERS BODY SHOP
353 WALNUT STREET
MACON, GA 31201

RCRA NonGen / NLR **1001231904**
FINDS **GAR000015859**
ECHO

Relative:
Higher

RCRA NonGen / NLR:

Date form received by agency: 07/07/2006

Facility name: GREENWAY BROTHERS BODY SHOP

Facility address: 353 WALNUT STREET
MACON, GA 312013405

EPA ID: GAR000015859
Mailing address: WALNUT STREET
MACON, GA 312013405

Contact: TONY COFFMAN
Contact address: 353 WALNUT STREET
MACON, GA 312013405

Contact country: US
Contact telephone: (912) 353-5121

Actual:
320 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREENWAY BROTHERS BODY SHOP (Continued)

1001231904

Contact email: Not reported
EPA Region: 04
Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: COFFMAN TONY
Owner/operator address: 353 WALNUT STREET
MACON, GA 31201
Owner/operator country: Not reported
Owner/operator telephone: (912) 353-5121
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GREENWAY BROTHERS BODY SHOP
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 06/01/2006
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Waste code: D001
Waste name: IGNITABLE WASTE

Waste code: D002
Waste name: CORROSIVE WASTE

Waste code: F001
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:
TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE,
1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED
FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING
CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREENWAY BROTHERS BODY SHOP (Continued)

1001231904

ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F002
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F003
Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F005
Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F006
Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Historical Generators:

Date form received by agency: 10/26/1998

Site name: GREENWAY BROTHERS BODY SHOP

Classification: Conditionally Exempt Small Quantity Generator

Waste code: D001
Waste name: IGNITABLE WASTE

Waste code: F001
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREENWAY BROTHERS BODY SHOP (Continued)

1001231904

FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F002
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F003
Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F005
Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 09/14/1998
Evaluation: COMPLIANCE ASSISTANCE VISIT
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

FINDS:

Registry ID: 110005715994

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREENWAY BROTHERS BODY SHOP (Continued)

1001231904

corrective action activities required under RCRA.

ECHO:

Envid: 1001231904
Registry ID: 110005715994
DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110005715994

D22 **M C SHEFFIELD AUTO**
WSW **212 3RD ST**
< 1/8 **MACON, GA**
0.057 mi.
299 ft. **Site 2 of 4 in cluster D**

EDR Hist Auto **1014931322**
N/A

Relative: EDR Historical Auto Stations:
Higher Name: M C SHEFFIELD AUTO
Year: 1925
Actual: Type: AUTOMOBILE REPAIRERS
327 ft.

E23 **OSAN MARATHON**
SSE **277 WALNUT ST**
< 1/8 **MACON, GA 31201**
0.066 mi.
350 ft. **Site 1 of 6 in cluster E**

UST **1006775802**
FINDS **N/A**
Financial Assurance

Relative: Facility:
Higher Facility Id: 4110039
Facility Status: Active
Actual: Facility Type: Gas Station
317 ft. District: West Central
Contact Id: 2141
Owner Name: OSAN PETROLEUM CO INC
Owner Address: PO BOX 2285
Owner City: MACON
Owner State: GA
Owner Zip: 31203
Owner City,St,Zip: MACON, GA 31203
Owner Telephone: 478-742-4534

Tanks:

Tank ID: 044
Status: **Cathodically Prot**
Status Date: 03/17/1997

Tank ID: 044
Status: **Currently In Use**
Status Date: 01/01/1988

Tank ID: 044
Status: **Installed**
Status Date: 01/01/1988

Tank ID: 044
Product1: Gas
Material: Steel-Imprinted Current
Capacity: 8000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OSAN MARATHON (Continued)

1006775802

Pipe Material: Fiberglass Reinforced Plastic
Pipe Type: Pressure
Overfill Protection: Not reported
Overfill Installed: 02/01/1988
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 02/01/1988

Tank ID: 045
Status: Cathodically Prot
Status Date: 03/17/1997

Tank ID: 045
Status: Installed
Status Date: 01/01/1988

Tank ID: 045
Status: Currently In Use
Status Date: 01/01/1988

Tank ID: 045
Product1: Gas
Material: Steel-Impressed Current
Capacity: 8000
Pipe Material: Fiberglass Reinforced Plastic
Pipe Type: Pressure
Overfill Protection: Not reported
Overfill Installed: 02/01/1988
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 02/01/1988

Tank ID: 046
Status: Cathodically Prot
Status Date: 03/17/1997

Tank ID: 046
Status: Currently In Use
Status Date: 01/01/1988

Tank ID: 046
Status: Installed
Status Date: 01/01/1988

Tank ID: 046
Product1: Gas
Material: Steel-Impressed Current
Capacity: 8000
Pipe Material: Fiberglass Reinforced Plastic
Pipe Type: Pressure
Overfill Protection: Not reported
Overfill Installed: 02/01/1988
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 02/01/1988

Tank ID: 047
Status: Cathodically Prot
Status Date: 03/17/1997

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OSAN MARATHON (Continued)

1006775802

Tank ID:	047
Status:	Currently In Use
Status Date:	02/01/1968
Tank ID:	047
Status:	Installed
Status Date:	02/01/1968
Tank ID:	047
Product1:	Diesel
Material:	Steel-Impressed Current
Capacity:	10061
Pipe Material:	Double Walled
Pipe Type:	Pressure
Overfill Protection:	Not reported
Overfill Installed:	02/01/1988
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	02/01/1988
Tank ID:	048
Status:	Cathodically Prot
Status Date:	03/17/1997
Tank ID:	048
Status:	Installed
Status Date:	01/01/1988
Tank ID:	048
Status:	Currently In Use
Status Date:	01/01/1988
Tank ID:	048
Product1:	Kerosene
Material:	Steel-Impressed Current
Capacity:	1011
Pipe Material:	Fiberglass Reinforced Plastic
Pipe Type:	Suction: Valve At The Tank
Overfill Protection:	Not reported
Overfill Installed:	02/01/1988
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	02/01/1988
Tank ID:	1
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	1
Status:	Removed From Ground
Status Date:	09/15/1988
Tank ID:	1
Status:	Installed
Status Date:	02/01/1968
Tank ID:	1
Product1:	Gas
Material:	Bare Steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OSAN MARATHON (Continued)

1006775802

Capacity: 4010
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Removed From Ground
Status Date: 09/15/1988

Tank ID: 2
Status: Installed
Status Date: 02/01/1968

Tank ID: 2
Product1: Gas
Material: Bare Steel
Capacity: 4010
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 3
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 3
Status: Removed From Ground
Status Date: 09/15/1988

Tank ID: 3
Status: Installed
Status Date: 02/01/1968

Tank ID: 3
Product1: Gas
Material: Bare Steel
Capacity: 4010
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 4
Status: Upgrade Repair Not Marked
Status Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OSAN MARATHON (Continued)

1006775802

Tank ID:	4
Status:	Removed From Ground
Status Date:	09/15/1988
Tank ID:	4
Status:	Installed
Status Date:	02/01/1968
Tank ID:	4
Product1:	Gas
Material:	Bare Steel
Capacity:	4010
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	5
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	5
Status:	Removed From Ground
Status Date:	09/15/1988
Tank ID:	5
Status:	Installed
Status Date:	02/01/1968
Tank ID:	5
Product1:	Gas
Material:	Bare Steel
Capacity:	1990
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported

FINDS:

Registry ID: 110013451013

Environmental Interest/Information System

GEIMS (Geographic Environmental Information Management System) provides the EPA and Public a single point of access to core data for all facilities and sites regulated or monitored by the EPA and a single system for the reporting of all environmental data.

GA Financial Assurance 1:

Region: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OSAN MARATHON (Continued)

1006775802

Facility ID: 4110039
Financial Responsibility: G.U.S.T. Trust Fund

E24 MARATHON #1
SSE 277 WALNUT STREET
< 1/8 MACON, GA 31201
0.066 mi.
350 ft. Site 2 of 6 in cluster E

AST A100327934
N/A

Relative: AST:
Higher Owner Name: Gas Incorporated
Owner Address: P. o. Box 730
Actual: Owner City/State/Zip: Lawrenceville Ga 31201
317 ft. Number Of Tanks: 24
Tank Capacity: 480

E25 BALKCOM THOS L FILLING STA
SSE 277 WALNUT ST
< 1/8 MACON, GA
0.066 mi.
350 ft. Site 3 of 6 in cluster E

EDR Hist Auto 1014931044
N/A

Relative: EDR Historical Auto Stations:
Higher Name: SAWYER COAL & ICE CO FILL STA
Year: 1935
Actual: Type: GASOLINE AND OIL SERVICE STATIONS
317 ft.
Name: BALKCOM THOS L FILLING STA
Year: 1939
Type: GASOLINE AND OIL SERVICE STATIONS
Name: CENTRAL OIL CO INC
Year: 1950
Type: GASOLINE STATIONS
Name: HALLIGAN CHAS L AUTO REPR
Year: 1954
Type: AUTOMOBILE REPAIRING
Name: CENTRAL OIL CO SERV STA
Year: 1954
Type: GASOLINE STATIONS
Name: CENTRAL OIL CO SERV STA
Year: 1959
Type: GASOLINE STATIONS
Name: CENTRAL OIL CO SERV STA
Year: 1966
Type: GASOLINE STATIONS
Name: CENTRAL OIL CO
Year: 1971
Type: GASOLINE STATIONS
Name: CENTRAL OIL CO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BALCOM THOS L FILLING STA (Continued)

1014931044

Year: 1975
Type: GASOLINE STATIONS

D26
WSW
< 1/8
0.069 mi.
363 ft.
NUTTING SARAH C MRS AUTO LNDRY
210 3RD ST
MACON, GA
Site 3 of 4 in cluster D

EDR Hist Auto **1014929947**
N/A

Relative: EDR Historical Auto Stations:
Higher Name: ALBERT HARRIS AUTO
Year: 1925
Type: AUTOMOBILE LAUNDRIES

Name: NUTTING SARAH C MRS AUTO LNDRY
Year: 1935
Type: AUTOMOBILE LAUNDRIES

Name: NUTTING SARAH C MRS AUTO LNDRY
Year: 1939
Type: AUTOMOBILE LAUNDRIES

Actual:
327 ft.

D27
WSW
< 1/8
0.074 mi.
389 ft.
MC GOLDRICK MOTOR CO INC
240 3RD ST
MACON, GA
Site 4 of 4 in cluster D

EDR Hist Auto **1014931069**
N/A

Relative: EDR Historical Auto Stations:
Higher Name: C & T AUTOMOTIVE
Year: 1950
Type: AUTOMOBILE REPAIRING

Name: MC GOLDRICK MOTOR CO INC
Year: 1954
Type: AUTOMOBILE REPAIRING

Actual:
329 ft.

F28
SW
< 1/8
0.078 mi.
414 ft.
CASSIDYS GARAGE
423 MULBERRY ST
MACON, GA 31201
Site 1 of 17 in cluster F

LUST **1006794221**
UST **N/A**
FINDS
Financial Assurance

Relative: LUST:
Higher Facility ID: 09011110
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA -Monitoring Only (MNA)
Date Received: 12/30/1999
Project Officer: Humphris,David D

Facility:
Facility Id: 9011110
Facility Status: Closed

Actual:
327 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASSIDYS GARAGE (Continued)

1006794221

Facility Type: Not Marked
District: West Central
Contact Id: 8504
Owner Name: CASSIDYS GARAGE
Owner Address: 423 MULBERRY ST
Owner City: MACON
Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 478-742-3832

Tanks:

Tank ID: 1
Status: Removed From Ground
Status Date: 05/01/2012

Tank ID: 1
Status: Temporarily Out Of Use
Status Date: 04/18/2012

Tank ID: 1
Status: Cathodically Prot
Status Date: 10/30/1998

Tank ID: 1
Status: Installed
Status Date: 01/01/1974

Tank ID: 1
Status: Currently In Use
Status Date: 01/01/1974

Tank ID: 1
Product1: Gas
Material: Steel-Imprinted Current
Capacity: 2980
Pipe Material: Cathodically Protected
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: 10/30/1998
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 10/30/1998

Tank ID: 2
Status: Removed From Ground
Status Date: 05/01/2012

Tank ID: 2
Status: Temporarily Out Of Use
Status Date: 04/18/2012

Tank ID: 2
Status: Cathodically Prot
Status Date: 10/30/1998

Tank ID: 2
Status: Currently In Use
Status Date: 01/01/1974

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASSIDYS GARAGE (Continued)

1006794221

Tank ID:	2
Status:	Installed
Status Date:	01/01/1974
Tank ID:	2
Product1:	Gas
Material:	Steel-Impressed Current
Capacity:	2980
Pipe Material:	Cathodically Protected
Pipe Type:	Suction: No Valve At The Tank
Overfill Protection:	Not reported
Overfill Installed:	10/30/1998
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	10/30/1998
Tank ID:	3
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	3
Status:	Removed From Ground
Status Date:	12/01/1999
Tank ID:	3
Status:	Installed
Status Date:	01/01/1974
Tank ID:	3
Product1:	Diesel
Material:	Bare Steel
Capacity:	6000
Pipe Material:	Galvanized Steel
Pipe Type:	Suction: Valve At The Tank
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	4
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	4
Status:	Installed
Status Date:	Not reported
Tank ID:	4
Status:	Removed From Ground
Status Date:	12/01/1999
Tank ID:	4
Product1:	Diesel
Material:	Bare Steel
Capacity:	8000
Pipe Material:	Galvanized Steel
Pipe Type:	Suction: Valve At The Tank
Overfill Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASSIDYS GARAGE (Continued)

1006794221

Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 5
Status: **Installed**
Status Date: Not reported

Tank ID: 5
Status: **Upgrade Repair Not Marked**
Status Date: Not reported

Tank ID: 5
Status: **Removed From Ground**
Status Date: 12/01/1999

Tank ID: 5
Product1: Diesel
Material: Bare Steel
Capacity: 1000
Pipe Material: Galvanized Steel
Pipe Type: Suction: Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 6
Status: **Upgrade Repair Not Marked**
Status Date: Not reported

Tank ID: 6
Status: **Installed**
Status Date: Not reported

Tank ID: 6
Status: **Removed From Ground**
Status Date: 12/01/1999

Tank ID: 6
Product1: Gas
Material: Bare Steel
Capacity: 550
Pipe Material: Galvanized Steel
Pipe Type: Suction: Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 7
Status: **Upgrade Repair Not Marked**
Status Date: Not reported

Tank ID: 7
Status: **Installed**
Status Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASSIDYS GARAGE (Continued)

1006794221

Tank ID:	7
Status:	Removed From Ground
Status Date:	12/01/1999
Tank ID:	7
Product1:	Gas
Material:	Bare Steel
Capacity:	1000
Pipe Material:	Galvanized Steel
Pipe Type:	Suction: Valve At The Tank
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	8
Status:	Installed
Status Date:	Not reported
Tank ID:	8
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	8
Status:	Removed From Ground
Status Date:	12/01/1999
Tank ID:	8
Product1:	Gas
Material:	Bare Steel
Capacity:	2000
Pipe Material:	Galvanized Steel
Pipe Type:	Suction: Valve At The Tank
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	9
Status:	Installed
Status Date:	Not reported
Tank ID:	9
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	9
Status:	Removed From Ground
Status Date:	12/01/1999
Tank ID:	9
Product1:	Gas
Material:	Bare Steel
Capacity:	2000
Pipe Material:	Galvanized Steel
Pipe Type:	Suction: Valve At The Tank
Overfill Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASSIDYS GARAGE (Continued)

1006794221

Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

FINDS:

Registry ID: 110013636761

Environmental Interest/Information System

GEIMS (Geographic Environmental Information Management System) provides the EPA and Public a single point of access to core data for all facilities and sites regulated or monitored by the EPA and a single system for the reporting of all environmental data.

GA Financial Assurance 1:

Region: 1
Facility ID: 9011110
Financial Responsibility: G.U.S.T. Trust Fund

**F29
SW
< 1/8
0.078 mi.
414 ft.**

**CASSIDYS GARAGE
423 MULBERRY ST
MACON, GA**

**EDR Hist Auto 1014931283
N/A**

Site 2 of 17 in cluster F

**Relative:
Higher**

EDR Historical Auto Stations:

Name: CASSIDYS GARAGE
Year: 1950
Type: AUTOMOBILE GARAGES

**Actual:
327 ft.**

Name: CASSIDYS GARAGE
Year: 1950
Type: AUTOMOBILE REPAIRING

Name: CASSIDYS GARAGE GAS SERV STA
Year: 2001
Type: GASOLINE STATIONS

**F30
SW
< 1/8
0.079 mi.
415 ft.**

**MAULDIN & JENKINS PROPERTY
439 MULBURY STREET
MACON, GA 31202**

**LUST U003763186
UST N/A
Financial Assurance**

Site 3 of 17 in cluster F

**Relative:
Higher**

LUST:

Facility ID: 09011213
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 08/24/2000
Project Officer: Wallace,Ronald J

**Actual:
329 ft.**

Facility ID: 09011213

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAULDIN & JENKINS PROPERTY (Continued)

U003763186

Leak ID: 1
Description: Suspected Release
Cleanup Status: NFA - No Further Action
Date Received: 10/24/2000
Project Officer: Wallace, Ronald J

Facility:

Facility Id: 9011213
Facility Status: Closed
Facility Type: Not Marked
District: West Central
Contact Id: 154
Owner Name: UNKNOWN OWNER
Owner Address: UNKNOWN
Owner City: UNKNOWN
Owner State: GA
Owner Zip: 30330
Owner City, St, Zip: UNKNOWN, GA 30330
Owner Telephone: Not reported

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 01/01/1984

Tank ID: 1
Product1: Used Oil
Material: Not Marked/Unknown
Capacity: Not reported
Pipe Material: Not Marked
Pipe Type: Not Marked
Overfill Protection: Yes
Overfill Installed: Not reported
Tank Exempt From Spill: Yes
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 9011213
Financial Responsibility: Not Marked

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F31
SSW
< 1/8
0.082 mi.
433 ft.
JONES THOS M FILLING STA
265 BROADWAY ST
MACON, GA
Site 4 of 17 in cluster F

EDR Hist Auto **1014931113**
N/A

Relative: EDR Historical Auto Stations:
Higher Name: JONES THOS M FILLING STA
 Year: 1939
Actual: Type: GASOLINE AND OIL SERVICE STATIONS
326 ft.

F32
SSW
< 1/8
0.083 mi.
438 ft.
BONNER THOS E JR DRY CLNS
284 BROADWAY ST
MACON, GA
Site 5 of 17 in cluster F

EDR Hist Cleaner **1014929401**
N/A

Relative: EDR Historical Cleaners:
Higher Name: BONNER THOS E JR DRY CLNS
 Year: 1959
Actual: Type: CLEANERS AND DYERS
325 ft.

G33
SSW
< 1/8
0.084 mi.
443 ft.
WISE BOB AUTO SERVICE
278 BROADWAY ST
MACON, GA
Site 1 of 9 in cluster G

EDR Hist Auto **1014931321**
N/A

Relative: EDR Historical Auto Stations:
Higher Name: HARRISONS SERV CENTER & GARAGE
 Year: 1954
Actual: Type: AUTOMOBILE REPAIRING
323 ft.

 Name: HARRISONS SERV CENTER & GARAGE
 Year: 1954
 Type: GASOLINE STATIONS

 Name: WISE BOB AUTO SERVICE
 Year: 1959
 Type: AUTOMOBILE REPAIRING

G34
South
< 1/8
0.090 mi.
474 ft.
COMMUNITY
267 BROADWAY LN
MACON, GA
Site 2 of 9 in cluster G

EDR Hist Auto **1014931313**
N/A

Relative: EDR Historical Auto Stations:
Higher Name: COMMUNITY
 Year: 1950
Actual: Type: AUTOMOBILE REPAIRING
323 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F35
SSW
< 1/8
0.094 mi.
494 ft.

KENDALL PETE SERV STA
405 MULBERRY ST
MACON, GA

EDR Hist Auto 1014929706
N/A

Relative:
Higher

Actual:
327 ft.

EDR Historical Auto Stations:

Name:	SWANN L FRANK AUTO REPR
Year:	1935
Type:	AUTOMOBILE REPAIRING
Name:	HARRISON S SERVICE
Year:	1950
Type:	AUTOMOBILE SERVICE STATIONS
Name:	HARRISON S SERVICE
Year:	1950
Type:	GASOLINE STATIONS
Name:	CENTER & GARAGE
Year:	1950
Type:	AUTOMOBILE REPAIRING
Name:	HARRISON S SERVICE
Year:	1950
Type:	AUTOMOBILE REPAIRING
Name:	CENTER & GARAGE
Year:	1950
Type:	AUTOMOBILE SERVICE STATIONS
Name:	KENDALL PETE SERV STA
Year:	1954
Type:	GASOLINE STATIONS
Name:	KENDALL PETE SERV STA
Year:	1959
Type:	GASOLINE STATIONS
Name:	KENDALLS PETE SERVICE
Year:	1966
Type:	SERVICE STATIONS
Name:	KENDALLS PETE SERVICE
Year:	1966
Type:	GASOLINE STATIONS
Name:	KENDALLS PETE SERVICE STATION
Year:	1971
Type:	GASOLINE STATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F36
SW
< 1/8
0.095 mi.
502 ft.

439 43 CHAPMANS
439 MULBERRY ST
MACON, GA

Site 7 of 17 in cluster F

EDR Hist Auto

1014931037
N/A

Relative:
Higher

EDR Historical Auto Stations:

Name: 439 43 CHAPMANS
Year: 1950
Type: AUTOMOBILE GARAGES

Actual:
329 ft.

Name: 439 43 CHAPMANS
Year: 1950
Type: AUTOMOBILE REPAIRING

Name: 439 43 CHAPMANS GARAGE INC REPR
Year: 1954
Type: AUTOMOBILE GARAGES

Name: 439 43 CHAPMANS GARAGE INC REPR
Year: 1954
Type: AUTOMOBILE REPAIRING

Name: 439 43 CHAPMANS GARAGE INC AUTO
Year: 1959
Type: AUTOMOBILE GARAGES

Name: 439 43 CHAPMANS GARAGE INC AUTO
Year: 1959
Type: AUTOMOBILE REPAIRING

Name: CHAPMANS GARAGE INC AUTO
Year: 1966
Type: AUTOMOBILE REPAIRING

Name: CHAPMANS GARAGE INC
Year: 1971
Type: AUTOMOBILE GARAGES

Name: CHAPMANS GARAGE INC
Year: 1971
Type: AUTOMOBILE REPAIRING

Name: CHAPMANS GARAGE INC
Year: 1975
Type: AUTOMOBILE REPAIRING

G37
South
< 1/8
0.095 mi.
504 ft.

ROBERTSON LAFAYETTE C DCLO CLNR
315 BROADWAY ST
MACON, GA

Site 3 of 9 in cluster G

EDR Hist Cleaner

1014928701
N/A

Relative:
Higher

EDR Historical Cleaners:

Name: ROBERTSON LAFAYETTE C DCLO CLNR
Year: 1935
Type: CLOTHES PRESSERS AND CLEANERS

Actual:
323 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

	Site	Database(s)	EDR ID Number EPA ID Number
G38 South < 1/8 0.096 mi. 507 ft.	SMITH JOS B CLO CLNRS 319 BROADWAY ST MACON, GA Site 4 of 9 in cluster G EDR Historical Cleaners: Name: SMITH JOS B CLO CLNRS Year: 1939 Type: CLOTHES PRESSERS AND CLEANERS	EDR Hist Cleaner	1014929453 N/A
F39 SSW < 1/8 0.097 mi. 510 ft.	CASSIDYS GARAGE 401 MULBERRY ST MACON, GA Site 8 of 17 in cluster F EDR Historical Auto Stations: Name: CASSIDYS GARAGE Year: 1930 Type: AUTOMOBILE GARAGES	EDR Hist Auto	1014930832 N/A
F40 SSW < 1/8 0.097 mi. 510 ft.	SWANN L FRANK AUTO REPR 403 MULBERRY ST MACON, GA Site 9 of 17 in cluster F EDR Historical Auto Stations: Name: SWANN L FRANK AUTO REPR Year: 1939 Type: AUTOMOBILE REPAIRING	EDR Hist Auto	1014930699 N/A
F41 SW < 1/8 0.097 mi. 511 ft.	CASSIDYS GARAGE AUTO REPRS 409 MULBERRY ST MACON, GA Site 10 of 17 in cluster F EDR Historical Auto Stations: Name: CASSIDYS GARAGE AUTO REPRS Year: 1935 Type: AUTOMOBILE REPAIRING Name: CASSIDYS GARAGE AUTO REPRS AND STORAGE Year: 1939 Type: AUTOMOBILE REPAIRING Name: CASSIDYS GARAGE AUTO REPRS AND STORAGE Year: 1939 Type: AUTOMOBILE GARAGES	EDR Hist Auto	1014930168 N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F42 415 19 CHAPMANS GARAGE
SW 415 MULBERRY ST
< 1/8 MACON, GA
0.097 mi.
512 ft. Site 11 of 17 in cluster F

EDR Hist Auto 1014930586
N/A

Relative:
Higher

EDR Historical Auto Stations:

Name: 415 19 CHAPMAN L H GARAGE
Year: 1930

Actual: Type: AUTOMOBILE GARAGES
328 ft.

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: AUTOMOBILE REPAIRING

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: GASOLINE AND OIL SERVICE STATIONS

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: AUTOMOBILE LAUNDRIES

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: AUTOMOBILE GARAGES

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: BRAKE SERVICE

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: GASOLINE AND OIL SERVICE STATIONS

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: AUTOMOBILE LAUNDRIES

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: AUTOMOBILE GARAGES

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: AUTOMOBILE REPAIRING

F43 415 19 CHAPMANS GARAGE
SW 419 MULBERRY ST
< 1/8 MACON, GA
0.097 mi.
512 ft. Site 12 of 17 in cluster F

EDR Hist Auto 1014929658
N/A

Relative:
Higher

EDR Historical Auto Stations:

Name: 415 19 CHAPMAN L H GARAGE
Year: 1930

Actual: Type: AUTOMOBILE GARAGES
328 ft.

Name: 415 19 CHAPMANS GARAGE
Year: 1935

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

415 19 CHAPMANS GARAGE (Continued)

1014929658

Type: AUTOMOBILE LAUNDRIES

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: AUTOMOBILE REPAIRING

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: AUTOMOBILE GARAGES

Name: 415 19 CHAPMANS GARAGE
Year: 1935
Type: GASOLINE AND OIL SERVICE STATIONS

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: GASOLINE AND OIL SERVICE STATIONS

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: BRAKE SERVICE

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: AUTOMOBILE GARAGES

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: AUTOMOBILE LAUNDRIES

Name: CHAPMANS GARAGE AUTO REPRS AND STORAGE
Year: 1939
Type: AUTOMOBILE REPAIRING

Name: 439 43 CHAPMANS
Year: 1950
Type: AUTOMOBILE REPAIRING

Name: 439 43 CHAPMANS
Year: 1950
Type: AUTOMOBILE GARAGES

F44
SW
< 1/8
0.098 mi.
519 ft.

**439 43 CHAPMANS GARAGE INC AUTO
443 MULBERRY ST
MACON, GA**

Site 13 of 17 in cluster F

**EDR Hist Auto 1014929662
N/A**

**Relative:
Higher**

EDR Historical Auto Stations:

Name: 439 43 CHAPMANS GARAGE INC REPR
Year: 1954
Type: AUTOMOBILE GARAGES

**Actual:
329 ft.**

Name: 439 43 CHAPMANS GARAGE INC AUTO
Year: 1959
Type: AUTOMOBILE GARAGES

Name: 439 43 CHAPMANS GARAGE INC AUTO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

439 43 CHAPMANS GARAGE INC AUTO (Continued)

1014929662

Year: 1959
Type: AUTOMOBILE REPAIRING

G45
South
< 1/8
0.100 mi.
526 ft.

**FELIX BANKS
314 BROADWAY ST
MACON, GA**

**EDR Hist Cleaner 1014929280
N/A**

Site 5 of 9 in cluster G

Relative:
Higher

EDR Historical Cleaners:

Name: FELIX BANKS
Year: 1925
Type: CLOTHES CLEANERS AND PRESSERS

Actual:
323 ft.

G46
South
< 1/8
0.102 mi.
539 ft.

**SITE 301
301 MULBERRY SITE
MACON, GA 31201**

**UST U001489824
Financial Assurance N/A**

Site 6 of 9 in cluster G

Relative:
Higher

Facility:

Facility Id: 9011040
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 8411
Owner Name: CITY OF MACON ECONOMIC & COMMUNI
Owner Address: 713 SOUTHERN TRUST BLDG
Owner City: MACON
Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 912-751-7190

Actual:
323 ft.

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 09/26/1989

Tank ID: 1
Product1: Other
Material: Bare Steel
Capacity: 1000
Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SITE 301 (Continued)

U001489824

Tank ID:	2
Status:	Installed
Status Date:	Not reported
Tank ID:	2
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	2
Status:	Removed From Ground
Status Date:	09/26/1989
Tank ID:	2
Product1:	Other
Material:	Bare Steel
Capacity:	1000
Pipe Material:	Unknown
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	3
Status:	Installed
Status Date:	Not reported
Tank ID:	3
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	3
Status:	Removed From Ground
Status Date:	09/26/1989
Tank ID:	3
Product1:	Other
Material:	Bare Steel
Capacity:	1000
Pipe Material:	Unknown
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
GA Financial Assurance 1:	
Region:	1
Facility ID:	9011040
Financial Responsibility:	Not Marked

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

G47 GULF REFINING CO FILLING STA
South 301 MULBERRY ST
< 1/8 MACON, GA
0.102 mi.
539 ft. Site 7 of 9 in cluster G

EDR Hist Auto 1014930850
N/A

Relative: EDR Historical Auto Stations:
Higher Name: GULF REFINING CO FILLING STA
Year: 1935
Actual: Type: GASOLINE AND OIL SERVICE STATIONS
323 ft.
Name: GULF OIL CORP FILLING STA
Year: 1939
Type: GASOLINE AND OIL SERVICE STATIONS

F48 B & B ONE DAY CLEANERS
SSW 397 MULBERRY ST
< 1/8 MACON, GA 31201
0.102 mi.
541 ft. Site 14 of 17 in cluster F

EDR Hist Cleaner 1014929143
N/A

Relative: EDR Historical Cleaners:
Higher Name: ONE DAY CLEANERS
Year: 1971
Actual: Type: CLEANERS AND DYERS
327 ft.
Name: B & B ONE DAY CLEANERS
Year: 1975
Type: CLEANERS AND DYERS

H49 TYLER BROS GARAGE AUTO REPRS
West 215 3RD ST
< 1/8 MACON, GA
0.103 mi.
543 ft. Site 1 of 3 in cluster H

EDR Hist Auto 1014931054
N/A

Relative: EDR Historical Auto Stations:
Higher Name: 215 219 HANNAS STORAGE & SERVICE
Year: 1930
Actual: Type: AUTOMOBILE GARAGES
329 ft.
Name: TYLER BROS GARAGE AUTO REPRS
Year: 1939
Type: AUTOMOBILE REPAIRING

H50 215 219 HANNAS STORAGE & SERVICE
West 219 3RD ST
< 1/8 MACON, GA
0.103 mi.
543 ft. Site 2 of 3 in cluster H

EDR Hist Auto 1014930379
N/A

Relative: EDR Historical Auto Stations:
Higher Name: 215 219 HANNAS STORAGE & SERVICE
Year: 1930
Actual: Type: AUTOMOBILE GARAGES
329 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site	Database(s)	EDR ID Number EPA ID Number
------	-------------	--------------------------------

F51 SSW < 1/8 0.104 mi. 547 ft.	ONE DAY CLEANERS 393 MULBERRY ST MACON, GA 31201 Site 15 of 17 in cluster F Relative: Higher Actual: 326 ft.	EDR Hist Cleaner 1014929440 N/A
	EDR Historical Cleaners: Name: ONE DAY CLEANERS Year: 1966 Type: CLEANERS AND DYERS	

F52 SW < 1/8 0.104 mi. 549 ft.	FEDERAL BLDG & US COURTHOUSE 475 MULBERRY ST MACON, GA 31201 Site 16 of 17 in cluster F Relative: Higher Actual: 330 ft.	RCRA NonGen / NLR 1004686324 FINDS ECHO GA3470000057
	RCRA NonGen / NLR: Date form received by agency: 01/17/2008 Facility name: FEDERAL BLDG & US COURTHOUSE Facility address: 475 MULBERRY ST MACON, GA 31201 EPA ID: GA3470000057 Mailing address: MULBERRY ST MACON, GA 31201 Contact: BILLY DIXON Contact address: 475 MULBERRY ST MACON, GA 31201 Contact country: US Contact telephone: (912) 752-3503 Contact email: Not reported EPA Region: 04 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste	

Owner/Operator Summary:
Owner/operator name: U S GOVERNMENT
Owner/operator address: OWNERSTREET
OWNERCITY, GA 00000
Owner/operator country: Not reported
Owner/operator telephone: (000) 000-0000
Legal status: Federal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FEDERAL BLDG & US COURTHOUSE (Continued)

1004686324

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 03/29/1993

Site name: FEDERAL BLDG & US COURTHOUSE
Classification: Conditionally Exempt Small Quantity Generator

Waste code: D001
Waste name: IGNITABLE WASTE

Waste code: D008
Waste name: LEAD

Waste code: F001
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F005
Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

FINDS:

Registry ID: 110005664806

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

ECHO:

Envid: 1004686324
Registry ID: 110005664806
DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110005664806

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F53
SW
< 1/8
0.104 mi.
549 ft.
BIBB CO COURTHOUSE & FEDERAL BLD
475 MULBERRY ST
MACON, GA 31298
Site 17 of 17 in cluster F

UST
Financial Assurance
U001486685
N/A

Relative:
Higher

Actual:
330 ft.

Facility:
Facility Id: 4110003
Facility Status: Closed
Facility Type: County
District: West Central
Contact Id: 5005
Owner Name: BIBB COUNTY GOVERNMENT
Owner Address: P O BOX 4708
Owner City: MACON
Owner State: GA
Owner Zip: 31298
Owner City,St,Zip: MACON, GA 31298
Owner Telephone: 912-749-6345

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Closed In Ground
Status Date: 02/01/1982

Tank ID: 1
Status: Installed
Status Date: 03/21/1953

Tank ID: 1
Product1: Gas
Material: Bare Steel
Capacity: 5000
Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Closed In Ground
Status Date: 02/01/1982

Tank ID: 2
Status: Installed
Status Date: 03/21/1970

Tank ID: 2
Product1: Gas
Material: Bare Steel
Capacity: 5000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB CO COURTHOUSE & FEDERAL BLD (Continued)

U001486685

Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 4110003
Financial Responsibility: G.U.S.T. Trust Fund

G54
SSW
< 1/8
0.105 mi.
553 ft.
BONNER ONE HOUR CLEANERS
375 MULBERRY ST
MACON, GA 31213
Site 8 of 9 in cluster G

EDR Hist Cleaner 1014929400
N/A

Relative: EDR Historical Cleaners:
Higher
Name: BONNER ONE HOUR CLEANERS
Year: 1980
Actual: Type: CLEANERS AND DYERS
326 ft.
Name: BONNER ONE HOUR CLEANERS
Year: 1985
Type: CLEANERS AND DYERS

H55
WSW
< 1/8
0.110 mi.
580 ft.
BEAU BRUMMEL LNDRY
255 3RD ST
MACON, GA
Site 3 of 3 in cluster H

EDR Hist Cleaner 1014929535
N/A

Relative: EDR Historical Cleaners:
Higher
Name: BEAU BRUMMEL LNDRY
Year: 1950
Actual: Type: LAUNDRIES
330 ft.

G56
SSW
< 1/8
0.110 mi.
582 ft.
PATTERSON GULF SERVICE
351 MULBERRY ST
MACON, GA 31201
Site 9 of 9 in cluster G

EDR Hist Auto 1014931323
N/A

Relative: EDR Historical Auto Stations:
Higher
Name: METHVIN J CLIFFORD
Year: 1950
Actual: Type: GASOLINE STATIONS
325 ft.
Name: METHVIN J CLIFF GULF SERV STA
Year: 1954
Type: GASOLINE STATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PATTERSON GULF SERVICE (Continued)

1014931323

Name: MC MICHAEL GULF SERV STA GAS
Year: 1959
Type: GASOLINE STATIONS

Name: PATTERSON GULF SERVICE
Year: 1966
Type: GASOLINE STATIONS

Name: FLAGGS GULF SERVICE
Year: 1971
Type: GASOLINE STATIONS

Name: MIMBS GARAGE
Year: 1980
Type: AUTOMOBILE REPAIRING

Name: MIMBS GARAGE
Year: 1985
Type: AUTOMOBILE REPAIRING

E57
SE
< 1/8
0.113 mi.
595 ft.

BUCKS GARAGE
225 WALNUT ST
MACON, GA

EDR Hist Auto 1014931064
N/A

Site 4 of 6 in cluster E

Relative:
Higher

Actual:
314 ft.

EDR Historical Auto Stations:
Name: BUCKS GARAGE
Year: 1959
Type: AUTOMOBILE REPAIRING

E58
SE
< 1/8
0.113 mi.
595 ft.

NORFOLK SOUTHERN RAILWAY CO
225 WALNUT ST
MACON, GA 31206

SPILLS 1000841194
RCRA NonGen / NLR GAD000616656
FINDS
ECHO

Site 5 of 6 in cluster E

Relative:
Higher

Actual:
314 ft.

SPILLS:
CTS Number: Not reported
Spill Number: 06
UN Number: Not reported
UN Number2: Not reported
Report Number: Not reported
Report Date: Not reported
Report Time: Not reported
Spill Date: 07/19/1999
Spill Time: Not reported
Incident Type: Not reported
Material Involved: Not reported
Quantity: Not reported
Phase: Not reported
Radioactive: Not reported
Waterway Impctd: NO
Evacuation: Not reported
Caller: Not reported
Organization: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NORFOLK SOUTHERN RAILWAY CO (Continued)

1000841194

Org Phone: Not reported
Primary Concern: Not reported
Associate Name: Not reported
Investigation Date: Not reported
Resolved: Not reported
Closure Date: Not reported
Ten Days Follow Up: Not reported
Transferred Record: Not reported
Emergency Units: Not reported
Responsible Prty: Not reported
RP Contact: Not reported
RP Address: Not reported
RP Phone: Not reported
RP City: Not reported
Action Code: Not reported
Action: Division Duty Officer
Investigator: Not reported
EOC Operator: Not reported
Time EOC Notifd: Not reported
Time Dispatched: Not reported
Complaint Code: Not reported
Complaint ID: Not reported
Cmplaint Referred: Not reported
Report Sum: Not reported
At: Not reported
DDO: Not reported
Date Recieved: Not reported
Referred: Not reported
Substance: Not reported
Location: Not reported
Source: Not reported
Details: Not reported
Additional Info: Not reported
Incident Type: Not reported
Incident: Not reported

RCRA NonGen / NLR:

Date form received by agency: 06/28/2013
Facility name: NORFOLK SOUTHERN RAILWAY CO
Facility address: 225 WALNUT ST
MACON, GA 31206
EPA ID: GAD000616656
Mailing address: WALNUT ST
MACON, GA 31206
Contact: KENNETH JORDAN JR
Contact address: 125 PEACHTREE ST BOX 136
ATLANTA, GA 30303
Contact country: US
Contact telephone: (404) 529-1753
Contact email: Not reported
EPA Region: 04
Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NORFOLK SOUTHERN RAILWAY CO (Continued)

1000841194

Owner/operator name: OPERNAME
Owner/operator address: OPERSTREET
OPERCITY, WY 99999
Owner/operator country: Not reported
Owner/operator telephone: (404) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NORFOLK SOUTHERN RAILWAY CO
Owner/operator address: 125 SPRING ST BOX 136
ATLANTA, GA 30303
Owner/operator country: Not reported
Owner/operator telephone: (404) 529-1753
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 03/02/1993
Site name: NORFOLK SOUTHERN RAILWAY CO
Classification: Conditionally Exempt Small Quantity Generator

Waste code: D000
Waste name: Not Defined

Waste code: D001
Waste name: IGNITABLE WASTE

Waste code: D003
Waste name: REACTIVE WASTE

Waste code: D008
Waste name: LEAD

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NORFOLK SOUTHERN RAILWAY CO (Continued)

1000841194

Evaluation Action Summary:

Evaluation date: 03/29/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/08/1988
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/01/1986
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110005281426

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

ECHO:

Envid: 1000841194
Registry ID: 110005281426
DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110005281426

E59
SE
< 1/8
0.115 mi.
605 ft.
GENERAL STEEL CO
224 WALNUT ST
MACON, GA 31202
Site 6 of 6 in cluster E

UST
Financial Assurance
U001486693
N/A

Relative:
Lower
Actual:
312 ft.
Facility:
Facility Id: 4110017
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 5016
Owner Name: GENERAL STEEL COMPANY
Owner Address: 224 WALNUT ST
Owner City: MACON
Owner State: GA
Owner Zip: 31202
Owner City,St,Zip: MACON, GA 31202
Owner Telephone: 912-746-2794

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENERAL STEEL CO (Continued)

U001486693

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 02/26/1990

Tank ID: 1
Status: Installed
Status Date: 02/21/1974

Tank ID: 1
Product 1: Gas
Material: Bare Steel
Capacity: 3000
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 4110017
Financial Responsibility: Not Marked

160
ENE
1/8-1/4
0.125 mi.
661 ft.

BIBB CO COLISEUM PLT
155 COLISEUM DR
MACON, GA 31217
Site 1 of 3 in cluster I

RCRA NonGen / NLR
FINDS
ECHO

1000703545
GAD984267054

Relative:
Lower

Actual:
290 ft.

RCRA NonGen / NLR:

Date form received by agency: 04/18/2000
Facility name: BIBB COMPANY GRAPHIC DIV
Facility address: 155 COLISEUM DR
MACON, GA 31201
EPA ID: GAD984267054
Mailing address: PO BOX 261
DANVILLE, VA 24543
Contact: PATTY GANN
Contact address: PO BOX 261
DANVILLE, VA 24543
Contact country: US
Contact telephone: (804) 799-7000
Contact email: Not reported
EPA Region: 04
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: BIBB COMPANY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB CO COLISEUM PLT (Continued)

1000703545

Owner/operator address: 237 COLISEUM DR
MACON, GA 31201
Owner/operator country: Not reported
Owner/operator telephone: (912) 752-6700
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Waste code: D000
Waste name: Not Defined

Waste code: D011
Waste name: SILVER

Violation Status: No violations found

FINDS:

Registry ID: 110009357203

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

AIR SYNTHETIC MINOR

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB CO COLISEUM PLT (Continued)

1000703545

program staff to track the notification, permit, compliance, and
corrective action activities required under RCRA.

ECHO:

Envid: 1000703545
Registry ID: 110009357203
DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110009357203

I61 THE BIBB COMPANY(CLOSED)
ENE 155 COLISEUM
1/8-1/4 MACON, GA 31211
0.125 mi.
661 ft. Site 2 of 3 in cluster I

AST A100327849
N/A

Relative: **AST:**
Lower Owner Name: McKinney's LP Gas Co.
Owner Address: 4262 Interstate Drive
Actual: Owner City/State/Zip: Macon Ga 31206
290 ft. Number Of Tanks: 1
Tank Capacity: 0

I62 BIBB YARNS INC COLISEUM PLANT
ENE 155 COLISEUM DR
1/8-1/4 MACON, GA 31202
0.125 mi.
661 ft. Site 3 of 3 in cluster I

LUST U001489435
UST N/A
Financial Assurance

Relative: **LUST:**
Lower Facility ID: 09000382
Leak ID: 1
Actual: Description: Confirmed Release
290 ft. Cleanup Status: NFA - No Further Action
Date Received: 10/11/1989
Project Officer: Vinson-Brittman, Anita

Facility ID: 09000382
Leak ID: 2
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 02/02/1993
Project Officer: Vinson-Brittman, Anita

Facility:
Facility Id: 9000382
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 7177
Owner Name: BIBB YARNS INC
Owner Address: P O BOX 1038
Owner City: MACON
Owner State: GA
Owner Zip: 31202
Owner City,St,Zip: MACON, GA 31202

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB YARNS INC COLISEUM PLANT (Continued)

U001489435

Owner Telephone: 912-744-3685

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Closed In Ground
Status Date: 06/21/1993

Tank ID: 1
Status: Installed
Status Date: 04/04/1968

Tank ID: 1
Product1: Other
Material: Bare Steel
Capacity: 30000
Pipe Material: Bare Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Closed In Ground
Status Date: 06/21/1993

Tank ID: 2
Status: Installed
Status Date: 04/04/1968

Tank ID: 2
Product1: Other
Material: Bare Steel
Capacity: 30000
Pipe Material: Bare Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 3
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 3
Status: Closed In Ground
Status Date: 06/21/1993

Tank ID: 3

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB YARNS INC COLISEUM PLANT (Continued)

U001489435

Status:	Installed
Status Date:	04/04/1968
Tank ID:	3
Product1:	Other
Material:	Bare Steel
Capacity:	30000
Pipe Material:	Bare Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	4
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	4
Status:	Removed From Ground
Status Date:	06/21/1993
Tank ID:	4
Status:	Installed
Status Date:	04/12/1967
Tank ID:	4
Product1:	Gas
Material:	Bare Steel
Capacity:	3000
Pipe Material:	Bare Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	5
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	5
Status:	Removed From Ground
Status Date:	06/21/1993
Tank ID:	5
Status:	Installed
Status Date:	04/13/1961
Tank ID:	5
Product1:	Empty
Material:	Bare Steel
Capacity:	2000
Pipe Material:	Bare Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB YARNS INC COLISEUM PLANT (Continued)

U001489435

Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 9000382
Financial Responsibility: Not Marked

63
SSE
1/8-1/4
0.158 mi.
832 ft.

**306 TERMINAL AVE.
MACON, GA**

**VCP S117361869
N/A**

Relative:
Higher

Actual:
319 ft.

VCP:

Tax Parcel Id#: R073-0384, R074-0223, R074-0225, Various ROWs
Associated with HSI #: 10511
Date Of Application: 10/14/2014
Applicant: Atlanta Gas Light
VRP Application #: VRP1413483140
Date App Stat Comm: 05/26/2015
Date App Stat2: Not reported
Date Ist Prog Report: 05/23/2016
Date Progress Report Comm: Not reported
Compliance Status Report Date: 11/23/2015
Compliance Status Report Date2: Not reported
Application Status Date: 5/21/2015
VRP Application Date: 2014-10-14 00:00:00
Check List Date: Not reported

[Click here for DBF VRP:](#)

[Click here for DBF Comments:](#)

[Click here for DBF Approval:](#)

[Click here for DBF Progress Report:](#)

[Click here for Compliance Status Report:](#)

64
West
1/8-1/4
0.175 mi.
923 ft.

**BB&T
201 SECOND STREET
MACON, GA 31201**

**UST U003763187
Financial Assurance N/A**

Relative:
Higher

Actual:
328 ft.

Facility:

Facility Id: 9011214
Facility Status: Active
Facility Type: Commercial
District: West Central
Contact Id: 68343
Owner Name: DUE SOUTH INVESTMENTS LLC
Owner Address: 201 SECOND ST STE 1200
Owner City: MACON

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BB&T (Continued)

U003763187

Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 478-741-8742

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Currently In Use
Status Date: 11/29/2000

Tank ID: 1
Product1: Diesel
Material: Double Walled
Capacity: 4000
Pipe Material: Fiberglass Reinforced Plastic
Pipe Type: Suction: Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: 11/29/2000
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 11/29/2000

GA Financial Assurance 1:

Region: 1
Facility ID: 9011214
Financial Responsibility: Insurance

65
ESE
1/8-1/4
0.185 mi.
977 ft.

CADUCEUS PROPERTY (FORMER)
167 RIVERSIDE DRIVE
MACON, GA 31210

GA NON-HSI S109261572
N/A

Relative:
Lower

NON HSI:
Latitude: 32.83583
Longitude: 83.616944
Ground Water Pathway Score: 0.60
On-Site Pathway Score: 14.80
Report Date: 07/02/2008
Additional Info: Not reported
Contamination: Barium, Benzene

Actual:
293 ft.

J66
West
1/8-1/4
0.191 mi.
1008 ft.

FICKLIN AND WALKER
577 MULBERRY ST
MACON, GA 31206

Site 1 of 2 in cluster J

SEMS-ARCHIVE 1003867858
GAD003319076

Relative:
Higher

SEMS-ARCHIVE:
Site ID: 401369
EPA ID: GAD003319076
Federal Facility: N

Actual:
330 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FICKLIN AND WALKER (Continued)

1003867858

NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

Following information was gathered from the prior CERCLIS update completed in 10/2013:

Site ID: 0401369
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

CERCLIS-NFRAP Site Contact Details:

Contact Sequence ID: 4753668.00000
Person ID: 4000275.00000

Contact Sequence ID: 4778539.00000
Person ID: 13002428.00000

Contact Sequence ID: 4822241.00000
Person ID: 4272610.00000

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: FICKLIN AND WALKER
Alias Address: Not reported
BIBB, GA

CERCLIS-NFRAP Assessment History:

Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 12/01/79
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Action: ARCHIVE SITE
Date Started: / /
Date Completed: 12/01/79
Priority Level: Not reported

Action: DISCOVERY
Date Started: / /
Date Completed: 11/01/79
Priority Level: Not reported

J67
West
1/8-1/4
0.220 mi.
1159 ft.
BIBB COUNTY COURTHOUSE
601 MULBERRY STREET
MACON, GA 31208
Site 2 of 2 in cluster J

UST
Financial Assurance
U003763184
N/A

Relative:
Higher
Actual:
331 ft.
Facility:
Facility Id: 9011211
Facility Status: Closed
Facility Type: County
District: West Central
Contact Id: 8704
Owner Name: BIBB COUNTY
Owner Address: 601 MULBERRY STREET
Owner City: MACON
Owner State: GA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIBB COUNTY COURTHOUSE (Continued)

U003763184

Owner Zip: 31208
Owner City,St,Zip: MACON, GA 31208
Owner Telephone: 912-749-6611

Tanks:

Tank ID: 1
Status: Removed From Ground Date Unknown
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Installed
Status Date: 01/01/1973

Tank ID: 1
Product1: Diesel
Material: Bare Steel
Capacity: 550
Pipe Material: Copper
Pipe Type: Suction: Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 9011211
Financial Responsibility: Self Insured

K68
SSE
1/8-1/4
0.225 mi.
1189 ft.

MACON GAS LIGHT AND WATER COMPANY
137 MULBERRY STREET
MACON, GA 31201

Relative:
Lower

Actual:
304 ft.

Site 1 of 5 in cluster K

SEMS:
Site ID: 406220
EPA ID: GAD984306076
Federal Facility: N
NPL: Not on the NPL
Non NPL Status: Other Cleanup Activity: State-Lead Cleanup

SEMS 1000507720
LUST GAD984306076
UST
RCRA NonGen / NLR
Financial Assurance
ECHO

Following information was gathered from the prior CERCLIS update completed in 10/2013:

Site ID: 0406220
EPA ID: GAD984306076
Facility County: BIBB
Short Name: MACON GAS LIGHT AND WATER
Congressional District: 08
IFMS ID: Not reported
SMSA Number: 4680
USGC Hydro Unit: 03070103
Federal Facility: Not a Federal Facility

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON GAS LIGHT AND WATER COMPANY (Continued)

1000507720

DMNSN Number: 2.00000
Site Orphan Flag: N
RCRA ID: Not reported
USGS Quadrangle: Not reported
Site Init By Prog: Not reported
NFRAP Flag: Not reported
Parent ID: Not reported
RST Code: Not reported
EPA Region: 04
Classification: Not reported
Site Settings Code: Not reported
NPL Status: Not on the NPL
DMNSN Unit Code: ACRE
RBRAC Code: Not reported
RResp Fed Agency Code: Not reported
Non NPL Status: Other Cleanup Activity: State-Lead Cleanup
Non NPL Status Date: 06/06/01
Site Fips Code: 13021
CC Concurrence Date: / /
CC Concurrence FY: Not reported
Alias EPA ID: Not reported
Site FUDS Flag: Not reported

CERCLIS Site Contact Name(s):

Contact ID: 4000275.00000
Contact Name: William Joyner
Contact Tel: (404) 562-8795
Contact Title: Site Assessment Manager (SAM)
Contact Email: joyner.william@epa.gov

Contact ID: 13002428.00000
Contact Name: Donna Seadler
Contact Tel: (404) 562-8870
Contact Title: Site Assessment Manager (SAM)
Contact Email: seadler.donna@epa.gov

Contact ID: 4272610.00000
Contact Name: Carolyn Callihan
Contact Tel: (404) 562-8913
Contact Title: Site Assessment Manager (SAM)
Contact Email: Carolyn Callihan/R4/USEPA/US,

Alias Comments: Not reported

Site Description: SITE WAS AN OLD COAL GASIFICATION PLANT LOCATED BETWEEN 6TH AND 7TH STREET YET ON MULBERRY STREET. OPERATED AROUND THE TURN OF THE CENTURY. JMCKEOWN 6/15/1994 Reassessment was conducted in FY2001. The site scores high enough to warrant preparation of an HRS package. However, State EPD has provided file material (see EPA file) demonstrating that site is being addressed under a consent order signed by PRP, Atlanta Gas Light Company, in accordance with EPD's HSRA requirements. Corrective Action Plan has been approved by EPD. CBT 6/6/01

CERCLIS Assessment History:

Action Code: 001
Action: DISCOVERY
Date Started: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON GAS LIGHT AND WATER COMPANY (Continued)

1000507720

Date Completed: 06/15/94
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: EPA In-House
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 09/11/95
Priority Level: Low priority for further assessment
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: SITE INSPECTION
Date Started: / /
Date Completed: 11/19/96
Priority Level: Higher priority for further assessment
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: OTHER CLEANUP ACTIVITY
Date Started: 11/19/96
Date Completed: 05/14/01
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: SITE REASSESSMENT
Date Started: / /
Date Completed: 06/06/01
Priority Level: Low priority for further assessment
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON GAS LIGHT AND WATER COMPANY (Continued)

1000507720

LUST:

Facility ID: 09000535
Leak ID: 1
Description: Confirmed Release
Cleanup Status: Transferred
Date Received: 01/30/1990
Project Officer: Jones,F. Calvin

Facility ID: 09000535
Leak ID: 2
Description: Confirmed Release
Cleanup Status: Transferred
Date Received: 12/28/1999
Project Officer: Jones,F. Calvin

Facility:

Facility Id: 9000535
Facility Status: Closed
Facility Type: Utilities
District: West Central
Contact Id: 1387
Owner Name: ATLANTA GAS LIGHT COMPANY
Owner Address: TEM PEACHTREE PL
Owner City: ATLANTA
Owner State: GA
Owner Zip: 30309
Owner City,St,Zip: ATLANTA, GA 30309
Owner Telephone: 404-584-3722

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: 03/08/1992

Tank ID: 1
Status: Removed From Ground
Status Date: 10/01/1990

Tank ID: 1
Status: Installed
Status Date: 05/10/1974

Tank ID: 1
Product1: Gas
Material: Cathodically Protected Steel
Capacity: 12000
Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: 03/08/1992

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON GAS LIGHT AND WATER COMPANY (Continued)

1000507720

Tank ID:	2
Status:	Removed From Ground
Status Date:	10/01/1990
Tank ID:	2
Status:	Installed
Status Date:	05/10/1974
Tank ID:	2
Product1:	Diesel
Material:	Cathodically Protected Steel
Capacity:	6000
Pipe Material:	Unknown
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	3
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	3
Status:	Removed From Ground
Status Date:	11/10/1999
Tank ID:	3
Status:	Installed
Status Date:	09/01/1990
Tank ID:	3
Product1:	Diesel
Material:	Fiberglass
Capacity:	12000
Pipe Material:	Cathodically Protected
Pipe Type:	Pressure
Overfill Protection:	Not reported
Overfill Installed:	09/01/1990
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	09/01/1990
Tank ID:	4
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	4
Status:	Removed From Ground
Status Date:	11/10/1999
Tank ID:	4
Status:	Installed
Status Date:	09/01/1990
Tank ID:	4
Product1:	Gas
Material:	Fiberglass

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON GAS LIGHT AND WATER COMPANY (Continued)

1000507720

Capacity: 8000
Pipe Material: Cathodically Protected
Pipe Type: Pressure
Overfill Protection: Not reported
Overfill Installed: 09/01/1990
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 09/01/1990

RCRA NonGen / NLR:

Date form received by agency: 01/18/2008
Facility name: ATLANTA GAS LIGHT-MACON MGP SITE
Facility address: 137 MULBERRY ST
MACON, GA 31213
EPA ID: GAD984306076
Mailing address: DEPT 1365, PO BOX 4569
ATLANTA, GA 30302
Contact: TERRY L RYLAND
Contact address: DEPT 1365, PO BOX 4569
ATLANTA, GA 30302
Contact country: US
Contact telephone: (404) 584-3953
Contact email: Not reported
EPA Region: 04
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: ATLANTA GAS LIGHT CO
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/01/1852
Owner/Op end date: Not reported

Owner/operator name: ATLANTA GAS LIGHT COMPANY
Owner/operator address: PO BOX 4569
ATLANTA, GA 30302
Owner/operator country: Not reported
Owner/operator telephone: (404) 584-4000
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1852
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON GAS LIGHT AND WATER COMPANY (Continued)

1000507720

Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 06/13/2003

Site name: ATLANTA GAS LIGHT-MACON MGP SITE

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 02/04/1992

Site name: ATLANTA GAS LIGHT-MACON MGP

Classification: Large Quantity Generator

Waste code: D000
Waste name: Not Defined

Waste code: D007
Waste name: CHROMIUM

Waste code: D008
Waste name: LEAD

Waste code: D009
Waste name: MERCURY

Waste code: D018
Waste name: BENZENE

Violation Status: No violations found

GA Financial Assurance 1:

Region: 1
Facility ID: 9000535
Financial Responsibility: Self Insured

ECHO:

Envid: 1000507720
Registry ID: 110009335512
DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110009335512

K69
SSE
1/8-1/4
0.225 mi.
1189 ft.
ATLANTA GAS PLANT
137 MULBERRY STREET
MACON, GA 31201
Site 2 of 5 in cluster K

US BROWNFIELDS 1014948580
FINDS N/A

Relative: US BROWNFIELDS:
Lower Recipient name: Macon, City of
Grant type: Assessment
Actual: Property name: ATLANTA GAS PLANT
304 ft. Property #: Not reported
Parcel size: 2.6

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATLANTA GAS PLANT (Continued)

1014948580

Property Description:	Not reported
Latitude:	32.833728
Longitude:	-83.620719
HCM label:	Address Matching-House Number
Map scale:	100000
Point of reference:	Entrance Point of a Facility or Station
Datum:	North American Datum of 1983
ACRES property ID:	12101
Start date:	09/30/2002 00:00:00
Completed date:	09/30/2002 00:00:00
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	Not reported
Assessment funding source:	Not reported
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	N/A
Accomplishment type:	Not reported
Accomplishment count:	0
Cooperative agreement #:	98480599
Ownership entity:	Not reported
Current owner:	Not reported
Did owner change:	Not reported
Cleanup required:	Yes
Video available:	Not reported
Photo available:	Not reported
Institutional controls required:	Not reported
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Not reported
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Unknown
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	Not reported
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controlled substance found:	Not reported
Controlled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATLANTA GAS PLANT (Continued)

1014948580

Other metals cleaned:	Not reported
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Not reported
PAHs cleaned up:	Not reported
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Not reported
Petro products cleaned:	Not reported
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Not reported
Soil cleaned up:	Not reported
Surface water cleaned:	Not reported
VOCs found:	Not reported
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	Not reported
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	Not reported
Arsenic cleaned up:	Not reported
Cadmium cleaned up:	Not reported
Chromium cleaned up:	Not reported
Copper cleaned up:	Not reported
Iron cleaned up:	Not reported
mercury cleaned up:	Not reported
nickel cleaned up:	Not reported
No clean up:	Not reported
Pesticides cleaned up:	Not reported
Selenium cleaned up:	Not reported
SVOCs cleaned up:	Not reported
Unknown clean up:	Not reported
Arsenic contaminant found:	Not reported
Cadmium contaminant found:	Not reported
Chromium contaminant found:	Not reported
Copper contaminant found:	Not reported
Iron contaminant found:	Not reported
Mercury contaminant found:	Not reported
Nickel contaminant found:	Not reported
No contaminant found:	Not reported
Pesticides contaminant found:	Not reported
Selenium contaminant found:	Not reported
SVOCs contaminant found:	Not reported
Unknown contaminant found:	Not reported
Future Use: Multistory	Not reported
Media affected Bluiding Material:	Not reported
Media affected indoor air:	Not reported
Building material media cleaned up:	Not reported
Indoor air media cleaned up:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATLANTA GAS PLANT (Continued)

1014948580

Unknown media cleaned up: Not reported
Past Use: Multistory Not reported
Highlights: Not reported
IC Data Address: Not reported
Redev Completion Date: Not reported
Below Poverty: 65
% Below Poverty: 3.3%
Low Income: 85
% Low Income: 2.5%
Median Income: 1295
Unemployed: 6
% Unemployed: 35.3%
Vacant Housing: 24
% Vacant Housing: 8.8%

FINDS:

Registry ID: 110009335512

Environmental Interest/Information System

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is an federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

RCRAInfo is a national information system that supports the Resource
Conservation and Recovery Act (RCRA) program through the tracking of
events and activities related to facilities that generate, transport,
and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA
program staff to track the notification, permit, compliance, and
corrective action activities required under RCRA.

SUPERFUND (NON-NPL)

K70 MACON GAS LIGHT AND WATER CO
SSE 137 MULBERRY STREET
1/8-1/4 MACON, GA 31201
0.225 mi.
1189 ft. Site 3 of 5 in cluster K

EDR MGP 1008408748
N/A

Relative: Manufactured Gas Plants:
Lower Alternate Name: MACON GAS CO. No additional information available

Actual:
304 ft.

K71 MACON MGP SITE
SSE 137 MULBERRY STREET
1/8-1/4 MACON, GA 31213
0.225 mi.
1189 ft. Site 4 of 5 in cluster K

SHWS S103920994
N/A

Relative: SHWS:
Lower Facility Id: 10511
Regulated Substances(RS): 1,1,1-Trichloroethane-GW; Acenaphthene-GW/Soil; Acetone-GW;
Arsenic-GW/Soil; Benzene-GW/Soil; Benzo(a)pyrene-Soil;
Benzo(ghi)perylene-Soil; Beryllium-GW/Soil; Chloroform-GW;

Actual:
304 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON MGP SITE (Continued)

S103920994

Chrysene-Soil; Dibenzo(a,h)anthracene-Soil; Fluoranthene-GW/Soil; Indeno(1,2,3-cd)pyrene-Soil; Mercury-Soil; Methyl ethyl ketone-GW; 2,4-Dimethylphenol-GW/Soil; Acenaphthylene-GW/Soil; Anthracene-GW/Soil; Barium-GW; Benzo(a)anthracene-Soil; Benzo(b)fluoranthene-Soil; Benzo(k)fluoranthene-Soil; Carbon disulfide-GW; Chromium-GW/Soil; Cyanides (soluble salts and complexes) n.o.s.-Soil; Ethylbenzene-GW/Soil; Fluorene-GW/Soil; Lead-GW/Soil; Methyl chloride-GW; Naphthalene-GW/Soil; o-Cresol-GW/Soil; Pyrene-GW/Soil; Tetrachloroethene-GW; Xylenes-GW/Soil; p-Cresol-Soil; Styrene-GW; Toluene-GW/Soil; Zinc-GW/Soil

RS Released/Threats to Health Env: This site has a known release of Benzo(a)pyrene in soil at levels exceeding the reportable quantity. This site has unlimited access. The nearest resident individual is less than 300 feet from the area affected by the release.

Status of Cleanup Activities: Cleanup activities are being conducted for source materials, soil, and groundwater.

GA EPD Dir Determination Re Correction Action: The Director has determined that this site requires corrective action.

Owner Name: City of Macon
Owner Address: 700 Poplar St., Room 309
Owner City,St,Zip: Macon, GA 31201
Last Known Property Owner NAME B: Macon Iron & Paper Stock Co. Inc.
Last Known Property Owner ADDRESS B: P.O. Box 506
Last Known Property Owner CITY B: Macon
Last Known Property Owner STATE B: GA
Last Known Property Owner ZIP B: 31202-0506
Last Known Property Owner NAME C: Macon-Bibb Co. Development Authority
Last Known Property Owner ADDRESS C: P.O. Box 169
Last Known Property Owner CITY C: Macon
Last Known Property Owner STATE C: GA
Last Known Property Owner ZIP C: 31201-0169
Last Known Property Owner NAME D: Not reported
Last Known Property Owner ADDRESS D: Not reported
Last Known Property Owner CITY D: Not reported
Last Known Property Owner STATE D: Not reported
Last Known Property Owner ZIP D: Not reported
Latitude: 32 50 ' 02 " N
Longitude: 83 37 ' 01 " W

K72 ATLANTA GAS LIGHT COMPANY
SSE 137 MULBERRY STREET
1/8-1/4 MACON, GA 31201
0.225 mi.
1189 ft. Site 5 of 5 in cluster K

AST A100327846
N/A

Relative: AST:
Lower Owner Name: Atlanta Gas Light Co.
Owner Address: P O Box 4569
Actual: Owner City/State/Zip: Atlanta GA 30302
304 ft. Number Of Tanks: 1
Tank Capacity: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

73
SE
1/8-1/4
0.236 mi.
1245 ft.

GENERAL RAILWAY SVCS INC
200 7TH ST
MACON, GA 31201

RCRA-CESQG
FINDS
ECHO

1004686308
GA0001003664

Relative:
Lower

RCRA-CESQG:

Date form received by agency: 01/05/1995

Facility name: GENERAL RAILWAY SVCS INC

Facility address: 200 7TH ST
MACON, GA 31201

EPA ID: GA0001003664

Mailing address: DILL RD
SUFFOLK, VA 23434

Contact: RICHARD COPELAND

Contact address: 830 DILL RD
SUFFOLK, VA 23434

Contact country: US

Contact telephone: (804) 539-0400

Contact email: Not reported

EPA Region: 04

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: GENERAL RAILWAY SVCS

Owner/operator address: 830 DILL RD
SUFFOLK, VA 23434

Owner/operator country: Not reported

Owner/operator telephone: (804) 539-0400

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Treater, storer or disposer of HW: No

Underground injection activity: No

On-site burner exemption: No

Furnace exemption: No

Used oil fuel burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENERAL RAILWAY SVCS INC (Continued)

1004686308

Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Waste code: D000
Waste name: Not Defined

Waste code: D001
Waste name: IGNITABLE WASTE

Violation Status: No violations found

FINDS:

Registry ID: 110005664398

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

ECHO:

Envid: 1004686308
Registry ID: 110005664398
DFR URL: http://echo.epa.gov/detailed_facility_report?fid=110005664398

74
WNW
1/8-1/4
0.238 mi.
1259 ft.

COCA COLA PROPERTY
658 WALNUT ST
MACON, GA 31201

US BROWNFIELDS 1016351278
FINDS N/A

Relative:
Higher

Actual:
329 ft.

US BROWNFIELDS:
Recipient name: Macon, City of
Grant type: Assessment
Property name: COCA COLA PROPERTY
Property #: Not reported
Parcel size: Not reported
Property Description: Not reported
Latitude: 32.839685
Longitude: -83.627579
HCM label: Not reported
Map scale: Not reported
Point of reference: Not reported
Datum: Not reported
ACRES property ID: 12103
Start date: 09/30/2002 00:00:00
Completed date: 09/30/2002 00:00:00
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COCA COLA PROPERTY (Continued)

1016351278

Assessment funding:	Not reported
Assessment funding source:	Not reported
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	N/A
Accomplishment type:	Not reported
Accomplishment count:	0
Cooperative agreement #:	98480599
Ownership entity:	Not reported
Current owner:	Not reported
Did owner change:	Not reported
Cleanup required:	Yes
Video available:	Not reported
Photo available:	Not reported
Institutional controls required:	Not reported
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Not reported
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Unknown
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	Not reported
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controlled substance found:	Not reported
Controlled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Not reported
Other metals cleaned:	Not reported
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Not reported
PAHs cleaned up:	Not reported
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Not reported
Petro products cleaned:	Not reported
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Not reported
Soil cleaned up:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COCA COLA PROPERTY (Continued)

1016351278

Surface water cleaned:	Not reported
VOCs found:	Not reported
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	Not reported
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	Not reported
Arsenic cleaned up:	Not reported
Cadmium cleaned up:	Not reported
Chromium cleaned up:	Not reported
Copper cleaned up:	Not reported
Iron cleaned up:	Not reported
mercury cleaned up:	Not reported
nickel cleaned up:	Not reported
No clean up:	Not reported
Pesticides cleaned up:	Not reported
Selenium cleaned up:	Not reported
SVOCs cleaned up:	Not reported
Unknown clean up:	Not reported
Arsenic contaminant found:	Not reported
Cadmium contaminant found:	Not reported
Chromium contaminant found:	Not reported
Copper contaminant found:	Not reported
Iron contaminant found:	Not reported
Mercury contaminant found:	Not reported
Nickel contaminant found:	Not reported
No contaminant found:	Not reported
Pesticides contaminant found:	Not reported
Selenium contaminant found:	Not reported
SVOCs contaminant found:	Not reported
Unknown contaminant found:	Not reported
Future Use: Multistory	Not reported
Media affected Bluiding Material:	Not reported
Media affected indoor air:	Not reported
Building material media cleaned up:	Not reported
Indoor air media cleaned up:	Not reported
Unknown media cleaned up:	Not reported
Past Use: Multistory	Not reported
Highlights:	Not reported
IC Data Address:	Not reported
Redev Completion Date:	Not reported
# Below Poverty:	355
% Below Poverty:	2.8%
# Low Income:	511
% Low Income:	2.0%
Meidan Income:	2981
# Unemployed:	46
% Unemployed:	21.7%
# Vacant Housing:	174

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COCA COLA PROPERTY (Continued)

1016351278

% Vacant Housing: 5.7%

FINDS:

Registry ID: 110039534046

Environmental Interest/Information System

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is an federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

L75
NW
1/4-1/2
0.262 mi.
1386 ft.

RIVERSIDE DRIVE PROPERTY
695 RIVERSIDE DRIVE
MACON, GA 31201

GA NON-HSI S104240143
N/A

Site 1 of 2 in cluster L

Relative:
Lower

NON HSI:

Latitude: Not reported
Longitude: Not reported

Actual:
289 ft.

Ground Water Pathway Score: 9.76
On-Site Pathway Score: 0.00
Report Date: 10/01/1999
Additional Info: Not reported
Contamination: naphthalene; 1,1,1-trichloroethene

76
SSW
1/4-1/2
0.277 mi.
1461 ft.

OLD WESTERN UNION
310 CHERRY STREET
MACON, GA 31201

LUST U003295810
UST N/A
Financial Assurance

Relative:
Higher

LUST:

Facility ID: 09011179
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - Remediation
Date Received: 07/02/1997
Project Officer: Wallace,Ronald J

Actual:
322 ft.

Facility:

Facility Id: 9011179
Facility Status: Closed
Facility Type: Not Marked
District: West Central
Contact Id: 8579
Owner Name: BIBB COUNTY BOARD OF COMMISSIONERS
Owner Address: BIBB COUNTY COURTHOUSE ROOM 408
Owner City: MACON
Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 478-621-6660

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WESTERN UNION (Continued)

U003295810

Tanks:

Tank ID:	1
Status:	Installed
Status Date:	Not reported
Tank ID:	1
Status:	Removed From Ground Date Unknown
Status Date:	Not reported
Tank ID:	1
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	1
Product1:	Empty
Material:	Bare Steel
Capacity:	550
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	2
Status:	Installed
Status Date:	Not reported
Tank ID:	2
Status:	Removed From Ground Date Unknown
Status Date:	Not reported
Tank ID:	2
Status:	Upgrade Repair Not Marked
Status Date:	Not reported
Tank ID:	2
Product1:	Empty
Material:	Bare Steel
Capacity:	550
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported

GA Financial Assurance 1:

Region:	1
Facility ID:	9011179
Financial Responsibility:	None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

L77 GEORGIA DEPARTMENT OF TRANSPORTA
NW 3.1 MILES NE OF I-16 SQODA RD
1/4-1/2 HUBER, GA 31201

LUST 1006778277
UST N/A
Financial Assurance

0.281 mi.
1484 ft.

Site 2 of 2 in cluster L

Relative:
Higher

LUST:

Facility ID: 01420017
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 12/06/1999
Project Officer: Humphris,David D

Actual:
318 ft.

Facility:

Facility Id: 1420017
Facility Status: Closed
Facility Type: State
District: West Central
Contact Id: 693
Owner Name: GEORGIA DEPARTMENT OF TRANSPORTA
Owner Address: 935 E CONFEDERATE AVE BLDG 24
Owner City: ATLANTA
Owner State: GA
Owner Zip: 30316
Owner City,St,Zip: ATLANTA, GA 30316
Owner Telephone: 404-635-8734

Tanks:

Tank ID: 346G1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 346G1
Status: Removed From Ground
Status Date: 10/14/1999

Tank ID: 346G1
Status: Installed
Status Date: 04/24/1972

Tank ID: 346G1
Product1: Gas
Material: Bare Steel
Capacity: 1060
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 1420017
Financial Responsibility: G.U.S.T. Trust Fund

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

M78 450 MLK JR., BLVD
SSW 450 MLK JR, BLVD.(A/K/A 466 BROADWAY)
1/4-1/2 MACON, GA

BROWNFIELDS S118197564
N/A

0.292 mi.
1540 ft.

Site 1 of 3 in cluster M

Relative: BROWNFIELD:
Higher Acreage: 0.35099999999999998
Risk: To be Determined
Actual: Restricted: To be Determined
321 ft. RRS Code: Not reported
Status: Withdrawn N-HSI
Date Cleanup Plan: 01/27/2006
Date Cleanup Completed: Not reported

M79 PALMER IND INC
SSW 450 MLK JR BLVD
1/4-1/2 MACON, GA 31202

LUST U003727929
UST N/A
Financial Assurance

0.292 mi.
1540 ft.

Site 2 of 3 in cluster M

Relative: LUST:
Higher Facility ID: 09011194
Leak ID: 1
Actual: Description: Confirmed Release
321 ft. Cleanup Status: NFA - No Further Action
Date Received: 07/29/1999
Project Officer: Wallace,Ronald J

Facility:

Facility Id: 9011194
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 8684
Owner Name: PALMER IND INC
Owner Address: PO BOX 759
Owner City: MACON
Owner State: GA
Owner Zip: 31202
Owner City,St,Zip: MACON, GA 31202
Owner Telephone: 912-474-4536

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 05/02/2000

Tank ID: 1
Status: Installed
Status Date: 01/01/1945

Tank ID: 1
Product1: Diesel
Material: Bare Steel
Capacity: 3000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PALMER IND INC (Continued)

U003727929

Pipe Material: Bare Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Closed In Ground
Status Date: 05/02/2000

Tank ID: 2
Status: Installed
Status Date: 01/01/1945

Tank ID: 2
Product1: Diesel
Material: Bare Steel
Capacity: 3000
Pipe Material: Bare Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:
Region: 1
Facility ID: 9011194
Financial Responsibility: Not Marked

80
SSE
1/4-1/2
0.300 mi.
1584 ft.
**ATLANTA GAS LIGHT COMPANY: MACON MGP
MULBERRY ST.
MACON, GA 31213**

**GA NON-HSI S105872140
N/A**

Relative: NON HSI:
Lower Latitude: 32.833
Longitude: -83.62
Actual: Ground Water Pathway Score: 9
298 ft. On-Site Pathway Score: 0
Report Date: Not reported
Additional Info: Not reported
Contamination: lead

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

81
South
1/4-1/2
0.312 mi.
1648 ft.

STRAIGHT EIGHT CORP/TERMINAL WAR
454 TERMINAL AVE
MACON, GA 31201

LUST
UST
FINDS
Financial Assurance

1006794774
N/A

Relative:
Higher

LUST:
Facility ID: 09011224
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 02/13/2002
Project Officer: Jones, F. Calvin

Actual:
320 ft.

Facility:
Facility Id: 9011224
Facility Status: Closed
Facility Type: Industrial
District: West Central
Contact Id: 8723
Owner Name: STRAIGHT EIGHT CORPORATION
Owner Address: 6951 GAINES RIDGE RD
Owner City: COLUMBUS
Owner State: GA
Owner Zip: 31904
Owner City,St,Zip: COLUMBUS, GA 31904
Owner Telephone: 706-660-2272

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Temporarily Out Of Use
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground Date Unknown
Status Date: Not reported

Tank ID: 1
Product 1: Diesel
Material: Marked Unknown
Capacity: 1000
Pipe Material: Secondary Containment
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

FINDS:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STRAIGHT EIGHT CORP/TERMINAL WAR (Continued)

1006794774

Registry ID: 110013642335

Environmental Interest/Information System

GEIMS (Geographic Environmental Information Management System) provides the EPA and Public a single point of access to core data for all facilities and sites regulated or monitored by the EPA and a single system for the reporting of all environmental data.

GA Financial Assurance 1:

Region: 1
Facility ID: 9011224
Financial Responsibility: Not Marked

M82
SSW
1/4-1/2
0.321 mi.
1697 ft.

**LOT #44 GOODYEAR
486 BROADWAY
MACON, GA 31201**

Site 3 of 3 in cluster M

**LUST U003003769
UST N/A
Financial Assurance**

**Relative:
Higher**

LUST:

Facility ID: 04110367
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 01/17/1996
Project Officer: Buerkle,Andrea C

**Actual:
321 ft.**

Facility ID: 04110367
Leak ID: 1
Description: Suspected Release
Cleanup Status: NFA - No Further Action
Date Received: 11/15/1995
Project Officer: Buerkle,Andrea C

Facility:

Facility Id: 4110367
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 5408
Owner Name: MACON BIBB COUNTY ROAD IMPROVEME
Owner Address: P O BOX 248
Owner City: MACON
Owner State: GA
Owner Zip: 31208
Owner City,St,Zip: MACON, GA 31208
Owner Telephone: 912-755-0000

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 11/15/1995

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOT #44 GOODYEAR (Continued)

U003003769

Tank ID: 1
Status: **Installed**
Status Date: 04/15/1984

Tank ID: 1
Product1: Used Oil
Material: Bare Steel
Capacity: 300
Pipe Material: Bare Steel
Pipe Type: Gravity Fed
Overfill Protection: Yes
Overfill Installed: Not reported
Tank Exempt From Spill: Yes
Date Spill Device Installed: Not reported

Tank ID: 2
Status: **Upgrade Repair Not Marked**
Status Date: Not reported

Tank ID: 2
Status: **Installed**
Status Date: Not reported

Tank ID: 2
Status: **Removed From Ground**
Status Date: 03/14/2001

Tank ID: 2
Product1: Gas
Material: Bare Steel
Capacity: 500
Pipe Material: Not Marked
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:
Region: 1
Facility ID: 4110367
Financial Responsibility: Self Insured

83
West
1/4-1/2
0.340 mi.
1795 ft.

DOWNTOWN CHEVRON SERVICE CENTER
311 FIRST ST
MACON, GA 31201

LUST U001486758
UST N/A
Financial Assurance

Relative:
Higher

LUST:
Facility ID: 04110107
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 12/30/1997
Project Officer: Badru,Abiola

Actual:
340 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DOWNTOWN CHEVRON SERVICE CENTER (Continued)

U001486758

Facility:

Facility Id: 4110107
Facility Status: Closed
Facility Type: Gas Station
District: West Central
Contact Id: 5094
Owner Name: DOWNTOWN CHEVRON SERVICE CENTER
Owner Address: 311 FIRST ST
Owner City: MACON
Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 912-745-1812

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: 06/13/1995

Tank ID: 1
Status: Removed From Ground
Status Date: 09/15/1986

Tank ID: 1
Status: Installed
Status Date: 03/20/1967

Tank ID: 1
Product1: Gas
Material: Cathodically Protected Steel
Capacity: 5000
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: 06/13/1995

Tank ID: 2
Status: Removed From Ground
Status Date: 09/15/1986

Tank ID: 2
Status: Installed
Status Date: 03/20/1967

Tank ID: 2
Product1: Gas
Material: Cathodically Protected Steel
Capacity: 3000
Pipe Material: Galvanized Steel
Pipe Type: Not Marked
Overfill Protection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DOWNTOWN CHEVRON SERVICE CENTER (Continued)

U001486758

Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	3
Status:	Upgrade Repair Not Marked
Status Date:	06/13/1995
Tank ID:	3
Status:	Removed From Ground
Status Date:	09/15/1986
Tank ID:	3
Status:	Installed
Status Date:	03/20/1967
Tank ID:	3
Product1:	Gas
Material:	Cathodically Protected Steel
Capacity:	3000
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	4
Status:	Upgrade Repair Not Marked
Status Date:	06/13/1995
Tank ID:	4
Status:	Removed From Ground
Status Date:	09/15/1986
Tank ID:	4
Status:	Installed
Status Date:	03/20/1967
Tank ID:	4
Product1:	Gas
Material:	Cathodically Protected Steel
Capacity:	3000
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Not reported
Overfill Installed:	Not reported
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	Not reported
Tank ID:	5
Status:	Upgrade Repair Not Marked
Status Date:	06/13/1995
Tank ID:	5
Status:	Removed From Ground
Status Date:	09/15/1986

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DOWNTOWN CHEVRON SERVICE CENTER (Continued)

U001486758

Tank ID:	5
Status:	Installed
Status Date:	03/20/1967
Tank ID:	5
Product1:	Used Oil
Material:	Cathodically Protected Steel
Capacity:	550
Pipe Material:	Galvanized Steel
Pipe Type:	Not Marked
Overfill Protection:	Yes
Overfill Installed:	Not reported
Tank Exempt From Spill:	Yes
Date Spill Device Installed:	Not reported
Tank ID:	6
Status:	Upgrade Repair Not Marked
Status Date:	02/15/2000
Tank ID:	6
Status:	Removed From Ground
Status Date:	01/07/2000
Tank ID:	6
Status:	Installed
Status Date:	11/01/1986
Tank ID:	6
Product1:	Gas
Material:	Cathodically Protected Steel
Capacity:	8000
Pipe Material:	Fiberglass Reinforced Plastic
Pipe Type:	Pressure
Overfill Protection:	Not reported
Overfill Installed:	11/01/1986
Tank Exempt From Spill:	Not reported
Date Spill Device Installed:	11/01/1986
Tank ID:	7
Status:	Upgrade Repair Not Marked
Status Date:	02/15/2000
Tank ID:	7
Status:	Removed From Ground
Status Date:	01/07/2000
Tank ID:	7
Status:	Installed
Status Date:	11/01/1986
Tank ID:	7
Product1:	Gas
Material:	Cathodically Protected Steel
Capacity:	8000
Pipe Material:	Fiberglass Reinforced Plastic
Pipe Type:	Pressure
Overfill Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DOWNTOWN CHEVRON SERVICE CENTER (Continued)

U001486758

Overfill Installed: 11/01/1986
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 11/01/1986

Tank ID: 8
Status: Upgrade Repair Not Marked
Status Date: 02/15/2000

Tank ID: 8
Status: Removed From Ground
Status Date: 01/07/2000

Tank ID: 8
Status: Installed
Status Date: 11/01/1986

Tank ID: 8
Product1: Gas
Material: Cathodically Protected Steel
Capacity: 8000
Pipe Material: Fiberglass Reinforced Plastic
Pipe Type: Pressure
Overfill Protection: Not reported
Overfill Installed: 11/01/1986
Tank Exempt From Spill: Not reported
Date Spill Device Installed: 11/01/1986

GA Financial Assurance 1:
Region: 1
Facility ID: 4110107
Financial Responsibility: G.U.S.T. Trust Fund

84
SW
1/4-1/2
0.371 mi.
1958 ft.

NORFOLK SOUTHERN BROSAN YARD
190 POPLAR STREET
MACON, GA 31201

LUST **U003295805**
UST **N/A**
Financial Assurance

Relative: LUST:
Higher Facility ID: 09011174
Leak ID: 1
Description: Confirmed Release
Actual: Cleanup Status: NFA - No Further Action
325 ft. Date Received: 09/13/1996
Project Officer: Logan, William E.

Facility:
Facility Id: 9011174
Facility Status: Closed
Facility Type: Railroad
District: West Central
Contact Id: 374
Owner Name: NORFOLK SOUTHERN BROSAN YARD
Owner Address: 110 FRANKLIN ROAD SE
Owner City: ROANOKE
Owner State: VA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NORFOLK SOUTHERN BROSNAK YARD (Continued)

U003295805

Owner Zip: 24042
Owner City,St,Zip: ROANOKE, VA 24042
Owner Telephone: 540-981-4239

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 04/18/1996

Tank ID: 1
Product1: Diesel
Material: Bare Steel
Capacity: 500
Pipe Material: Galvanized Steel
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 9011174
Financial Responsibility: Self Insured

85
SSE
1/4-1/2
0.394 mi.
2078 ft.

**ANDERSON MCGRUFF
398 EIGHTH ST
MACON, GA 31201**

**LUST 1006790208
UST N/A
FINDS**

Financial Assurance

**Relative:
Lower**

LUST:

Facility ID: 09000289
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 04/15/1989
Project Officer: Vinson-Brittman, Anita

**Actual:
290 ft.**

Facility:

Facility Id: 9000289
Facility Status: Closed
Facility Type: Commercial
District: West Central
Contact Id: 6963
Owner Name: ANDERSON MCGRUFF COMPANY
Owner Address: P O BOX 93523
Owner City: ATLANTA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ANDERSON MCGRUFF (Continued)

1006790208

Owner State: GA
Owner Zip: 30318
Owner City, St, Zip: ATLANTA, GA 30318
Owner Telephone: 404-355-2760

Tanks:

Tank ID: 1
Status: Removed From Ground Date Unknown
Status Date: Not reported

Tank ID: 1
Status: Installed Date Unknown
Status Date: Not reported

Tank ID: 1
Product1: Diesel
Material: Not Marked/Unknown
Capacity: 652
Pipe Material: Not Marked
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

FINDS:

Registry ID: 110013596340

Environmental Interest/Information System

GEIMS (Geographic Environmental Information Management System) provides the EPA and Public a single point of access to core data for all facilities and sites regulated or monitored by the EPA and a single system for the reporting of all environmental data.

GA Financial Assurance 1:

Region: 1
Facility ID: 9000289
Financial Responsibility: Not Marked

N86
NW
1/4-1/2
0.403 mi.
2128 ft.
MACON-BIBB COUNTY TRANSIT AUTHOR
815 RIVERSIDE DR
MACON, GA 31201
Site 1 of 2 in cluster N

LUST U003004376
UST N/A

Financial Assurance

Relative:
Higher

LUST:

Facility ID: 09011141
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 02/10/2000
Project Officer: Humphris, David D

Actual:
323 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON-BIBB COUNTY TRANSIT AUTHORITY (Continued)

U003004376

Facility:

Facility Id: 9011141
Facility Status: Closed
Facility Type: County
District: West Central
Contact Id: 8600
Owner Name: MACON-BIBB COUNTY TRANSIT AUTHORITY
Owner Address: 815 RIVERSIDE DR
Owner City: MACON
Owner State: GA
Owner Zip: 31201
Owner City,St,Zip: MACON, GA 31201
Owner Telephone: 912-746-1318

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: 02/11/2000

Tank ID: 1
Status: Removed From Ground
Status Date: 01/11/2000

Tank ID: 1
Product1: Diesel
Material: Cathodically Protected Steel
Capacity: 10000
Pipe Material: Galvanized Steel
Pipe Type: Suction: Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Installed
Status Date: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: 02/11/2000

Tank ID: 2
Status: Removed From Ground
Status Date: 01/11/2000

Tank ID: 2
Product1: Diesel
Material: Cathodically Protected Steel
Capacity: 10000
Pipe Material: Galvanized Steel
Pipe Type: Suction: Valve At The Tank
Overfill Protection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MACON-BIBB COUNTY TRANSIT AUTHORITY (Continued)

U003004376

Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 3
Status: Installed
Status Date: Not reported

Tank ID: 3
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 3
Status: Removed From Ground
Status Date: 01/11/2000

Tank ID: 3
Product1: Used Oil
Material: Not Marked/Unknown
Capacity: 500
Pipe Material: Not Marked
Pipe Type: Not Marked
Overfill Protection: Yes
Overfill Installed: Not reported
Tank Exempt From Spill: Yes
Date Spill Device Installed: Not reported

GA Financial Assurance 1:
Region: 1
Facility ID: 9011141
Financial Responsibility: G.U.S.T. Trust Fund

N87
NW
1/4-1/2
0.426 mi.
2251 ft.
MACON GAS LIGHT AND WATER CO
WILLOW STREET
MACON, GA 31201
Site 2 of 2 in cluster N

EDR MGP 1008408749
N/A

Relative: Lower
Manufactured Gas Plants: No additional information available

Actual:
300 ft.

88
West
1/4-1/2
0.444 mi.
2342 ft.
BST\MACON MAIN\IR2110
787 CHERRY ST
MACON, GA 31201

LUST S107749928
AIRS N/A
TIER 2

Relative: Higher
LUST:
Facility ID: 04110369
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 10/06/1992

Actual:
357 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Project Officer: Revell-Robinson,Isabelle

AIRS:

Record Type:	Not reported
State County FIPS:	Not reported
State Facility Id:	302100183
Facility Registry Id:	Not reported
Facility Category:	Not reported
Oris Facility code:	Not reported
SIC Primary:	Not reported
NAICS Primary:	Not reported
Dun&Bradstreet Number:	Not reported
Tri Id number:	Not reported
NTI Site id:	Not reported
Facility County:	Not reported
Site Description:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported
AIRS Number:	041302100183
Operational Status:	O
SIC Code:	4811
Latitude:	000000
Longitude:	000000
Contact Name:	N/A N/A
Contact Company:	N/A
Contact Telephone:	N/A
Contact Telephone 2:	N/A
Contact Fax:	N/A
Contact Email:	N/A
Contact Address:	N/A
Contact Address 2:	N/A
Contact City,St,Zip:	N/A, GA 00000
Year:	06

Control Device Information:

Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Process ID:	Not reported
Pollutant Code:	Not reported
Primary Pct control Efficiency:	Not reported
Pct Capture Efficiency:	Not reported
Total Capture Control Efficiency:	Not reported
Primary Device Type Code:	Not reported
Secondary Device Type Code:	Not reported
Control System Description:	Not reported
Third Control Device Type Code:	Not reported
Fourth Control Device Type Code:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Airs Emissions:

Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Process Id:	Not reported
Pollutant Code:	Not reported
Emission Release Point ID:	Not reported
Start Date:	Not reported
End Date:	Not reported
Start Time:	Not reported
End Time:	Not reported
Emission Numeric Value:	Not reported
Emission Unit Numerator:	Not reported
Emission Type:	Not reported
Em Reliability Indicator:	Not reported
Factor Numeric Value:	Not reported
Factor Unit Numerator:	Not reported
Factor Unit Denominator:	Not reported
Material:	Not reported
Material Io:	Not reported
Emission Calculation Method Code:	Not reported
Ef Reliability Indicator:	Not reported
Rule Effectiveness:	Not reported
Rule Effectiveness Method:	Not reported
Hap Emissions Performance Level:	Not reported
Control Status:	Not reported
Emission Data Level:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Airs EP:	
Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Emission Release Point ID:	Not reported
Process ID:	Not reported
Scs Number:	Not reported
Process Mact Code:	Not reported
Emission Process Description:	Not reported
Winter Throughput Pct:	Not reported
Spring Throughput Pct:	Not reported
Summer Throughput Pct:	Not reported
Fall Throughput Pct:	Not reported
Annual Average Days Per Week:	Not reported
Annual Average Weeks Per Year:	Not reported
Annual Average Hours Per Day:	Not reported
Annual Average Hours Per Year:	Not reported
Heat Content:	Not reported
Sulfur Content:	Not reported
Ash Content:	Not reported
Process Mact compliance Status:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Emission Release Points:	
Year:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Release Point ID:	Not reported
Emission Release Point Type:	Not reported
Stack Height:	Not reported
Stack Diameter:	Not reported
Stack Fenceline Distance:	Not reported
Exit Gas Temperature:	Not reported
Exit Gas Velocity:	Not reported
Exit Gas Flowrate:	Not reported
X Coordinate:	Not reported
Y Coordinate:	Not reported
Utm Zone:	Not reported
X Y coordinate Type:	Not reported
Horizontal Area Fugitive:	Not reported
Release Height Fugitive:	Not reported
Fugitive Dimensions Unit:	Not reported
Emission Release Point Description:	Not reported
Submittal Flag:	Not reported
Horizontal Collection method Code:	Not reported
Horizontal Accuracy Measure:	Not reported
Horizontal Reference datum Code:	Not reported
Reference Point Code:	Not reported
Source Map scale Number:	Not reported
Coordinate Data source Code:	Not reported
Tribal Code:	Not reported

Airs EU:

Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Oris Boiler ID:	Not reported
Sic Unit Level:	Not reported
Naics Unit Level:	Not reported
Design Capacity:	Not reported
Design Capacity Unit Numerator:	Not reported
Design Capacity Unit Denominator:	Not reported
Max Nameplate Capacity:	Not reported
Emission Unit Description:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Process Annual Throughput:

Year:	Not reported
Record Type:	Not reported
State County fips:	Not reported
State Facility identifier:	Not reported
Emission Unit id:	Not reported
Process ID:	Not reported
Start Date:	Not reported
End Date:	Not reported
Start Time:	Not reported
End Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Actual Throughput:	Not reported
Throughput Unit numerator:	Not reported
Material:	Not reported
Material lo:	Not reported
Period Days per week:	Not reported
Period Weeks per period:	Not reported
Period Hours per day:	Not reported
Period Hours per period:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Transaction Table:

Year:	Not reported
Record Type:	Not reported
State County fips:	Not reported
Organization Name:	Not reported
Transaction Type:	Not reported
Inventory Year:	Not reported
Inventory Type code:	Not reported
Transaction Create date:	Not reported
Incremental Submission number:	Not reported
Reliability Indicator:	Not reported
Transaction Comments:	Not reported
Contact Person name:	Not reported
Contact Phone number:	Not reported
Telephone Number type name:	Not reported
Electronic Address text:	Not reported
Electronic Address type name:	Not reported
Source Type:	Not reported
Affiliation Type:	Not reported
Format Version:	Not reported
Tribal Code:	Not reported

Record Type:	Not reported
State County FIPS:	Not reported
State Facility Id:	302100183
Facility Registry Id:	Not reported
Facility Category:	Not reported
Oris Facility code:	Not reported
SIC Primary:	Not reported
NAICS Primary:	Not reported
Dun&Bradstreet Number:	Not reported
Tri Id number:	Not reported
NTI Site id:	Not reported
Facility County:	Not reported
Site Description:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported
AIRS Number:	041302100183
Operational Status:	Not reported
SIC Code:	4811
Latitude:	000000
Longitude:	000000
Contact Name:	N/A N/A
Contact Company:	N/A
Contact Telephone:	N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Contact Telephone 2: N/A
Contact Fax: N/A
Contact Email: N/A
Contact Address: N/A
Contact Address 2: N/A
Contact City,St,Zip: N/A, GA 00000
Year: Not reported

Control Device Information:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Unit ID: Not reported
Process ID: Not reported
Pollutant Code: Not reported
Primary Pct control Efficiency: Not reported
Pct Capture Efficiency: Not reported
Total Capture Control Efficiency: Not reported
Primary Device Type Code: Not reported
Secondary Device Type Code: Not reported
Control System Description: Not reported
Third Control Device Type Code: Not reported
Fourth Control Device Type Code: Not reported
Submittal Flag: Not reported
Tribal Code: Not reported

Airs Emissions:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Unit ID: Not reported
Process Id: Not reported
Pollutant Code: Not reported
Emission Release Point ID: Not reported
Start Date: Not reported
End Date: Not reported
Start Time: Not reported
End Time: Not reported
Emission Numeric Value: Not reported
Emission Unit Numerator: Not reported
Emission Type: Not reported
Em Reliability Indicator: Not reported
Factor Numeric Value: Not reported
Factor Unit Numerator: Not reported
Factor Unit Denominator: Not reported
Material: Not reported
Material Id: Not reported
Emission Calculation Method Code: Not reported
Ef Reliability Indicator: Not reported
Rule Effectiveness: Not reported
Rule Effectiveness Method: Not reported
Hap Emissions Performance Level: Not reported
Control Status: Not reported
Emission Data Level: Not reported
Submittal Flag: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Tribal Code: Not reported

Airs EP:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Unit ID: Not reported
Emission Release Point ID: Not reported
Process ID: Not reported
Scc Number: Not reported
Process Mact Code: Not reported
Emission Process Description: Not reported
Winter Throughput Pct: Not reported
Spring Throughput Pct: Not reported
Summer Throughput Pct: Not reported
Fall Throughput Pct: Not reported
Annual Average Days Per Week: Not reported
Annual Average Weeks Per Year: Not reported
Annual Average Hours Per Day: Not reported
Annual Average Hours Per Year: Not reported
Heat Content: Not reported
Sulfur Content: Not reported
Ash Content: Not reported
Process Mact compliance Status: Not reported
Submittal Flag: Not reported
Tribal Code: Not reported

Emission Release Points:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Release Point ID: Not reported
Emission Release Point Type: Not reported
Stack Height: Not reported
Stack Diameter: Not reported
Stack Fenceline Distance: Not reported
Exit Gas Temperature: Not reported
Exit Gas Velocity: Not reported
Exit Gas Flowrate: Not reported
X Coordinate: Not reported
Y Coordinate: Not reported
Utm Zone: Not reported
X Y coordinate Type: Not reported
Horizontal Area Fugitive: Not reported
Release Height Fugitive: Not reported
Fugitive Dimensions Unit: Not reported
Emission Release Point Description: Not reported
Submittal Flag: Not reported
Horizontal Collection method Code: Not reported
Horizontal Accuracy Measure: Not reported
Horizontal Reference datum Code: Not reported
Reference Point Code: Not reported
Source Map scale Number: Not reported
Coordinate Data source Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Tribal Code:	Not reported
Airs EU:	
Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Oris Boiler ID:	Not reported
Sic Unit Level:	Not reported
Naics Unit Level:	Not reported
Design Capacity:	Not reported
Design Capacity Unit Numerator:	Not reported
Design Capacity Unit Denominator:	Not reported
Max Nameplate Capacity:	Not reported
Emission Unit Description:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported
Process Annual Throughput:	
Year:	Not reported
Record Type:	Not reported
State County fips:	Not reported
State Facility identifier:	Not reported
Emission Unit id:	Not reported
Process ID:	Not reported
Start Date:	Not reported
End Date:	Not reported
Start Time:	Not reported
End Time:	Not reported
Actual Throughput:	Not reported
Throughput Unit numerator:	Not reported
Material:	Not reported
Material lo:	Not reported
Period Days per week:	Not reported
Period Weeks per period:	Not reported
Period Hours per day:	Not reported
Period Hours per period:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported
Transaction Table:	
Year:	Not reported
Record Type:	Not reported
State County fips:	Not reported
Organization Name:	Not reported
Transaction Type:	Not reported
Inventory Year:	Not reported
Inventory Type code:	Not reported
Transaction Create date:	Not reported
Incremental Submission number:	Not reported
Reliability Indicator:	Not reported
Transaction Comments:	Not reported
Contact Person name:	Not reported
Contact Phone number:	Not reported
Telephone Number type name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Electronic Address text: Not reported
Electronic Address type name: Not reported
Source Type: Not reported
Affiliation Type: Not reported
Format Version: Not reported
Tribal Code: Not reported

Record Type: Not reported
State County FIPS: Not reported
State Facility Id: 302100183
Facility Registry Id: Not reported
Facility Category: Not reported
Oris Facility code: Not reported
SIC Primary: Not reported
NAICS Primary: Not reported
Dun&Bradstreet Number: Not reported
Tri Id number: Not reported
NTI Site id: Not reported
Facility County: Not reported
Site Description: Not reported
Submittal Flag: Not reported
Tribal Code: Not reported
AIRS Number: 041302100183
Operational Status: O
SIC Code: 4811
Latitude: 000000
Longitude: 000000
Contact Name: N/A N/A
Contact Company: N/A
Contact Telephone: N/A
Contact Telephone 2: N/A
Contact Fax: N/A
Contact Email: N/A
Contact Address: N/A
Contact Address 2: N/A
Contact City,St,Zip: N/A, GA 00000
Year: Not reported

Control Device Information:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Unit ID: Not reported
Process ID: Not reported
Pollutant Code: Not reported
Primary Pct control Efficiency: Not reported
Pct Capture Efficiency: Not reported
Total Capture Control Efficiency: Not reported
Primary Device Type Code: Not reported
Secondary Device Type Code: Not reported
Control System Description: Not reported
Third Control Device Type Code: Not reported
Fourth Control Device Type Code: Not reported
Submittal Flag: Not reported
Tribal Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Airs Emissions:

Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Process Id:	Not reported
Pollutant Code:	Not reported
Emission Release Point ID:	Not reported
Start Date:	Not reported
End Date:	Not reported
Start Time:	Not reported
End Time:	Not reported
Emission Numeric Value:	Not reported
Emission Unit Numerator:	Not reported
Emission Type:	Not reported
Em Reliability Indicator:	Not reported
Factor Numeric Value:	Not reported
Factor Unit Numerator:	Not reported
Factor Unit Denominator:	Not reported
Material:	Not reported
Material Io:	Not reported
Emission Calculation Method Code:	Not reported
Em Reliability Indicator:	Not reported
Rule Effectiveness:	Not reported
Rule Effectiveness Method:	Not reported
Hap Emissions Performance Level:	Not reported
Control Status:	Not reported
Emission Data Level:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Airs EP:

Year:	Not reported
Record Type:	Not reported
State County Fips:	Not reported
State Facility Identifier:	Not reported
Emission Unit ID:	Not reported
Emission Release Point ID:	Not reported
Process ID:	Not reported
Scc Number:	Not reported
Process Mact Code:	Not reported
Emission Process Description:	Not reported
Winter Throughput Pct:	Not reported
Spring Throughput Pct:	Not reported
Summer Throughput Pct:	Not reported
Fall Throughput Pct:	Not reported
Annual Average Days Per Week:	Not reported
Annual Average Weeks Per Year:	Not reported
Annual Average Hours Per Day:	Not reported
Annual Average Hours Per Year:	Not reported
Heat Content:	Not reported
Sulfur Content:	Not reported
Ash Content:	Not reported
Process Mact compliance Status:	Not reported
Submittal Flag:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Tribal Code: Not reported

Emission Release Points:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Release Point ID: Not reported
Emission Release Point Type: Not reported
Stack Height: Not reported
Stack Diameter: Not reported
Stack Fenceline Distance: Not reported
Exit Gas Temperature: Not reported
Exit Gas Velocity: Not reported
Exit Gas Flowrate: Not reported
X Coordinate: Not reported
Y Coordinate: Not reported
Utm Zone: Not reported
X Y coordinate Type: Not reported
Horizontal Area Fugitive: Not reported
Release Height Fugitive: Not reported
Fugitive Dimensions Unit: Not reported
Emission Release Point Description: Not reported
Submittal Flag: Not reported
Horizontal Collection method Code: Not reported
Horizontal Accuracy Measure: Not reported
Horizontal Reference datum Code: Not reported
Reference Point Code: Not reported
Source Map scale Number: Not reported
Coordinate Data source Code: Not reported
Tribal Code: Not reported

Airs EU:

Year: Not reported
Record Type: Not reported
State County Fips: Not reported
State Facility Identifier: Not reported
Emission Unit ID: Not reported
Oris Boiler ID: Not reported
Sic Unit Level: Not reported
Naics Unit Level: Not reported
Design Capacity: Not reported
Design Capacity Unit Numerator: Not reported
Design Capacity Unit Denominator: Not reported
Max Nameplate Capacity: Not reported
Emission Unit Description: Not reported
Submittal Flag: Not reported
Tribal Code: Not reported

Process Annual Throughput:

Year: Not reported
Record Type: Not reported
State County fips: Not reported
State Facility identifier: Not reported
Emission Unit id: Not reported
Process ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Start Date:	Not reported
End Date:	Not reported
Start Time:	Not reported
End Time:	Not reported
Actual Throughput:	Not reported
Throughput Unit numerator:	Not reported
Material:	Not reported
Material Io:	Not reported
Period Days per week:	Not reported
Period Weeks per period:	Not reported
Period Hours per day:	Not reported
Period Hours per period:	Not reported
Submittal Flag:	Not reported
Tribal Code:	Not reported

Transaction Table:

Year:	Not reported
Record Type:	Not reported
State County fips:	Not reported
Organization Name:	Not reported
Transaction Type:	Not reported
Inventory Year:	Not reported
Inventory Type code:	Not reported
Transaction Create date:	Not reported
Incremental Submission number:	Not reported
Reliability Indicator:	Not reported
Transaction Comments:	Not reported
Contact Person name:	Not reported
Contact Phone number:	Not reported
Telephone Number type name:	Not reported
Electronic Address text:	Not reported
Electronic Address type name:	Not reported
Source Type:	Not reported
Affiliation Type:	Not reported
Format Version:	Not reported
Tribal Code:	Not reported

GA TIER 2:

Reporting Year:	2015
Facility ID:	5372817
Facility Country:	Not reported
Company Name:	BellSouth Telecommunications, LLC/DBA AT&T Georgia
Date Submitted:	01/13/2016
Filing Type:	302; 312
SIC Code:	4813
NAICS Code:	517110
Dun&Bradstreet Code:	185035813
Chemicals Same as Last Year:	Not reported
Data Tier 2 Signed:	Not reported
Dikes/Saveguard Measures:	Not reported
Facility Department:	Not reported
Facility Date Modified:	01/13/2016
State Fees Total:	Not reported
Mailing Address:	Not reported
Mailing City,St,Zip:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Mailing Country: Not reported
Latitude: 32.838340
Longitude: -83.631869
Lat/Long Location Desc: Not reported
Lat/Long Method: Not reported
Number Employees on Site: Not reported
Site Coordinate Abbrvtns Sbmtd: Not reported
Fire District: Not reported
Notes: Not reported
Validity: Not reported

Inventory:

Facility Id: 5372817
Year: 2015
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71700.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71700.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: EH&S Hotline
Contact Type: Fac. Emergency Coordinator
Email: knowehs@ems.att.com
Phone1: 1-800-KNOWEHS (1-800-566-
Phone2: 1-800-KNOWEHS (1-800-566-
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 5372817
Year: 2015
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71700.0
Average Daily Amount Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71700.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: EH&S Hotline
Contact Type: Fac. Emergency Coordinator
Email: knowehs@ems.att.com
Phone1: 1-800-KNOWEHS (1-800-566-
Phone2: 1-800-KNOWEHS (1-800-566-
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 5372817
Year: 2015
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71700.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71700.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Solid: False
Facility Name: BellSouth - RE021
Contact Info: EH&S Hotline
Contact Type: Fac. Emergency Coordinator
Email: knowehs@ems.att.com
Phone1: 1-800-KNOWEHS (1-800-566-
Phone2: 1-800-KNOWEHS (1-800-566-
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported

Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 5372817
Year: 2015
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71700.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71700.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: EH&S Hotline
Contact Type: Fac. Emergency Coordinator
Email: knowehs@ems.att.com
Phone1: 1-800-KNOWEHS (1-800-566-
Phone2: 1-800-KNOWEHS (1-800-566-
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported

Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 5372817
Year: 2015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71700.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71700.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: EH&S Hotline
Contact Type: Fac. Emergency Coordinator
Email: knowehs@ems.att.com
Phone1: 1-800-KNOWEHS (1-800-566-
Phone2: 1-800-KNOWEHS (1-800-566-
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 5372817
Year: 2015
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71700.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71700.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Mixture Form:	False
Sudden Release of Pressure Hazard:	False
Pure Form:	True
Reactive Hazard:	False
Solid:	False
Facility Name:	BellSouth - RE021
Contact Info:	EH&S Hotline
Contact Type:	Fac. Emergency Coordinator
Email:	knowehs@ems.att.com
Phone1:	1-800-KNOWEHS (1-800-566-
Phone2:	1-800-KNOWEHS (1-800-566-
Phone3:	Not reported
Phone4:	Not reported
Phone5:	Not reported
Hazardous 1 least hazardous/4 most hazardous:	0
Flammable 1 least flammable/4 most flammable:	2
Reactive 1 least reactive/4 very reactive:	0
Any characteristic over/above H F and R category:	-
Reporting Year:	2014
Facility ID:	4985300
Facility Country:	Not reported
Company Name:	BellSouth Telecommunications, LLC/DBA AT&T Georgia
Date Submitted:	01/15/2015
Filing Type:	302Tier2
SIC Code:	4813
NAICS Code:	517110
Dun&Bradstreet Code:	185035813
Chemicals Same as Last Year:	Not reported
Data Tier 2 Signed:	Not reported
Dikes/Saveguard Measures:	Not reported
Facility Department:	Not reported
Facility Date Modified:	07/01/2015
State Fees Total:	Not reported
Mailing Address:	Not reported
Mailing City,St,Zip:	Not reported
Mailing Country:	Not reported
Latitude:	32.838340
Longitude:	-83.631869
Lat/Long Location Desc:	Not reported
Lat/Long Method:	Not reported
Number Employees on Site:	Not reported
Site Coordinate Abbrvtns Sbmtrd:	Not reported
Fire District:	Not reported
Notes:	Not reported
Validity:	Not reported
Reporting Year:	2012
Facility ID:	4024590
Facility Country:	Not reported
Company Name:	BellSouth - RE021
Date Submitted:	Not reported
Filing Type:	Not reported
SIC Code:	Not reported
NAICS Code:	Not reported
Dun&Bradstreet Code:	Not reported
Chemicals Same as Last Year:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Data Tier 2 Signed: 01/08/2013
Dikes/Saveguard Measures: Not reported
Facility Department: Not reported
Facility Date Modified: 01/08/2013
State Fees Total: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Mailing Country: Not reported
Latitude: 32.83831
Longitude: -83.63186
Lat/Long Location Desc: Not reported
Lat/Long Method: Not reported
Number Employees on Site: Not reported
Site Coordinate Abbrvtns Sbmtd: Not reported
Fire District: Not reported
Notes: Not reported
Validity: Not reported
Contact 1: EH&S Hotline
Contact Type 1: Alternate Contact
Contact Email 1: Not reported
Contact 1 Telephone1: 1-800-KNOWEHS (1-800-566-9347)
Contact 1 Telephone2: Not reported
Contact 1 Phone3: Not reported
Contact Name 2: FRANK ALBERT
Contact Type 2: Emergency Contact
Contact Email 2: ba3745@us.att.com
Contact 2 Telephone1: (706) 729-5502
Contact 2 Telephone2: 1-800-566-9347
Contact Name 3: BellSouth Telecommunications, LLC/DBA AT&T
Contact Type 3: Owner / Operator
Contact Email 3: sb0464@att.com
Contact 3 Telephone1: 904-614-5041
Contact 3 Telephone2: Not reported
Contact 3 Telephone3: Not reported
Contact Name 4: Not reported
Contact Type 4: Not reported
Contact Email 4: Not reported
Contact 4 Telephone1: Not reported
Contact 4 Telephone2: Not reported
Contact Name 5: Not reported
Contact Type 5: Not reported
Contact Email 5: Not reported
Contact 5 Telephone1: Not reported
Contact 5 Telephone2: Not reported
Contact 5 Telephone3: Not reported

Inventory:

Facility Id: 4024590
Year: 2012
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: FRANK ALBERT
Contact Type: Emergency Contact
Email: ba3745@us.att.com
Phone1: (706) 729-5502
Phone2: 1-800-566-9347
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 4024590
Year: 2012
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: FRANK ALBERT
Contact Type: Emergency Contact
Email: ba3745@us.att.com

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Phone1: (706) 729-5502
Phone2: 1-800-566-9347
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 4024590
Year: 2012
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: FRANK ALBERT
Contact Type: Emergency Contact
Email: ba3745@us.att.com
Phone1: (706) 729-5502
Phone2: 1-800-566-9347
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 4024590
Year: 2012
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: FRANK ALBERT
Contact Type: Emergency Contact
Email: ba3745@us.att.com
Phone1: (706) 729-5502
Phone2: 1-800-566-9347
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 4024590
Year: 2012
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Facility Name: BellSouth - RE021
Contact Info: FRANK ALBERT
Contact Type: Emergency Contact
Email: ba3745@us.att.com
Phone1: (706) 729-5502
Phone2: 1-800-566-9347
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported

Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Inventory:

Facility Id: 4024590
Year: 2012
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: BellSouth - RE021
Contact Info: FRANK ALBERT
Contact Type: Emergency Contact
Email: ba3745@us.att.com
Phone1: (706) 729-5502
Phone2: 1-800-566-9347
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported

Hazardous 1 least hazardous/4 most hazardous: 0
Flammable 1 least flammable/4 most flammable: 2
Reactive 1 least reactive/4 very reactive: 0
Any characteristic over/above H F and R category: -

Reporting Year: 2011
Facility ID: 2898615
Facility Country: Not reported
Company Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Date Submitted:	Not reported
Filing Type:	Not reported
SIC Code:	Not reported
NAICS Code:	Not reported
Dun&Bradstreet Code:	Not reported
Chemicals Same as Last Year:	Not reported
Data Tier 2 Signed:	01/24/2012
Dikes/Saveguard Measures:	Not reported
Facility Department:	Not reported
Facility Date Modified:	05/02/2012
State Fees Total:	Not reported
Mailing Address:	Not reported
Mailing City, St, Zip:	Not reported
Mailing Country:	Not reported
Latitude:	32.83831
Longitude:	-83.63186
Lat/Long Location Desc:	Not reported
Lat/Long Method:	Not reported
Number Employees on Site:	Not reported
Site Coordinate Abbrvtns Sbmtd:	Not reported
Fire District:	Not reported
Notes:	Not reported
Validity:	Not reported
Contact 1:	Not reported
Contact Type 1:	Not reported
Contact Email 1:	Not reported
Contact 1 Telephone1:	Not reported
Contact 1 Telephone2:	Not reported
Contact 1 Phone3:	Not reported
Contact Name 2:	Not reported
Contact Type 2:	Not reported
Contact Email 2:	Not reported
Contact 2 Telephone1:	Not reported
Contact 2 Telephone2:	Not reported
Contact Name 3:	Not reported
Contact Type 3:	Not reported
Contact Email 3:	Not reported
Contact 3 Telephone1:	Not reported
Contact 3 Telephone2:	Not reported
Contact 3 Telephone3:	Not reported
Contact Name 4:	Not reported
Contact Type 4:	Not reported
Contact Email 4:	Not reported
Contact 4 Telephone1:	Not reported
Contact 4 Telephone2:	Not reported
Contact Name 5:	Not reported
Contact Type 5:	Not reported
Contact Email 5:	Not reported
Contact 5 Telephone1:	Not reported
Contact 5 Telephone2:	Not reported
Contact 5 Telephone3:	Not reported

Inventory:

Facility Id:	2898615
Year:	2011
Chemical Inventory ID:	Not reported
Acute Health Risks:	True
Average Daily Amount:	71400.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Average Daily Amount Code:	Not reported
CB Record ID:	Not reported
Chemical Same as Last Year:	Not reported
Chronic Health Risk:	True
CAS Number:	68476346
EHS Substance:	Not reported
Last Modified:	Not reported
Days on Site:	Not reported
Chemical Name:	DIESEL FUEL #2 LOW SULFUR
Fire Hazard:	True
Gas:	False
Liquid:	True
Max Daily Amount:	71400.0
Max Daily Amount Code:	Not reported
Max Amount in Largest Container:	Not reported
Mixture Form:	False
Sudden Release of Pressure Hazard:	False
Pure Form:	True
Reactive Hazard:	False
Solid:	False
Facility Name:	Not reported
Contact Info:	Not reported
Contact Type:	Not reported
Email:	Not reported
Phone1:	Not reported
Phone2:	Not reported
Phone3:	Not reported
Phone4:	Not reported
Phone5:	Not reported
Hazardous 1 least hazardous/4 most hazardous:	Not reported
Flammable 1 least flammable/4 most flammable:	Not reported
Reactive 1 least reactive/4 very reactive:	Not reported
Any characteristic over/above H F and R category:	Not reported

Inventory:

Facility Id:	2898615
Year:	2011
Chemical Inventory ID:	Not reported
Acute Health Risks:	True
Average Daily Amount:	71400.0
Average Daily Amount Code:	Not reported
CB Record ID:	Not reported
Chemical Same as Last Year:	Not reported
Chronic Health Risk:	True
CAS Number:	68476346
EHS Substance:	Not reported
Last Modified:	Not reported
Days on Site:	Not reported
Chemical Name:	DIESEL FUEL #2 LOW SULFUR
Fire Hazard:	True
Gas:	False
Liquid:	True
Max Daily Amount:	71400.0
Max Daily Amount Code:	Not reported
Max Amount in Largest Container:	Not reported
Mixture Form:	False
Sudden Release of Pressure Hazard:	False
Pure Form:	True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Reactive Hazard:	False	
Solid:	False	
Facility Name:	Not reported	
Contact Info:	Not reported	
Contact Type:	Not reported	
Email:	Not reported	
Phone1:	Not reported	
Phone2:	Not reported	
Phone3:	Not reported	
Phone4:	Not reported	
Phone5:	Not reported	
Hazardous 1 least hazardous/4 most hazardous:		Not reported
Flammable 1 least flammable/4 most flammable:		Not reported
Reactive 1 least reactive/4 very reactive:		Not reported
Any characteristic over/above H F and R category:		Not reported

Inventory:

Facility Id:	2898615	
Year:	2011	
Chemical Inventory ID:	Not reported	
Acute Health Risks:	True	
Average Daily Amount:	71400.0	
Average Daily Amount Code:	Not reported	
CB Record ID:	Not reported	
Chemical Same as Last Year:	Not reported	
Chronic Health Risk:	True	
CAS Number:	68476346	
EHS Substance:	Not reported	
Last Modified:	Not reported	
Days on Site:	Not reported	
Chemical Name:	DIESEL FUEL #2 LOW SULFUR	
Fire Hazard:	True	
Gas:	False	
Liquid:	True	
Max Daily Amount:	71400.0	
Max Daily Amount Code:	Not reported	
Max Amount in Largest Container:	Not reported	
Mixture Form:	False	
Sudden Release of Pressure Hazard:	False	
Pure Form:	True	
Reactive Hazard:	False	
Solid:	False	
Facility Name:	Not reported	
Contact Info:	Not reported	
Contact Type:	Not reported	
Email:	Not reported	
Phone1:	Not reported	
Phone2:	Not reported	
Phone3:	Not reported	
Phone4:	Not reported	
Phone5:	Not reported	
Hazardous 1 least hazardous/4 most hazardous:		Not reported
Flammable 1 least flammable/4 most flammable:		Not reported
Reactive 1 least reactive/4 very reactive:		Not reported
Any characteristic over/above H F and R category:		Not reported

Inventory:

Facility Id:	2898615
--------------	---------

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Year: 2011
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported
Max Amount in Largest Container: Not reported
Mixture Form: False
Sudden Release of Pressure Hazard: False
Pure Form: True
Reactive Hazard: False
Solid: False
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported

Inventory:

Facility Id: 2898615
Year: 2011
Chemical Inventory ID: Not reported
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: Not reported
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: Not reported
Days on Site: Not reported
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: False
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Max Amount in Largest Container:	Not reported
Mixture Form:	False
Sudden Release of Pressure Hazard:	False
Pure Form:	True
Reactive Hazard:	False
Solid:	False
Facility Name:	Not reported
Contact Info:	Not reported
Contact Type:	Not reported
Email:	Not reported
Phone1:	Not reported
Phone2:	Not reported
Phone3:	Not reported
Phone4:	Not reported
Phone5:	Not reported
Hazardous 1 least hazardous/4 most hazardous:	Not reported
Flammable 1 least flammable/4 most flammable:	Not reported
Reactive 1 least reactive/4 very reactive:	Not reported
Any characteristic over/above H F and R category:	Not reported

Inventory:

Facility Id:	2898615
Year:	2011
Chemical Inventory ID:	Not reported
Acute Health Risks:	True
Average Daily Amount:	71400.0
Average Daily Amount Code:	Not reported
CB Record ID:	Not reported
Chemical Same as Last Year:	Not reported
Chronic Health Risk:	True
CAS Number:	68476346
EHS Substance:	Not reported
Last Modified:	Not reported
Days on Site:	Not reported
Chemical Name:	DIESEL FUEL #2 LOW SULFUR
Fire Hazard:	True
Gas:	False
Liquid:	True
Max Daily Amount:	71400.0
Max Daily Amount Code:	Not reported
Max Amount in Largest Container:	Not reported
Mixture Form:	False
Sudden Release of Pressure Hazard:	False
Pure Form:	True
Reactive Hazard:	False
Solid:	False
Facility Name:	Not reported
Contact Info:	Not reported
Contact Type:	Not reported
Email:	Not reported
Phone1:	Not reported
Phone2:	Not reported
Phone3:	Not reported
Phone4:	Not reported
Phone5:	Not reported
Hazardous 1 least hazardous/4 most hazardous:	Not reported
Flammable 1 least flammable/4 most flammable:	Not reported
Reactive 1 least reactive/4 very reactive:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Any characteristic over/above H F and R category: Not reported

Reporting Year: 2010
Facility ID: FATR2010JD9P9U716WV
Facility Country: USA
Company Name: Not reported
Date Submitted: Not reported
Filing Type: Not reported
SIC Code: Not reported
NAICS Code: Not reported
Dun&Bradstreet Code: Not reported
Chemicals Same as Last Year: Not reported
Data Tier 2 Signed: 01/03/2011
Dikes/Saveguard Measures: Not reported
Facility Department: BellSouth - RE021
Facility Date Modified: 01/17/2011
State Fees Total: Not reported
Mailing Address: 7825 Red Top Road
Mailing City,St,Zip: Macclenny, FL 32063
Mailing Country: USA
Latitude: 32.83833
Longitude: -83.63191
Lat/Long Location Desc: Not reported
Lat/Long Method: Not reported
Number Employees on Site: 16
Site Coordinate Abbrvtns Sbmtd: Not reported
Fire District: Not reported
Notes: Not reported
Validity: Not reported

Inventory:

Facility Id: FATR2010JD9P9U716WV
Year: 2010
Chemical Inventory ID: CVTR2010JD9P9U0020N
Acute Health Risks: True
Average Daily Amount: 618.0
Average Daily Amount Code: 02
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 7664939
EHS Substance: True
Last Modified: 01/17/2011
Days on Site: 365
Chemical Name: SULFURIC ACID
Fire Hazard: Not reported
Gas: Not reported
Liquid: True
Max Daily Amount: 618.0
Max Daily Amount Code: 02
Max Amount in Largest Container: 618.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: True
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2010
Substance Amount: 618.0
Units: pounds
Storage Type: R
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: VHO - 6 th
Substance Last Modified: 9/8/2011

Inventory:
Facility Id: FATR2010JD9P9U716WV
Year: 2010
Chemical Inventory ID: CVTR2010JD9P9U0020N
Acute Health Risks: True
Average Daily Amount: 618.0
Average Daily Amount Code: 02
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 7664939
EHS Substance: True
Last Modified: 01/17/2011
Days on Site: 365
Chemical Name: SULFURIC ACID
Fire Hazard: Not reported
Gas: Not reported
Liquid: True
Max Daily Amount: 618.0
Max Daily Amount Code: 02
Max Amount in Largest Container: 618.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: True
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Any characteristic over/above H F and R category: Not reported
Year: 2010
Substance Amount: 618.0
Units: pounds
Storage Type: R
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: VHO - 6 th
Substance Last Modified: 9/8/2011

Inventory:

Facility Id: FATR2010JD9P9U716WV
Year: 2010
Chemical Inventory ID: CVTR2010JD9P9U0020N
Acute Health Risks: True
Average Daily Amount: 618.0
Average Daily Amount Code: 02
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 7664939
EHS Substance: True
Last Modified: 01/17/2011
Days on Site: 365
Chemical Name: SULFURIC ACID
Fire Hazard: Not reported
Gas: Not reported
Liquid: True
Max Daily Amount: 618.0
Max Daily Amount Code: 02
Max Amount in Largest Container: 618.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: True
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported

Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2010
Substance Amount: 618.0
Units: pounds
Storage Type: R
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: VHO - 6 th
Substance Last Modified: 9/8/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Inventory:

Facility Id:	FATR2010JD9P9U716WV	
Year:	2010	
Chemical Inventory ID:	CVTR2010JD9P9U0020N	
Acute Health Risks:	True	
Average Daily Amount:	618.0	
Average Daily Amount Code:	02	
CB Record ID:	Not reported	
Chemical Same as Last Year:	Not reported	
Chronic Health Risk:	True	
CAS Number:	7664939	
EHS Substance:	True	
Last Modified:	01/17/2011	
Days on Site:	365	
Chemical Name:	SULFURIC ACID	
Fire Hazard:	Not reported	
Gas:	Not reported	
Liquid:	True	
Max Daily Amount:	618.0	
Max Daily Amount Code:	02	
Max Amount in Largest Container:	618.0	
Mixture Form:	Not reported	
Sudden Release of Pressure Hazard:	Not reported	
Pure Form:	True	
Reactive Hazard:	True	
Solid:	Not reported	
Facility Name:	Not reported	
Contact Info:	Not reported	
Contact Type:	Not reported	
Email:	Not reported	
Phone1:	Not reported	
Phone2:	Not reported	
Phone3:	Not reported	
Phone4:	Not reported	
Phone5:	Not reported	
Hazardous 1 least hazardous/4 most hazardous:		Not reported
Flammable 1 least flammable/4 most flammable:		Not reported
Reactive 1 least reactive/4 very reactive:		Not reported
Any characteristic over/above H F and R category:		Not reported
Year:	2010	
Substance Amount:	618.0	
Units:	pounds	
Storage Type:	R	
Storage Pressure Code:	1	
Storage Temperature Code:	4	
Substance Location:	VHO - 6 th	
Substance Last Modified:	9/8/2011	

Inventory:

Facility Id:	FATR2010JD9P9U716WV	
Year:	2010	
Chemical Inventory ID:	CVTR2010JD9P9U0020N	
Acute Health Risks:	True	
Average Daily Amount:	618.0	
Average Daily Amount Code:	02	
CB Record ID:	Not reported	
Chemical Same as Last Year:	Not reported	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Chronic Health Risk: True
CAS Number: 7664939
EHS Substance: True
Last Modified: 01/17/2011
Days on Site: 365
Chemical Name: SULFURIC ACID
Fire Hazard: Not reported
Gas: Not reported
Liquid: True
Max Daily Amount: 618.0
Max Daily Amount Code: 02
Max Amount in Largest Container: 618.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: True
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2010
Substance Amount: 618.0
Units: pounds
Storage Type: R
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: VHO - 6 th
Substance Last Modified: 9/8/2011

Inventory:

Facility Id: FATR2010JD9P9U716WV
Year: 2010
Chemical Inventory ID: CVTR2010JD9P9U0020N
Acute Health Risks: True
Average Daily Amount: 618.0
Average Daily Amount Code: 02
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 7664939
EHS Substance: True
Last Modified: 01/17/2011
Days on Site: 365
Chemical Name: SULFURIC ACID
Fire Hazard: Not reported
Gas: Not reported
Liquid: True
Max Daily Amount: 618.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Max Daily Amount Code:	02	
Max Amount in Largest Container:	618.0	
Mixture Form:	Not reported	
Sudden Release of Pressure Hazard:	Not reported	
Pure Form:	True	
Reactive Hazard:	True	
Solid:	Not reported	
Facility Name:	Not reported	
Contact Info:	Not reported	
Contact Type:	Not reported	
Email:	Not reported	
Phone1:	Not reported	
Phone2:	Not reported	
Phone3:	Not reported	
Phone4:	Not reported	
Phone5:	Not reported	
Hazardous 1 least hazardous/4 most hazardous:		Not reported
Flammable 1 least flammable/4 most flammable:		Not reported
Reactive 1 least reactive/4 very reactive:		Not reported
Any characteristic over/above H F and R category:		Not reported
Year:	2010	
Substance Amount:	618.0	
Units:	pounds	
Storage Type:	R	
Storage Pressure Code:	1	
Storage Temperature Code:	4	
Substance Location:	VHO - 6 th	
Substance Last Modified:	9/8/2011	
Reporting Year:	2009	
Facility ID:	FATR2009HQL6QN28743K	
Facility Country:	USA	
Company Name:	Not reported	
Date Submitted:	Not reported	
Filing Type:	Not reported	
SIC Code:	Not reported	
NAICS Code:	Not reported	
Dun&Bradstreet Code:	Not reported	
Chemicals Same as Last Year:	Not reported	
Data Tier 2 Signed:	01/04/2010	
Dikes/Saveguard Measures:	Not reported	
Facility Department:	BellSouth - RE021	
Facility Date Modified:	Not reported	
State Fees Total:	Not reported	
Mailing Address:	7825 Red Top Road	
Mailing City,St,Zip:	Macclenny, FL 32063	
Mailing Country:	USA	
Latitude:	0.000000	
Longitude:	0.000000	
Lat/Long Location Desc:	Not reported	
Lat/Long Method:	Not reported	
Number Employees on Site:	24	
Site Coordinate Abbrvtns Sbmtd:	Not reported	
Fire District:	Not reported	
Notes:	Not reported	
Validity:	Not reported	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Facility Info:

Year: 2009
Facility ID Description: Unknown
Facility ID Type: NAICS
Facility ID Last Modified: Not reported
ID: 517110

Year: 2009
Facility ID Description: Unknown
Facility ID Type: SIC
Facility ID Last Modified: Not reported
ID: 4813

Year: 2009
Facility ID Description: other
Facility ID Type: Dun & Bradstreet
Facility ID Last Modified: Not reported
ID: 185035813

Inventory:

Facility Id: FATR2009HQL6QN28743K
Year: 2009
Chemical Inventory ID: CVTR2009HQL6QN001D
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: 04
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: 9/7/2010
Days on Site: 365
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: Not reported
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: 04
Max Amount in Largest Container: 71400.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: Not reported
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\IR2110 (Continued)

S107749928

Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2009
Substance Amount: 71400.0
Units: pounds
Storage Type: B
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: N/A - N/A
Substance Last Modified: 9/7/2010

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8485C
Contact Title: Property Manager
Contact First Name: FRANK
Contact Last Name: ALBERT
Contact Email: ba3745@asemail.att.com
Contact Mail Address: 937 GREENE ST
Contact Mail City,St,Zip: AUGUSTA, GA 30901
Contact Mail Country: USA
Contact Type: Emergency Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8484C
Contact Title: Alternative Contact (IMS/EPCRA)
Contact First Name: EH&S
Contact Last Name: Hotline
Contact Email: Not reported
Contact Mail Address: Not reported
Contact Mail City,St,Zip: Not reported
Contact Mail Country: USA
Contact Type: Alternate Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8486C
Contact Title: EHS Manager
Contact First Name: Sara
Contact Last Name: Buford
Contact Email: sb0464@att.com
Contact Mail Address: 7825 Red Top Road
Contact Mail City,St,Zip: Macclenny, FL 32063
Contact Mail Country: USA
Contact Type: Owner / Operator
Contact Modification Date: Not reported

Facility Info:
Year: 2009
Facility ID Description: Unknown
Facility ID Type: NAICS
Facility ID Last Modified: Not reported
ID: 517110

Year: 2009
Facility ID Description: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Facility ID Type: SIC
Facility ID Last Modified: Not reported
ID: 4813

Year: 2009
Facility ID Description: other
Facility ID Type: Dun & Bradstreet
Facility ID Last Modified: Not reported
ID: 185035813

Inventory:

Facility Id: FATR2009HQL6QN28743K
Year: 2009
Chemical Inventory ID: CVTR2009HQL6QN001D
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: 04
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: 9/7/2010
Days on Site: 365
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: Not reported
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: 04
Max Amount in Largest Container: 71400.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: Not reported
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2009
Substance Amount: 71400.0
Units: pounds
Storage Type: B
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: N/A - N/A
Substance Last Modified: 9/7/2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\IMACON MAIN\R2110 (Continued)

S107749928

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8485C
Contact Title: Property Manager
Contact First Name: FRANK
Contact Last Name: ALBERT
Contact Email: ba3745@asemail.att.com
Contact Mail Address: 937 GREENE ST
Contact Mail City,St,Zip: AUGUSTA, GA 30901
Contact Mail Country: USA
Contact Type: Emergency Contact
Contact Modification Date: Not reported

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8484C
Contact Title: Alternative Contact (IMS/EPCRA)
Contact First Name: EH&S
Contact Last Name: Hotline
Contact Email: Not reported
Contact Mail Address: Not reported
Contact Mail City,St,Zip: Not reported
Contact Mail Country: USA
Contact Type: Alternate Contact
Contact Modification Date: Not reported

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8486C
Contact Title: EHS Manager
Contact First Name: Sara
Contact Last Name: Buford
Contact Email: sb0464@att.com
Contact Mail Address: 7825 Red Top Road
Contact Mail City,St,Zip: Macclenny, FL 32063
Contact Mail Country: USA
Contact Type: Owner / Operator
Contact Modification Date: Not reported

Facility Info:

Year: 2009
Facility ID Description: Unknown
Facility ID Type: NAICS
Facility ID Last Modified: Not reported
ID: 517110

Year: 2009
Facility ID Description: Unknown
Facility ID Type: SIC
Facility ID Last Modified: Not reported
ID: 4813

Year: 2009
Facility ID Description: other
Facility ID Type: Dun & Bradstreet
Facility ID Last Modified: Not reported
ID: 185035813

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Inventory:

Facility Id: FATR2009HQL6QN28743K
Year: 2009
Chemical Inventory ID: CVTR2009HQL6QN001D
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: 04
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: 9/7/2010
Days on Site: 365
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: Not reported
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: 04
Max Amount in Largest Container: 71400.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: Not reported
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2009
Substance Amount: 71400.0
Units: pounds
Storage Type: B
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: N/A - N/A
Substance Last Modified: 9/7/2010

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8485C
Contact Title: Property Manager
Contact First Name: FRANK
Contact Last Name: ALBERT
Contact Email: ba3745@asemail.att.com
Contact Mail Address: 937 GREENE ST
Contact Mail City, St, Zip: AUGUSTA, GA 30901

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Contact Mail Country: USA
Contact Type: Emergency Contact
Contact Modification Date: Not reported

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8484C
Contact Title: Alternative Contact (IMS/EPCRA)
Contact First Name: EH&S
Contact Last Name: Hotline
Contact Email: Not reported
Contact Mail Address: Not reported
Contact Mail City,St,Zip: Not reported
Contact Mail Country: USA
Contact Type: Alternate Contact
Contact Modification Date: Not reported

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8486C
Contact Title: EHS Manager
Contact First Name: Sara
Contact Last Name: Buford
Contact Email: sb0464@att.com
Contact Mail Address: 7825 Red Top Road
Contact Mail City,St,Zip: Macclenny, FL 32063
Contact Mail Country: USA
Contact Type: Owner / Operator
Contact Modification Date: Not reported

Facility Info:

Year: 2009
Facility ID Description: Unknown
Facility ID Type: NAICS
Facility ID Last Modified: Not reported
ID: 517110

Year: 2009
Facility ID Description: Unknown
Facility ID Type: SIC
Facility ID Last Modified: Not reported
ID: 4813

Year: 2009
Facility ID Description: other
Facility ID Type: Dun & Bradstreet
Facility ID Last Modified: Not reported
ID: 185035813

Inventory:

Facility Id: FATR2009HQL6QN28743K
Year: 2009
Chemical Inventory ID: CVTR2009HQL6QN001D
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: 04
CB Record ID: Not reported
Chemical Same as Last Year: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: 9/7/2010
Days on Site: 365
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: Not reported
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: 04
Max Amount in Largest Container: 71400.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: Not reported
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2009
Substance Amount: 71400.0
Units: pounds
Storage Type: B
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: N/A - N/A
Substance Last Modified: 9/7/2010

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8485C
Contact Title: Property Manager
Contact First Name: FRANK
Contact Last Name: ALBERT
Contact Email: ba3745@asemail.att.com
Contact Mail Address: 937 GREENE ST
Contact Mail City, St, Zip: AUGUSTA, GA 30901
Contact Mail Country: USA
Contact Type: Emergency Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8484C
Contact Title: Alternative Contact (IMS/EPCRA)
Contact First Name: EH&S
Contact Last Name: Hotline

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\R2110 (Continued)

S107749928

Contact Email: Not reported
Contact Mail Address: Not reported
Contact Mail City,St,Zip: Not reported
Contact Mail Country: USA
Contact Type: Alternate Contact
Contact Modification Date: Not reported

Contact:

Year: 2009
Contact ID: CTTR2009HQL6QN8486C
Contact Title: EHS Manager
Contact First Name: Sara
Contact Last Name: Buford
Contact Email: sb0464@att.com
Contact Mail Address: 7825 Red Top Road
Contact Mail City,St,Zip: Macclenny, FL 32063
Contact Mail Country: USA
Contact Type: Owner / Operator
Contact Modification Date: Not reported

Facility Info:

Year: 2009
Facility ID Description: Unknown
Facility ID Type: NAICS
Facility ID Last Modified: Not reported
ID: 517110

Year: 2009
Facility ID Description: Unknown
Facility ID Type: SIC
Facility ID Last Modified: Not reported
ID: 4813

Year: 2009
Facility ID Description: other
Facility ID Type: Dun & Bradstreet
Facility ID Last Modified: Not reported
ID: 185035813

Inventory:

Facility Id: FATR2009HQL6QN28743K
Year: 2009
Chemical Inventory ID: CVTR2009HQL6QN001D
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: 04
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: 9/7/2010
Days on Site: 365
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: Not reported
Liquid: True
Max Daily Amount: 71400.0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Max Daily Amount Code: 04
Max Amount in Largest Container: 71400.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: Not reported
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported
Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2009
Substance Amount: 71400.0
Units: pounds
Storage Type: B
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: N/A - N/A
Substance Last Modified: 9/7/2010

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8485C
Contact Title: Property Manager
Contact First Name: FRANK
Contact Last Name: ALBERT
Contact Email: ba3745@asemail.att.com
Contact Mail Address: 937 GREENE ST
Contact Mail City,St,Zip: AUGUSTA, GA 30901
Contact Mail Country: USA
Contact Type: Emergency Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8484C
Contact Title: Alternative Contact (IMS/EPCRA)
Contact First Name: EH&S
Contact Last Name: Hotline
Contact Email: Not reported
Contact Mail Address: Not reported
Contact Mail City,St,Zip: Not reported
Contact Mail Country: USA
Contact Type: Alternate Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8486C
Contact Title: EHS Manager

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Contact First Name: Sara
Contact Last Name: Buford
Contact Email: sb0464@att.com
Contact Mail Address: 7825 Red Top Road
Contact Mail City,St,Zip: Macclenny, FL 32063
Contact Mail Country: USA
Contact Type: Owner / Operator
Contact Modification Date: Not reported

Facility Info:

Year: 2009
Facility ID Description: Unknown
Facility ID Type: NAICS
Facility ID Last Modified: Not reported
ID: 517110

Year: 2009
Facility ID Description: Unknown
Facility ID Type: SIC
Facility ID Last Modified: Not reported
ID: 4813

Year: 2009
Facility ID Description: other
Facility ID Type: Dun & Bradstreet
Facility ID Last Modified: Not reported
ID: 185035813

Inventory:

Facility Id: FATR2009HQL6QN28743K
Year: 2009
Chemical Inventory ID: CVTR2009HQL6QN001D
Acute Health Risks: True
Average Daily Amount: 71400.0
Average Daily Amount Code: 04
CB Record ID: Not reported
Chemical Same as Last Year: Not reported
Chronic Health Risk: True
CAS Number: 68476346
EHS Substance: Not reported
Last Modified: 9/7/2010
Days on Site: 365
Chemical Name: DIESEL FUEL #2 LOW SULFUR
Fire Hazard: True
Gas: Not reported
Liquid: True
Max Daily Amount: 71400.0
Max Daily Amount Code: 04
Max Amount in Largest Container: 71400.0
Mixture Form: Not reported
Sudden Release of Pressure Hazard: Not reported
Pure Form: True
Reactive Hazard: Not reported
Solid: Not reported
Facility Name: Not reported
Contact Info: Not reported
Contact Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BST\MACON MAIN\IR2110 (Continued)

S107749928

Email: Not reported
Phone1: Not reported
Phone2: Not reported
Phone3: Not reported
Phone4: Not reported
Phone5: Not reported
Hazardous 1 least hazardous/4 most hazardous: Not reported
Flammable 1 least flammable/4 most flammable: Not reported
Reactive 1 least reactive/4 very reactive: Not reported
Any characteristic over/above H F and R category: Not reported
Year: 2009
Substance Amount: 71400.0
Units: pounds
Storage Type: B
Storage Pressure Code: 1
Storage Temperature Code: 4
Substance Location: N/A - N/A
Substance Last Modified: 9/7/2010

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8485C
Contact Title: Property Manager
Contact First Name: FRANK
Contact Last Name: ALBERT
Contact Email: ba3745@asemail.att.com
Contact Mail Address: 937 GREENE ST
Contact Mail City,St,Zip: AUGUSTA, GA 30901
Contact Mail Country: USA
Contact Type: Emergency Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8484C
Contact Title: Alternative Contact (IMS/EPCRA)
Contact First Name: EH&S
Contact Last Name: Hotline
Contact Email: Not reported
Contact Mail Address: Not reported
Contact Mail City,St,Zip: Not reported
Contact Mail Country: USA
Contact Type: Alternate Contact
Contact Modification Date: Not reported

Contact:
Year: 2009
Contact ID: CTTR2009HQL6QN8486C
Contact Title: EHS Manager
Contact First Name: Sara
Contact Last Name: Buford
Contact Email: sb0464@att.com
Contact Mail Address: 7825 Red Top Road
Contact Mail City,St,Zip: Macclenny, FL 32063
Contact Mail Country: USA
Contact Type: Owner / Operator
Contact Modification Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

O89 LOCKSMITH ASSOCIATES
SW 551 PLUM STREET
1/4-1/2 MACON, GA 31201
0.449 mi.
2369 ft. Site 1 of 2 in cluster O

LUST U003763182
UST N/A
Financial Assurance

Relative:
Higher

LUST:

Facility ID: 09011209
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 06/06/2000
Project Officer: Logan, William E.

Actual:
334 ft.

Facility:

Facility Id: 9011209
Facility Status: Closed
Facility Type: Other
District: West Central
Contact Id: 8702
Owner Name: GEORGE YOUMANS
Owner Address: 2020 RIVERSIDE DRIVE
Owner City: MACON
Owner State: GA
Owner Zip: 31204
Owner City, St, Zip: MACON, GA 31204
Owner Telephone: 912-746-2020

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Closed In Ground
Status Date: 05/01/2000

Tank ID: 1
Product1: Diesel
Material: Bare Steel
Capacity: 500
Pipe Material: Not Marked
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Installed
Status Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKSMITH ASSOCIATES (Continued)

U003763182

Tank ID: 2
Status: Closed In Ground
Status Date: 05/01/2000

Tank ID: 2
Product1: Diesel
Material: Bare Steel
Capacity: 500
Pipe Material: Not Marked
Pipe Type: Not Marked
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 9011209
Financial Responsibility: Not Marked

P90
NW
1/4-1/2
0.449 mi.
2370 ft.

MORGAN TIRE & AUTO INC
852 RIVERSIDE DRIVE
MACON, GA 31201

GA NON-HSI **U003763176**
LUST **N/A**
UST
Financial Assurance

Site 1 of 2 in cluster P

Relative:
Higher

NON HSI:
Latitude: 32.84277
Longitude: 83.628889
Ground Water Pathway Score: 4.30
On-Site Pathway Score: 8.30
Report Date: 11/13/2013
Additional Info: Not reported
Contamination: acetone

Actual:
339 ft.

LUST:

Facility ID: 09011203
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 06/27/2000
Project Officer: Logan, William E.

Facility:

Facility Id: 9011203
Facility Status: Closed
Facility Type: Other
District: West Central
Contact Id: 8695
Owner Name: F DON BRADFORD
Owner Address: P O BOX 2371
Owner City: MACON
Owner State: GA
Owner Zip: 31203
Owner City,St,Zip: MACON, GA 31203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN TIRE & AUTO INC (Continued)

U003763176

Owner Telephone: 912-743-6371

Tanks:

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 05/02/2000

Tank ID: 1
Status: Installed
Status Date: 01/01/1984

Tank ID: 1
Product1: Used Oil
Material: Marked Unknown
Capacity: 0
Pipe Material: Unknown
Pipe Type: Not Marked
Overfill Protection: Yes
Overfill Installed: Not reported
Tank Exempt From Spill: Yes
Date Spill Device Installed: Not reported

GA Financial Assurance 1:

Region: 1
Facility ID: 9011203
Financial Responsibility: Other (REV Code 0)

Q91
SSW
1/4-1/2
0.450 mi.
2374 ft.

FORMER CURTIS MATHIS FACILITY
600 BROADWAY DRIVE
MACON, GA 31201
Site 1 of 2 in cluster Q

LUST **U003763175**
UST **N/A**
Financial Assurance

Relative:
Higher

LUST:

Facility ID: 09011202
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA -Monitoring Only (MNA)
Date Received: 04/12/2000
Project Officer: Wallace,Ronald J

Actual:
326 ft.

Facility:

Facility Id: 9011202
Facility Status: Closed
Facility Type: Gas Station
District: West Central
Contact Id: 8693
Owner Name: CURTIS MATHIS
Owner Address: RT 6 BOX 246
Owner City: BURNSVILLE
Owner State: NC
Owner Zip: 38714

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER CURTIS MATHIS FACILITY (Continued)

U003763175

Owner City,St,Zip: BURNSVILLE, NC 38714
Owner Telephone: 828-682-7550

Tanks:

Tank ID: 1
Status: Installed
Status Date: Not reported

Tank ID: 1
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 1
Status: Removed From Ground
Status Date: 12/01/1999

Tank ID: 1
Product1: Gas
Material: Bare Steel
Capacity: 2000
Pipe Material: Bare Steel
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 2
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 2
Status: Installed
Status Date: Not reported

Tank ID: 2
Status: Removed From Ground
Status Date: 12/01/1999

Tank ID: 2
Product1: Gas
Material: Bare Steel
Capacity: 2000
Pipe Material: Bare Steel
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 3
Status: Installed
Status Date: Not reported

Tank ID: 3
Status: Upgrade Repair Not Marked
Status Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER CURTIS MATHIS FACILITY (Continued)

U003763175

Tank ID: 3
Status: Removed From Ground
Status Date: 12/01/1999

Tank ID: 3
Product1: Diesel
Material: Bare Steel
Capacity: 1000
Pipe Material: Bare Steel
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

Tank ID: 4
Status: Upgrade Repair Not Marked
Status Date: Not reported

Tank ID: 4
Status: Installed
Status Date: Not reported

Tank ID: 4
Status: Removed From Ground
Status Date: 12/01/1999

Tank ID: 4
Product1: Heating Oil
Material: Bare Steel
Capacity: 550
Pipe Material: Bare Steel
Pipe Type: Suction: No Valve At The Tank
Overfill Protection: Not reported
Overfill Installed: Not reported
Tank Exempt From Spill: Not reported
Date Spill Device Installed: Not reported

GA Financial Assurance 1:
Region: 1
Facility ID: 9011202
Financial Responsibility: Not Marked

R92
WSW
1/4-1/2
0.453 mi.
2392 ft.

FORMER SERVICE STATION
489 COTTON AVENUE
MACON, GA 31201

Site 1 of 3 in cluster R

LUST S111868573
N/A

Relative:
Higher

Actual:
365 ft.

LUST:
Facility ID: 10002090
Leak ID: 1
Description: Confirmed Release
Cleanup Status: NFA - No Further Action
Date Received: 03/22/2012
Project Officer: Wallace,Ronald J